


CAMP
Aviation from the ground up™

CAMP SYSTEMS INTERNATIONAL, LLC
LONG ISLAND MAC ARTHUR AIRPORT
999 MARCONI AVE.
RONKONKOMA, NY 11779

POSTAL

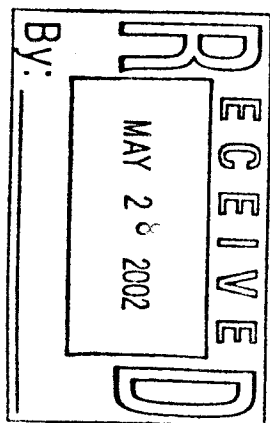

R&S AIRCRAFT INVESTMENTS, LLC
ATTN: YANDELL ROGERS III
P.O. BOX 43
HOUSTON, TX 77001-0043



ModelName: 1124A WESTWIND 368
RegNo: N368MD

PLEASE FILL IN THE INFORMATION REQUESTED BELOW AND RETURN CARD TO
CAMP SYSTEMS, INT'L.

1124 WESTWIND368

Y06/02 UNITED STATES OF AMERICA

AIRCRAFT MODEL _____

RECORD PRESENT:

AIRCRAFT HOURS _____ **LANDINGS** _____

NO. 1 ENG. HOURS _____ **CYCLES** _____

NO. 2 ENG. HOURS _____ **CYCLES** _____

NO. 3 ENG. HOURS _____ **CYCLES** _____

NO. 4 ENG. HOURS _____ **CYCLES** _____

APU HOURS _____ **STARTS** _____

DATE _____

OWNER: R&S AIRCRAFT INVESTMENTS, LLC
ADDRESS: P.O. BOX 43 HOUSTON TX 77001-0043

OPERATOR: R&S AIRCRAFT INVESTMENTS, LLC
ADDRESS: P.O. BOX 43 HOUSTON TX 77001-0043

PHONE: 713-830-9584
FAX: 713-918-5925

PHONE: 713-830-9584
FAX: 713-918-5925

AIRCRAFT

S/N: 368

REG NO: N368MD

MODEL: 1124A WESTWIND

MANUFACTURER: GULFSTREAM AEROSPACE CORPORATION

NOTE:
INSPECTION PROGRAM: 3
CERTIFICATE DATE: 11-FEB-1982

UOM	LAST ACTUAL	LAST ACTUAL DATE
HRS	7806	28-FEB-2002
AFL	5706	28-FEB-2002

ENGINE NO. 1

S/N: P-77482

PART NO: 3072500-2

MODEL: TFE731-3

MANUFACTURER: HONEYWELL

INSTALLED DATE: 4/3/1989
A/C HRS: 4215
ENGINE HRS: 3972
ENGINE CYCLES: 2456

UOM	LAST ACTUAL	LAST ACTUAL DATE
HRS	7806	28-FEB-2002
ENC	0	
(AFL)	5706	28-FEB-2002

ENGINE NO. 2

S/N: P77488

PART NO: 3072500-2

MODEL: TFE731-3

MANUFACTURER: HONEYWELL

INSTALLED DATE: 5/31/1993
A/C HRS: 5278
ENGINE HRS: 5227
ENGINE CYCLES: 3867

UOM	LAST ACTUAL	LAST ACTUAL DATE
HRS	7806	28-FEB-2002
ENC	0	
(AFL)	5706	28-FEB-2002



AIRCRAFT Status Report
 (Work Packages)
 (Alphabetical with Relations)

Report Date **13-MAY-2002**

Aircraft Model - 1124 WESTWIND
 Owner Name R&S AIRCRAFT INVESTMENTS, LLC
 A/C Serial #: 368 A/C Reg. #: N368MD

ITEMNO	TASK DESCRIPTION	UNIT	ACT	INTERVAL	TIME-----AT-----	INSTALLATION	COMPLIANCE	DISPOSITION	AREA
WORKCARD	PKG NUMBER				TSN TSO TSR TSI ADJ	Warr Exp		NEXT DUE	PRICE
									LABOR HRS
AIRCRAFT									
CHAPTER 05 TIME LIMITS/MAINTENANCE CHECKS									
+ 050150U	200 HOUR INSPECTION								
	PKG 1 in PKG 2, 3	MOS	R				26-JUN-2001		
		HRS/MSC		200			7687	7887	31
	REF:	AFL					5594		
+ 050300U	400/200 HOUR INSPECTION								
	PKG 2 in PKG 3	MOS	R				26-JUN-2001		
		HRS/MSC		400			7687	8087	45.5
	REF:	AFL					5594		
+ 050600U	800/400/200 HOUR INSPECT								
	PKG 3	MOS	R				26-JUL-2000		
		HRS/MSC		800		-38	7325	8087	45.5
	REF:	AFL					5360		
+ 057110U	150HR #1 ENGINE INSP NO. 1								E1
	PKG 4	MOS					26-JUN-2001		
		HRS/MSC		150			7687		1.5
	REF:	AFL					5594		
+ 057110U	150HR #2 ENGINE INSP NO. 2								E2
	PKG 5	MOS					26-JUN-2001		
		HRS/MSC		150			7687		1
	REF:	AFL					5594		
+ 057120U	300HR #1 ENGINE INSP NO. 1								E1
	PKG 6	MOS					16-FEB-2001		
		HRS/MSC		300			7551		
	REF:	AFL					5515		
+ 057120U	300HR #2 ENGINE INSP NO. 2								E2
	PKG 7	MOS					16-FEB-2001		
		HRS/MSC		300			7551		
	REF:	AFL					5515		

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PKG NUMBER	UNIT	ACT INTERVAL TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
			TSN	TSO	TSR	TSI	ADJ				
ENGINE NO. 1											
CHAPTER 05 TIME LIMITS/MAINTENANCE CHECKS											
+ 057110U	NO. 1 ENGINE - 150HR #1 ENGINE INSP PKG 4 in PKG 4,6, 6	MOS HRS/MS		150				26-JUN-2001 7687	7837	1	
	REF:	ENC (AFL)						5594			
+ 057120U	NO. 1 ENGINE - 300HR #1 ENGINE INSP PKG 6 in PKG 6	MOS HRS/MS		300				16-FEB-2001 7551	7851	1.5	
	REF:	ENC (AFL)						5515			



AIRCRAFT Status Report
 (Work Packages)
 (Alphabetical with Relations)

Engine Model - TFE731-3
 Owner Name R&S AIRCRAFT INVESTMENTS, LLC
 A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PKG NUMBER	UNIT	ACT INTERVAL TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
			TSN	TSO	TSR	TSI	ADJ				
ENGINE NO. 2											
CHAPTER 05 TIME LIMITS/MAINTENANCE CHECKS											
+ 057110U	NO. 2 ENGINE - 150HR #2 ENGINE INSP PKG 5 in PKG 5,7, 7	MOS HRS/MSC		150					26-JUN-2001 7687	7837	1
	REF:	ENC (AFL)						5594			
+ 057120U	NO. 2 ENGINE - 300HR #2 ENGINE INSP PKG 7 in PKG 7	MOS HRS/MSC		300					16-FEB-2001 7551	7851	1.5
	REF:	ENC (AFL)						5515			

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION TSN TSO TSR TSI ADJ	Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
AIRCRAFT								
CHAPTER 00 INFORMATION								
000004U	-- ICON HEALTH AND FITNESS						11-FEB-1982	
		MOS					0	
	REF:	HRS/MS AFL	N/R				0	
CHAPTER 10 PARKING, MOORING, STORE AND RET TO SERV								
+ 100310	CHECK AIRWORTHY DIRECTIVES						26-JUN-2001	
10.010	PKG 1, 2, 3	MOS					7687	
		HRS/MS AFL	200				5594	
	REF: NO REF							
+ 100320	CHECK SERVICE BULLETINS						26-JUN-2001	
10.020	PKG 1, 2, 3	MOS					7687	
		HRS/MS AFL	200				5594	
	REF: NO REF							
+ 100330	CHECK SERVICE LETTERS						26-JUN-2001	
10.030	PKG 1, 2, 3	MOS					7687	
		HRS/MS AFL	200				5594	
	REF: NO REF							
CHAPTER 12 SERVICING								
+ 120160	CHECK NO.1 ENGINE PREFLIGHT COMPLETE						26-JUN-2001	E1
12.020	PKG 4	MOS					7687	
		HRS/MS AFL	150				5594	
	REF: AMM 5-21-00							
+ 120161	CHECK NO.2 ENGINE PREFLIGHT COMPLETE						26-JUN-2001	E2
12.020	PKG 5	MOS					7687	
		HRS/MS AFL	150				5594	
	REF: AMM 5-21-00							
+ 120150	CHECK PRE-FLIGHT						26-JUN-2001	
12.010	PKG 1, 2, 3	MOS					7687	
		HRS/MS AFL	200				5594	
	REF: AMM 5-30-00							
CHAPTER 21 AIR CONDITIONING								
210280	CHECK BLEED AIR DUCT OVERPRESSURE SWITCH						26-JUL-2000	F3
21.270	PKG 3	MOS					7325	
		HRS/MS AFL	800				5360	
	REF: AMM 21-00-00							
+ 210276	OPERATIONAL CHECK PRESSURIZATION SWITCHES AND VALVES						26-JUN-2001	F3
21.030	PKG 2, 3	MOS					7687	
		HRS/MS AFL	400				5594	
	REF: AMM 21-00-00							
210641	ANTICIPATOR, TEMPERATURE SENSOR						11-FEB-1982	F4
21.310	548486-1	MOS					0	
	SN-UNKNOWN	HRS/MS AFL	O/C	0			0	
	REF: AMM 21-60-00							

Report Date **13-MAY-2002**

(Alphabetical with Relations)

Aircraft Model - 1124 WESTWIND

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
210673	ASPIRATOR, ENVIRONMENTAL CONTROL SYSTEM										F5	
21.430	PN	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 21-50-00	AFL								0		
210661	BULB, CABIN TEMPERATURE INDICATOR SENSOR										F4	
21.350	PN	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 21-60-00	AFL								0		
210626	CONTROL BOX, CABIN TEMPERATURE										F4	
21.450	548482-5	MOS								11-FEB-1982		
	030C154	HRS/MSC	O/C	0						0		
	REF: AMM 21-60-00	AFL								0		
210118	CONTROL UNIT, BLEED AIR CONTROL RIGHT										F5	
21.360	3213894-4-1	MOS								06-NOV-1990		
	P402C	HRS/MSC	O/C							4731		
	REF: NO REF	AFL								3324		
210108	CONTROL UNIT, BLEED AIR LEFT										F5	
21.360	32131894-4-1	MOS								06-NOV-1990		
	P336C	HRS/MSC	O/C							4731		
	REF: NO REF	AFL								3324		
210176	CONTROLLER, CABIN AIR PRESSURE										F3	
21.180	130398-3	MOS								11-FEB-1982	\$1455.	
	31340	HRS/MSC	O/C	0						0	3	
	REF: AMM 21-30-00	AFL								0		
210178	CLEAN FILTER										F3	
21.480	PKG 3	MOS								26-JUL-2000		
		HRS/MSC	800							7325		
	REF: AMM 21-30-00	AFL								5360		
210606	EXCHANGER, REFRIGERATION UNIT HEAT										F5	
21.240	PN	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0	20	
	REF: AMM 21-50-00	AFL								0		
210636	FAN, CABIN TEMPERATURE										F4	
21.300	5783661-5	MOS								04-APR-1996	\$302.	
	120713	HRS/MSC	O/C							5747		
	REF: AMM 21-60-00	AFL								4430		
210206	INDICATOR, CABIN ALTITUDE/PRESSURE										F3	
21.390	4883747-1	MOS								11-FEB-1982		
	495	HRS/MSC	O/C	0						0		
	REF: AMM 21-31-00	AFL								0		
210208	INDICATOR, CABIN RATE-OF-CLIMB										F3	
21.400	4883788	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 21-31-00	AFL								0		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
210633	INDICATOR, CABIN TEMPERATURE										F3	
21.410	883767-50 1	MOS							11-FEB-1982			
	197	HRSMSC	O/C		0				0			
	REF: AMM 21-60-00	AFL							0			
210156	PLENUM, MIXING										F4	
21.160	5-783584-1	MOS							11-FEB-1982			
	SN-UNKNOWN	HRSMSC	O/C		0				0			
	REF: NO REF	AFL							0			
210241	REGULATOR, ABSOLUTE AIR PRESSURE LOWER										F3	
21.200	102466-1	MOS							11-FEB-1982			
	1203419	HRSMSC	O/C		0				0		4	
	REF: AMM 21-30-00	AFL							0			
210221	REPLACE LOWER INLET AIR FILTER ELEMENT										F3	
21.080	PKG 3	MOS							26-JUL-2000			
	1203419	HRSMSC	800						7325			
	REF: AMM 21-30-00	AFL							5360			
210236	REGULATOR, ABSOLUTE AIR PRESSURE UPPER										F3	
21.200	102466-1	MOS							11-FEB-1982			
	313613	HRSMSC	O/C		0				0		4	
	REF: AMM 21-30-00	AFL							0			
210621	REGULATOR, PNEUMATIC PRESSURE										F5	
21.280	PN	MOS							11-FEB-1982			
	SN-UNKNOWN	HRSMSC	O/C		0				0			
	REF: AMM 21-50-00	AFL							0			
210246	RELAY, PNEUMATIC										F3	
21.210	107312-2	MOS							22-OCT-1982		\$383.	
	11-9440	HRSMSC	O/C		0				482		4	
	REF: AMM 21-30-00	AFL										
210619	SENSOR, 35 DEGREE TEMPERATURE										F5	
21.420	783649-1	MOS							11-FEB-1982			
	071C730	HRSMSC	O/C		0				0			
	REF: AMM 21-50-00	AFL							0			
+ 210622	INSPECT 35 DEGREE DUCT SENSOR										F5	
21.420	PKG 1, 2, 3	MOS							26-JUN-2001			
		HRSMSC	200						7687			
	REF: AMM 21-50-00	AFL							5594			
210631	SENSOR, CABIN TEMPERATURE										F4	
21.460	548484-1	MOS							11-FEB-1982			
	070C482	HRSMSC	O/C		0				0			
	REF: AMM 21-60-00	AFL							0			
210646	SENSOR, HIGH TEMPERATURE										F4	
21.320	627962-2	MOS							11-FEB-1982			
	011C955	HRSMSC	O/C		0				0			
	REF: AMM 21-60-00	AFL							0			

Report Date **13-MAY-2002**

(Alphabetical with Relations)

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
210665 21.440	SENSOR, REFRIGERATION TEMPERATURE CONTROL 3783649-1 11166 REF: NO REF	MOS HRS/MSC AFL	O/C	0					03-NOV-1984 2044	F3	
210666 21.050	SEPARATOR, WATER 179510-1 31535 REF: AMM 21-70-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F5	
+ 210671 21.050	CLEAN/REPLACE CONDENSER/FILTER PKG 1, 2, 3 REF: AMM 21-70-00	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594	F5 1	
210286 21.380	SWITCH, CABIN AIR SELECTOR 823073-501 8128133 REF: NO REF	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F3	
210656 21.340	SWITCH, OVERPRESSURE 3-783646-2 194 REF: AMM 21-60-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F5	
210651 21.330	SWITCH, OVERTEMPERATURE 3-783645-1 211 REF: AMM 21-60-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F4	
210623 21.440	TANK, AUXILIARY ENVIRONMENTAL CONTROL SYSTEM VOLUME 131358-1 311533 REF: NO REF	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F2	
210677 21.290	TURBINE, COOLING 572375-2 56-133 REF: AMM 21-50-00	MOS HRS/MSC AFL	O/C		0				15-MAR-1995 5585 4260	F5	
210681 21.290	CHANGE OIL PKG 1, 2, 3 REF: AMM 21-50-00	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594	F5	
210601 21.230	UNIT, REFRIGERATION 3783648-1 120-333 REF: AMM 21-50-00	MOS HRS/MSC AFL	O/C	0					21-AUG-1983 1200 667	F5	
210616 21.260	VALVE, 35 DEGREE TEMPERATURE CONTROL 898730-1 SN-UNKNOWN REF: AMM 21-50-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F5	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
210121 21.060	VALVE, AIR CONDITIONING PRESSURE RELIEF 3-783644-1 162 REF: AMM 21-11-00	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F5	
210101 21.010	VALVE, BLEED AIR SWITCHING LEFT 3783647-3 P511 REF: AMM 21-11-00	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F5 \$1698.	
+ 210102 21.500	VISUALLY INSPECT PKG 2, 3 REF: AMM 5-20-05	MOS HRS/MS AFL	400							26-JUN-2001 7687 5594	F5	
210111 21.010	VALVE, BLEED AIR SWITCHING RIGHT 3783647-3 P506 REF: AMM 21-11-00	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F5 \$1698.	
+ 210112 21.500	VISUALLY INSPECT PKG 2, 3 REF: AMM 5-20-05	MOS HRS/MS AFL	400							26-JUN-2001 7687 5594	F5	
210146 21.130	VALVE, CABIN AIR CHECK LEFT PN SN-UNKNOWN REF: AMM 21-20-00	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F4	
210151 21.130	VALVE, CABIN AIR CHECK RIGHT PN SN-UNKNOWN REF: AMM 21-20-00	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F4	
210153 21.370	VALVE, COLD AIR CHECK PN SN-UNKNOWN REF: AMM 21-20-00	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F5	
210166 21.150	VALVE, CONDITION AIR PILOT PN SN-UNKNOWN REF: AMM 21-20-00	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F3	
210143 21.470	VALVE, EMERGENCY AIR CHECK PN SN-UNKNOWN REF: NO REF	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F5	
210141 21.120	VALVE, EMERGENCY AIR SHUTOFF 321760-2-1 P1222 REF: AMM 21-14-00	MOS HRS/MS AFL	O/C	0						11-FEB-1982 0 0	F5 \$1099.	

Report Date **13-MAY-2002**

Aircraft Model - **1124 WESTWIND**
Owner Name - **R&S AIRCRAFT INVESTMENTS, LLC**
A/C Serial #: **368** A/C Reg. #: **N368MD**

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
210161 21.140	VALVE, FLOOD DUCT PN SN-UNKNOWN REF: AMM 21-20-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F4	
210136 21.110	VALVE, GROUND BY-PASS 4-783622-1 P4380 REF: AMM 21-13-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5 \$1099.	
210211 21.080	REPLACE UPPER INLET AIR FILTER ELEMENT PKG 3 REF: AMM 21-30-00	MOS HRS/MSC AFL	800							26-JUL-2000 7325 5360	F3	
210611 21.250	VALVE, HOT AIR 321760-2-1 P1108 REF: AMM 21-60-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5 \$1099.	
210158 21.380	VALVE, HOT AIR CHECK PN SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F4	
210226 21.070	VALVE, ISOBARIC SHUTOFF 3-783105 SN-UNKNOWN REF: AMM 21-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
210171 21.170	VALVE, MANUAL DEFOG PN SN-UNKNOWN REF: AMM 21-20-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
210181 21.190	VALVE, MANUAL DUMP 5-723018-401 21563 REF: AMM 21-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
210186 21.040	VALVE, NORMAL OUTFLOW 130374-6 110870 REF: AMM 21-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F4	
210256 21.220	VALVE, PRESSURE SOLENOID LOWER 3783686 175 REF: AMM 21-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
210251 21.220	VALVE, PRESSURE SOLENOID UPPER 3783686 214 REF: AMM 21-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
210131 21.100	VALVE, RAM AIR SHUTOFF 398712-1-1 P222 REF: AMM 21-12-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
210196 21.040	VALVE, SAFETY OUTFLOW 103278-8 11905 REF: AMM 21-30-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F4	
210261 21.160	VENTURI, AIRFLOW 131052-1 703075 REF: NO REF	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	
210266 21.090	INSPECT/CLEAN SCREEN REF: NO REF	MOS HRSMSC AFL	O/C							11-FEB-1982 0 0	F3	
CHAPTER 22 AUTO FLIGHT												
220166 22.020	AMPLIFIER, NO.1 AUTOPILOT SERVO 622-3108-016 2120LNR REF: AMM 22-10-03	MOS HRSMSC AFL	O/C							27-AUG-1996	F3 1	
220156 22.050	COMPUTER, AUTO PILOT 522-2901-016 2198 REF: AMM 22-13-13	MOS HRSMSC AFL	O/C		4165					15-FEB-1995 5554 4242	F3	
220163 22.040	COMPUTER, AUTOPILOT YAW DAMPER 622-3167-028 4078 REF: AMM 22-10-05	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	
221021 22.030	CONTROLLER, AIR DATA NO. 1 590A-3J SN-UNKNOWN REF: AMM 22-10-04	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	
+ 340146 34.050 ASSOCIATED	LEAKCHECK LEFT STATIC SYSTEM REF: AMM 34-10-01	MOS HRSMSC AFL	24							18-JAN-2001 7494 5466	MANDATORY F1 18-JAN-2003	
+ 340151 34.050 ASSOCIATED	LEAKCHECK RIGHT STATIC SYSTEM REF: AMM 34-10-01	MOS HRSMSC AFL	24							18-JAN-2001 7494 5466	MANDATORY F1 18-JAN-2003	
221031 22.030	CONTROLLER, AIR DATA NO. 2 590A-3J1 SN-UNKNOWN REF: AMM 22-10-04	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
+ 340146	LEAKCHECK LEFT STATIC SYSTEM									MANDATORY	F1
34.050		MOS	24						18-JAN-2001	18-JAN-2003	
	ASSOCIATED	HRS/MSC							7494		
	REF: AMM 34-10-01	AFL							5466		
+ 340151	LEAKCHECK RIGHT STATIC SYSTEM									MANDATORY	F1
34.050		MOS	24						18-JAN-2001	18-JAN-2003	
	ASSOCIATED	HRS/MSC							7494		
	REF: AMM 34-10-01	AFL							5466		
222001	CONTROLLER, ALTITUDE PRESELECT										F3
22.090		MOS							11-FEB-1982		
	622-2923-066	HRS/MSC		O/C	0				0		
	SN-UNKNOWN	AFL			0				0		
	REF: NO REF										
220161	CONTROLLER, AUTOPILOT										F3
22.010		MOS							11-FEB-1982		
	792-6348-002	HRS/MSC		O/C	0				0		1
	2759	AFL			0				0		
	REF: AMM 22-10-02										
220181	MOUNT, AUTOPILOT AILERON SERVO										F5
22.080		MOS							11-FEB-1982		
	792-6783-001	HRS/MSC		O/C	0				0		
	1191	AFL			0				0		
	REF:										
220191	MOUNT, AUTOPILOT ELEVATOR SERVO										F5
22.080		MOS							11-FEB-1982		
	792-6783-001	HRS/MSC		O/C	0				0		
	1160	AFL			0				0		
	REF:										
220201	MOUNT, AUTOPILOT RUDDER SERVO										F5
22.080		MOS							11-FEB-1982		
	792-6783-001	HRS/MSC		O/C	0				0		
	1166	AFL			0				0		
	REF:										
220150	PANEL, AUTOPILOT										F3
22.060		MOS							11-FEB-1982		
	622-0141-023	HRS/MSC		O/C					0		
	SN-UNKNOWN	AFL							0		
	REF: AMM 22-11-02										
220176	SERVO, AUTOPILOT AILERON										F5
22.070		MOS							15-FEB-1995		
	792-6781-001	HRS/MSC		O/C		5554			5554		
	726	AFL			4242				4242		
	REF: AMM 22-10-06(1124),22-11-07(1124A)										
220186	SERVO, AUTOPILOT ELEVATOR										F5
22.070		MOS							15-FEB-1995		
	792-6781-001	HRS/MSC		O/C		5554			5554		
	791	AFL			4242				4242		
	REF: AMM 22-10-06(1124),22-11-07(1124A)										
220196	SERVO, AUTOPILOT RUDDER										F5
22.070		MOS							11-FEB-1982		
	792-6781-001	HRS/MSC		O/C	0				0		
	3915	AFL			0				0		
	REF: AMM 22-10-06(1124),22-11-07(1124A)										

CHAPTER 23 COMMUNICATIONS

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
230450U	- REPLACE BEACON BATTERY	MOS								17-OCT-1998 ?		
	REF:	HRS/MSC								6520		
		AFL								4889		
+ 230218	INSPECT/CHECK STATIC DISCHARGE WICK RESISTANCE	MOS								26-JUN-2001	F1	
23.120	PKG 2, 3	HRS/MSC	400							7687		
	REF: AMM 23-60-00	AFL								5594		
230166	RENEW FCC RADIO/TELEPHONE LICENSE	MOS	60							27-OCT-1999 27-OCT-2004	F3	
23.100		HRS/MSC								6961		
	REF: See Workcard	AFL								5135		
238004U	- INTERCOM, COPILOTS NAT LTD	MOS								15-APR-1993		
	AA80-020	HRS/MSC	O/C							5252		
	9688	AFL								3907		
	REF:											
238006U	- INTERCOM, PILOTS NAT LTD.	MOS								15-APR-1993		
	AA80020	HRS/MSC	O/C	0						5252		
	9689	AFL								3907		
	REF:											
230111	AMPLIFIER, HF POWER	MOS								26-SEP-1995	F3	
23.030	622-2883-001	HRS/MSC	O/C							5707		
	1033	AFL								4380		
	REF: AMM REF BELOW											
230156	ANTENNA, RADIO/TELEPHONE	MOS								11-FEB-1982	F1	
23.110	121-0011-000	HRS/MSC	O/C	0						0		
	3272	AFL								0		
	REF: AMM 23-21-00											
230136	ANTENNA, VHF BLADE	MOS								11-FEB-1982	F1	
23.070	DMC-81-1	HRS/MSC	O/C	0						0		
	387	AFL								0		
	REF: AMM 23-20-00											
230131	ANTENNA, VHF FIN CAP	MOS								11-FEB-1982	F1	
23.060	VFS-10-90-2	HRS/MSC	O/C	0						0	5	
	866	AFL								0		
	REF: AMM 23-20-00											
230399	BEACON, VOICE RECORDER	MOS								09-NOV-1996	T1	
23.130	DK-100	HRS/MSC	O/C							5951		
	DL4928	AFL								4589		
	REF: NO REF											
230171	CONTROL, COMMUNICATION 1	MOS								09-JAN-1986	F3	
23.140	622-4523-011	HRS/MSC	O/C	0						2812		
	SN-UNKNOWN	AFL								1743		
	REF: NO REF											

Report Date **13-MAY-2002**

(Alphabetical with Relations)

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
230181 23.140	CONTROL, COMMUNICATION 2 622-4523-003 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0					09-JAN-1986 2812 1743	F3	
230196 23.150	CONTROL, NO.1 AUDIO CENTER 522-3763-001 3747 REF: AMM 23-50-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F3	
230201 23.150	CONTROL, NO.2 AUDIO CENTER 522-3763-001 3749 REF: AMM 23-50-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F3	
230116 23.040	COUPLER, HF ANTENNA 622-2884-001 2427 REF: AMM REF BELOW	MOS HRS/MSC AFL	O/C	5702 4372					16-AUG-1995 5702 4372	F3	
230101 23.010	PANEL, HF CONTROL 622-4545-001 SN-UNKNOWN REF: AMM REF BELOW	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F3	
230106 23.020	RECEIVER/EXCITER, HF 622-5337-001 1554 REF: AMM REF BELOW	MOS HRS/MSC AFL	O/C						26-SEP-1995 5707 4380	F3	
230151 23.100	RECEIVER/TRANSMITTER, RADIO/TELEPHONE 400-0033-000 603 REF: AMM 23-21-00	MOS HRS/MSC AFL	O/C						29-JUL-1994 5472 4150	F3	
230206 23.130	RECORDER, COCKPIT VOICE 89094-003111 A01001 REF: NO REF	MOS HRS/MSC AFL	O/C						16-AUG-1995 5702 4372	T1	
230400 23.130	CLEAN/TEST BEACON REF: NO REF	MOS HRS/MSC AFL	6						06-NOV-2001 7774 5641	06-MAY-2002 T1	
230207 23.130	REPLACE BATTERY REF: NO REF	MOS HRS/MSC AFL							17-OCT-1998 6520 4889	? T1	
230121 23.050	TRANSCEIVER, VHF NO. 1 622-1334-002 4589 REF: AMM 23-20-00	MOS HRS/MSC AFL	O/C	0					24-JUN-1991 4880 3495	F3	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
230126 23.050	TRANSCEIVER, VHF NO. 2 622-1879-002 16718 REF: AMM 23-20-00	MOS HRS/MSC AFL			0 0 0				28-MAY-1991 4877 3493		F3	
230146 23.090	UNIT, RADIO/TELEPHONE CABIN 400-0030-004 77790 REF: AMM 23-21-00	MOS HRS/MSC AFL			0				06-FEB-1989 4149 2658		F4	
230141 23.080	UNIT, RADIO/TELEPHONE COCKPIT 400-0032-002 2506 REF: AMM 23-21-00	MOS HRS/MSC AFL			0				11-FEB-1982 0 0		F3	
230191 23.140	UNIT, UHF COMMUNICATION REMOTE DISPLAY 622-1945-011 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL			0 0 0				11-FEB-1982 0 0		F3	
CHAPTER 24 ELECTRICAL POWER												
+ 241653 24.140	CHECK CIRCUIT BREAKER RESISTANCE/INSPECT BUS PKG 3 REF: AMM 24-50-00	MOS HRS/MSC AFL		800					26-JUL-2000 7325 5360		F3	
+ 241655 24.150	INSPECT DISTRIBUTION BUS CIRCUIT BREAKER PKG 3 REF: AMM 24-50-00	MOS HRS/MSC AFL		800					26-JUL-2000 7325 5360		F3	
+ 241657 24.160	INSPECT TEST PRIORITY BUS DIODES PKG 3 REF: AMM 24-50-00	MOS HRS/MSC AFL		800					26-JUL-2000 7325 5360		F3	
240156 24.030	BATTERY, LEFT 4833517-1 8812674 REF: AMM 24-30-00	MOS HRS/MSC AFL		O/C					09-NOV-1996 5951 4589		F2 \$2100. 1	
240168 24.030	ANALYZE REF: NO REF	MOS HRS/MSC AFL		C/C					09-NOV-1996 5951 4589		F2	
+ 240161 24.030	CHECK ELECTROLYTE LEVEL PKG 1, 2, 3 REF: AMM 12-10-06	MOS HRS/MSC AFL		200					26-JUN-2001 7687 5594		F2 1	
240166 24.030	DEEP CYCLE PKG 1, 2, 3 REF: AMM 12-10-06	MOS HRS/MSC AFL		200					06-NOV-2001 7774 5641		F2 2	

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
240171	BATTERY, RIGHT									F2	
24.020	4833517-1	MOS							09-NOV-1996	\$2100.	
	8506152	HRS/MSC	O/C						5951	1	
	REF: AMM 24-30-00	AFL							4589		
240184	ANALYZE									F2	
24.020		MOS							09-NOV-1996		
		HRS/MSC							5951		
	REF: NO REF	AFL	C/C						4589		
+ 240176	CHECK ELECTROLYTE LEVEL									F2	
24.020	PKG 1, 2, 3	MOS							26-JUN-2001		
		HRS/MSC	200						7687	1	
	REF: AMM 12-10-06	AFL							5594		
240181	DEEP CYCLE									F2	
24.020	PKG 1, 2, 3	MOS							06-NOV-2001		
		HRS/MSC	200						7774	2	
	REF: AMM 12-10-06	AFL							5641		
240111	BLOWER, INVERTER COOLING									F2	
24.100	M125J-9A1	MOS							11-FEB-1982		
	200	HRS/MSC	O/C				0		0		
	REF: AMM 24-20-00	AFL							0		
240136	BOX, D.C. CONTACTOR LEFT									F5	
24.050	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C				0		0		
	REF: NO REF	AFL							0		
240141	BOX, D.C. CONTACTOR RIGHT									F5	
24.050	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C				0		0		
	REF: NO REF	AFL							0		
240146	CONTROL UNIT, GENERATOR NO. 1									F5	
24.040	5833515-1	MOS							30-NOV-1989		
	6681927M1	HRS/MSC	O/C						4430	1	
	REF: AMM 24-30-00	AFL							2987		
240151	CONTROL UNIT, GENERATOR NO. 2									F5	
24.040	5833515-1	MOS							01-MAY-1990		
	663958M1	HRS/MSC	O/C						4578	1	
	REF: AMM 24-30-00	AFL							3154		
240116	GENERATOR, STARTER NO. 1									OVERHAUL	
24.010	23065-018-1	MOS							06-NOV-2001	\$813.	
	3684	HRS/MSC	1000						7774	1	
	REF: AMM 80-10-00	AFL							5641		
+ 240121	CHECK BRUSH WEAR/TENSION									E1	
24.010	PKG 4	MOS							06-NOV-2001		
		HRS/MSC	150						7774	.5	
	REF: See Workcard	AFL							5641		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT----- TSN TSO TSR TSI ADJ	INSTALLATION	Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
+ 240118 24.170	INSPECT PKG 4	MOS HRSMSC AFL	150				06-NOV-2001 7774 5641		E1
	REF: AMM 5-21-00								
+ 240123 24.010	INSPECT SPLINE PKG 4	MOS HRSMSC AFL	150				06-NOV-2001 7774 5641		E1
	REF: AMM								
240126 24.010	GENERATOR, STARTER NO. 2 23065-018-1 2562	MOS HRSMSC AFL	1000				06-NOV-2001 7774 5641	OVERHAUL ?	E2 \$813. 1
	REF: AMM 80-10-00								
+ 240131 24.010	CHECK BRUSH WEAR/TENSION PKG 5	MOS HRSMSC AFL	150				06-NOV-2001 7774 5641		E2
	REF: See Workcard								
+ 240128 24.170	INSPECT PKG 5	MOS HRSMSC AFL	150				06-NOV-2001 7774 5641		E2
	REF: AMM 5-21-00								
+ 240133 24.010	INSPECT SPLINE PKG 5	MOS HRSMSC AFL	150				06-NOV-2001 7774 5641		E2
	REF: AMM 80-10-00								
240196 24.050	INDICATOR, BATTERY TEMPERATURE 4883754-501 1955	MOS HRSMSC AFL	O/C	0			11-FEB-1982 0 0		F3
	REF: NO REF								
240101 24.080	INVERTER, NO. 1 6833508-501 C0253094	MOS HRSMSC AFL	O/C	0			12-JUL-1989 4305 2845		F2 \$1150. 1
	REF: AMM 24-20-00								
240106 24.080	INVERTER, NO. 2 6833508-501 1135	MOS HRSMSC AFL	O/C	0			09-DEC-1985 2762 1713		F2 \$1150. 1
	REF: AMM 24-20-00								
241651 24.120	METER, VOLT/AMP 6883091-513 SN-UNKNOWN	MOS HRSMSC AFL	O/C				11-FEB-1982 0 0		
	REF: NO REF								
241601 24.130	POWER SUPPLY, VHF EMERGENCY COMMUNICATION 501-1015-02 SN-UNKNOWN	MOS HRSMSC AFL	O/C	0			11-FEB-1982 0 0		
	REF: NO REF								

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
241606 24.130	INSPECT BATTERY	MOS HRSMSC AFL	O/C						11-OCT-1990 4718 3309		
240211 24.060	RECEPTACLE, EXTERNAL POWER PN	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F1	
+ 240203 24.070	FUNCTIONALLY CHECK BATTERY TEMPERATURE AND WARNING SYSTEM PKG 1, 2, 3	MOS HRSMSC AFL	200						26-JUN-2001 7687 5594	F3	
240186 24.030	THERMISTOR, BATTERY LEFT PN	MOS HRSMSC AFL	O/C	0					11-JAN-1989 4127 2632	F2	
240191 24.020	THERMISTOR, BATTERY RIGHT PN	MOS HRSMSC AFL	O/C	0					11-JAN-1989 4127 2632	F2	
240103 24.090	VOLTMETER, AC LEFT 3883035-501 HH9400	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F3	
240108 24.090	VOLTMETER, AC RIGHT 3883035-501 JC1215	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F3	
240143 24.110	VOLTMETER, DC LEFT 6883091-505 H69513	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F3	
240148 24.110	VOLTMETER, DC RIGHT 6883091-505 JD1421	MOS HRSMSC AFL	O/C	0					25-FEB-1994 5408 4066	F3	
CHAPTER 25	EQUIPMENT/FURNISHINGS										
+ 250162 25.050	INSPECT FIRST AID KIT	MOS HRSMSC AFL	12						06-NOV-2001 7774 5641	06-NOV-2002	F4
+ 250156 25.050	INSPECT LIFE PRESERVERS	MOS HRSMSC AFL	12						06-NOV-2001 7774 5641	06-NOV-2002	F4

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
250141	DISPLAY, CABIN INFORMATION									F4	
25.040	32940-004	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: NO REF	AFL						0			
250146	OPERATIONAL CHECK									F4	
25.040		MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C					0			
	REF: NO REF	AFL						0			
250116	INERTIA REEL, COPILOT									F3	
25.020	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: NO REF	AFL						0			
250111	INERTIA REEL, PILOT									F3	
25.020	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: NO REF	AFL						0			
250106	SEAT, COPILOT									F3	
25.010	1024-0	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: AMM 25-10-01	AFL						0			
250101	SEAT, PILOT									F3	
25.010	1025-0	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: AMM 25-10-01	AFL						0			
250131	SEATBELT, COPILOT									F3	
25.030	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: NO REF	AFL						0			
250121	SEATBELT, PILOT									F3	
25.030	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: NO REF	AFL						0			
250166	TRANSMITTER, EMERGENCY LOCATOR									F4	
25.060	607690-2	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: NO REF	AFL						0			
CHAPTER 26	FIRE PROTECTION										
+ 260186	OPERATIONAL CHECK FIRE PROTECTION SYSTEM									F3	
26.020	PKG 2, 3	MOS							26-JUN-2001		
		HRS/MSC	400					7687			
	REF: AMM 26-00-00	AFL						5594			
+ 260148	REPLACE LEFT FIRE EXTINGUISHER NO.1 CARTRIDGE								SCRAP	F5	
26.010		MOS	48						17-JAN-2001	17-JAN-2005	
		HRS/MSC									
	REF: AMM 26-20-00	AFL									

Report Date **13-MAY-2002**

Aircraft Model - **1124 WESTWIND**
Owner Name - **R&S AIRCRAFT INVESTMENTS, LLC**
A/C Serial #: **368** A/C Reg. #: **N368MD**

ITEM NO	WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
					TSN	TSO	TSR	TSI	ADJ				
+ 260153	26.010	REPLACE LEFT FIRE EXTINGUISHER NO.2 CARTRIDGE	MOS	48							17-JAN-2001	SCRAP	F5
		REF: AMM 26-20-00	HRS/MS AFL									17-JAN-2005	
+ 260158	26.015	REPLACE RIGHT FIRE EXTINGUISHER NO.1 CARTRIDGE	MOS	48							17-JAN-2001	SCRAP	F5
		REF: AMM 26-20-00	HRS/MS AFL									17-JAN-2005	
+ 260163	26.015	REPLACE RIGHT FIRE EXTINGUISHER NO.2 CARTRIDGE	MOS	48							17-JAN-2001	SCRAP	F5
		REF: AMM 26-20-00	HRS/MS AFL									17-JAN-2005	
260176	26.030	EXTINGUISHER, CABIN PORTABLE MODEL 2-10	MOS				13				21-JAN-1989		F4
		U-329516	HRS/MS AFL	O/C			0				4131 2636		
260182	26.030	DISCHARGE VALVE OVERHAUL AND REFILL CABIN FIRE EXINGUISHER	MOS	72							06-NOV-2001	06-NOV-2007	F3
		REF: MSC SIL 1124-25-059R1	HRS/MS AFL								7774 5641		
260183	26.030	HYDROSTATIC TEST CABIN FIRE EXTINGUISHER	MOS	144							01-JAN-1995	01-JAN-2007	F4
		REF: See Workcard	HRS/MS AFL										
+ 260184	26.030	INSPECT CABIN FIRE EXTINGUISHER PKG 1, 2, 3	MOS								26-JUN-2001		F4
		REF: AMM 26-20-00	HRS/MS AFL	200							7687 5594		
+ 260180	26.060	VISUAL INSPECTION CABIN FIRE EXTINGUISHER	DAYS	30							06-NOV-2001	06-DEC-2001	F3
		REF: NO REF	HRS/MS AFL								7774 5641		
260181	26.030	WEIGHT CHECK CABIN FIRE EXTINGUISHER	MOS	12							26-JUN-2001	26-JUN-2002	F4
		REF: AMM 5-10-00	HRS/MS AFL								7687 5594		
260166	26.030	EXTINGUISHER, COCKPIT PORTABLE MODEL 2-10	MOS				13				21-JAN-1989		F3
		U-329659	HRS/MS AFL	O/C			0				4131 2636		
260172	26.030	DISCHARGE VALVE OVERHAUL AND REFILL COCKPIT FIRE EXTINGUISHER	MOS	72							06-NOV-2001	06-NOV-2007	F3
		REF: MSC SIL 1124-25-059R1	HRS/MS AFL								7774 5641		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
260173 26.030	HYDROSTATIC TEST COCKPIT FIRE EXTINGUISHER	MOS HRS/MSA AFL	144							01-JAN-1995	01-JAN-2007	F3
	REF: MSC SIL 1124-25-059R1											
+ 260174 26.030	INSPECT COCKPIT FIRE EXTINGUISHER PKG 1, 2, 3	MOS HRS/MSA AFL	200							26-JUN-2001		F3
	REF: AMM 26-20-00									7687		
										5594		
+ 260169 26.060	VISUAL INSPECTION COCKPIT FIRE EXTINGUISHER	DAYS HRS/MSA AFL	30							06-NOV-2001	06-DEC-2001	F3
	REF: NO REF									7774		
										5641		
260171 26.030	WEIGHT CHECK COCKPIT FIRE EXTINGUISHER	MOS HRS/MSA AFL	12							26-JUN-2001	26-JUN-2002	F3
	REF: AMM 5-10-00									7687		
										5594		
260111 26.010	EXTINGUISHER, FIRE LEFT 3643507-1 02447C1	MOS HRS/MSA AFL	O/C	0						11-FEB-1982		F5 \$795.
	REF: AMM 26-20-00									0		
										0		
260121 26.010	HYDROSTATIC TEST	MOS HRS/MSA AFL	60							06-NOV-2001	06-NOV-2006	MANDATORY F5
	REF: AMM 5-10-00									7774		
										5641		
+ 260146 26.010	RECORD DATE STAMPED ON NEW CARTRIDGE (SERVICE LIFE)	MOS HRS/MSA AFL	72							17-JAN-2001	17-JAN-2007	LIFE LIMIT F5
	REF: AMM 26-20-00											
+ 260151 26.010	RECORD DATE STAMPED ON NEW CARTRIDGE (SERVICE LIFE)	MOS HRS/MSA AFL	72							17-JAN-2001	17-JAN-2007	LIFE LIMIT F5
	REF: AMM 26-20-00											
+ 260148 26.010 ASSOCIATED	REPLACE LEFT FIRE EXTINGUISHER NO.1 CARTRIDGE	MOS HRS/MSA AFL	48							17-JAN-2001	17-JAN-2005	SCRAP F5
	REF: AMM 26-20-00											
+ 260153 26.010 ASSOCIATED	REPLACE LEFT FIRE EXTINGUISHER NO.2 CARTRIDGE	MOS HRS/MSA AFL	48							17-JAN-2001	17-JAN-2005	SCRAP F5
	REF: AMM 26-20-00											
260116 26.010	WEIGHT CHECK	MOS HRS/MSA AFL	O/C							17-JAN-2001		F5
	REF: See Workcard									7494		
										5466		

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
260126	EXTINGUISHER, FIRE RIGHT										F5	
26.015	23700004	MOS							10-JAN-1994		\$795.	
	02429C1	HRS/MS	O/C			0			5382			
	REF: AMM 26-20-00	AFL							4036			
260136	HYDROSTATIC TEST									MANDATORY	F5	
26.015		MOS	60						07-APR-1999	07-APR-2004		
		HRS/MS							6727			
	REF: AMM 5-10-00	AFL							4999			
+ 260156	RECORD DATE STAMPED ON NEW CARTRIDGE (SERVICE LIFE)									LIFE LIMIT	F5	
26.015		MOS	72						17-JAN-2001	17-JAN-2007		
		HRS/MS										
	REF: AMM 26-20-00	AFL										
+ 260161	RECORD DATE STAMPED ON NEW CARTRIDGE (SERVICE LIFE)									LIFE LIMIT	F5	
26.015		MOS	72						17-JAN-2001	17-JAN-2007		
		HRS/MS										
	REF: AMM 26-20-00	AFL										
+ 260158	REPLACE RIGHT FIRE EXTINGUISHER NO.1 CARTRIDGE									SCRAP	F5	
26.015		MOS	48						17-JAN-2001	17-JAN-2005		
	ASSOCIATED	HRS/MS										
	REF: AMM 26-20-00	AFL										
+ 260163	REPLACE RIGHT FIRE EXTINGUISHER NO.2 CARTRIDGE									SCRAP	F5	
26.015		MOS	48						17-JAN-2001	17-JAN-2005		
	ASSOCIATED	HRS/MS										
	REF: AMM 26-20-00	AFL										
260131	WEIGHT CHECK										F5	
26.015		MOS							17-JAN-2001			
		HRS/MS	O/C						7494			
	REF: See Workcard	AFL							5466			
260101	FIRE DETECTOR, LEFT										E1	
26.040	4643506-3	MOS							11-FEB-1982			
	19491	HRS/MS	O/C			0			0			
	REF: AMM 26-10-00	AFL							0			
260106	FIRE DETECTOR, RIGHT										E2	
26.040	4643506-3	MOS							11-FEB-1982			
	19503	HRS/MS	O/C			0			0			
	REF: AMM 26-10-00	AFL							0			
260141	INDICATOR, EXTINGUISHER DISCHARGE										F5	
26.050	PN	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MS	O/C			0			0			
	REF: NO REF	AFL							0			
CHAPTER 27	FLIGHT CONTROLS											
+ 270271	ADJUST/TEST FLAP COMPARATOR										F3	
27.430	PKG 3	MOS							26-JUL-2000			
		HRS/MS	800						7325			
	REF: AMM 27-50-00	AFL							5360			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
+ 270140 27.070	CHECK AILERON CONTROL SYSTEM FREEPLAY PKG 3	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	F5	
	REF: AMM 27-10-00										
+ 270341 27.440	CHECK CABLE TENSION AFT FUSELAGE PKG 2, 3	MOS HRS/MSC AFL	400						26-JUN-2001 7687 5594	F5	
	REF: AMM 27-00-00										
+ 270340 27.440	CHECK CABLE TENSION FLIGHT/PASSENGER COMPARTMENT PKG 3	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	F3	
	REF: AMM 27-00-00										
+ 270280 27.230	CLEAN/INSPECT/LUBRICATE LEFT INBOARD/OUTBOARD FLEXIBLE SHAFT PKG 3	MOS HRS/MSC AFL	1200						16-FEB-2001 7551 5515	8751 W1	
	REF: AMM 27-50-00										
+ 270285 27.230	CLEAN/INSPECT/LUBRICATE RIGHT INBOARD/OUTBOARD FLEXIBLE SHAFT PKG 3	MOS HRS/MSC AFL	1200						16-FEB-2001 7551 5515	8751 W2	
	REF: AMM 27-50-00										
+ 270248 27.200	FUNCTIONAL CHECK FLAP TIME EXCEED RELAY PKG 2, 3	MOS HRS/MSC AFL	400						26-JUN-2001 7687 5594	F3	
	REF: AMM 27-50-00										
+ 270211 27.500	INSPECT SCISSORS ASSEMBLY PKG 2, 3	MOS HRS/MSC AFL	400						26-JUN-2001 7687 5594	T1	
	REF: See Workcard										
+ 270351 27.380	INSPECT/LUBRICATE PRESSURE SEALS PKG 3	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	F4	
	REF: AMM 12-20-00										
270214 27.195	LUBRICATE AFT HINGE FITTING BEARINGS PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594	T1	
	REF: NO REF										
270179 27.350	LUBRICATE CONTROL COLUMNS PKG 3	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	F3	
	REF: AMM 12-20-00										
270213 27.190	LUBRICATE ELEVATOR ATTACH POINTS PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594	T1	
	REF: AMM 12-20-00										

Report Date **13-MAY-2002**

Aircraft Model - **1124 WESTWIND**
Owner Name - **R&S AIRCRAFT INVESTMENTS, LLC**
A/C Serial #: **368** A/C Reg. #: **N368MD**

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
270346 27.360	LUBRICATE FLIGHT CONTROL FORWARD/AFT PKG 3	BELLCRANKS MOS									F4	
	REF: AMM 12-20-00	HRS/MSC AFL	800						26-JUL-2000	7325 5360		
270215 27.195	LUBRICATE FORWARD SCISSOR ASSEMBLY PKG 1, 2, 3	MOS									T1	
	REF: NO REF	HRS/MSC AFL	200						26-JUN-2001	7687 5594		
270356 27.370	LUBRICATE GUST LOCK PKG 3	MOS									F3	
	REF: AMM 12-20-00	HRS/MSC AFL	800						26-JUL-2000	7325 5360		
270176 27.340	LUBRICATE RUDDER PEDAL ARMS PKG 3	MOS									F3	
	REF: AMM 12-20-00	HRS/MSC AFL	800						26-JUL-2000	7325 5360		
+ 270335 27.280	OPERATIONAL CHECK SPEED BRAKES AND PKG 1, 2, 3	LIFT DUMPERS MOS									F2	
	REF: AMM 27-60-00	HRS/MSC AFL	200						26-JUN-2001	7687 5594		
270145 27.045	STATIC FRICTION TEST AILERON AND RUDDER PKG 3	MOS										
	REF: AMM 27-00-00	HRS/MSC AFL	800						26-JUL-2000	7325 5360		
270210 27.570	VISUAL INSPECT ELEVATOR CONTROL BELLCRANK ASSEMBLY PKG 3	MOS										
	REF: AMM 5-10-00	HRS/MSC AFL	5000						16-JUN-1997	6135 4707	16-JUN-2002 11135	
270331 27.320	ACCUMULATOR, LIFT DUMPER RIGHT WING 3-713515-501	INBOARD MOS									W2	
	SN-UNKNOWN	HRS/MSC AFL	O/C			0			11-FEB-1982	0 0		
270116 27.060	ACTUATOR, AILERON TRIM TAB 5793500-1	MOS									W1	
	REF: AMM 27-10-00	HRS/MSC AFL	O/C						09-NOV-1996	5951 4589		
270251 27.210	ACTUATOR, FLAP LEFT INBOARD 1390T100-5	MOS									LIFE LIMIT	
	REF: AMM 27-50-00	HRS/MSC AFL	10000						16-JUN-1997	6135 4707	W1 \$1006. 8	
270256 27.220	ACTUATOR, FLAP LEFT OUTBOARD 1391T100-7	MOS									OVERHAUL	
	REF: AMM 27-50-00	HRS/MSC AFL	10000			0			06-APR-1998	6346 4787	W1 \$1046. 16346	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
270261 27.210	ACTUATOR, FLAP RIGHT INBOARD 193544-1 749A REF: AMM 27-50-00	MOS HRSMSC AFL	10000	0					15-JUL-1986 3201 1972	OVERHAUL W2 \$1006. 8	
270266 27.220	ACTUATOR, FLAP RIGHT OUTBOARD 193544-502 120 REF: AMM 27-50-00	MOS HRSMSC AFL	10000	0				22-OCT-1982 482	LIFE LIMIT W2 \$1046.		
270216 27.170	ACTUATOR, HORIZONTAL STABILIZER TRIM 21164-005 0481-11AA REF: AMM 27-40-00	MOS HRSMSC AFL	2500	0				06-APR-1998 6346 4787	OVERHAUL T1 \$4158. 7287		
+ 270217 27.170	INSPECT PKG 2, 3 REF: See Workcard	MOS HRSMSC AFL	400					26-JUN-2001 7687 5594	T1		
270328 27.310	ACTUATOR, LIFT DUMPER LEFT WING INBOARD 3-71 3515-501 SN-UNKNOWN REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0				11-FEB-1982 0 0	W1		
270326 27.310	ACTUATOR, LIFT DUMPER LEFT WING OUTBOARD 3-71 3515-501 SN-UNKNOWN REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0				11-FEB-1982 0 0	W1		
270333 27.320	ACTUATOR, LIFT DUMPER RIGHT WING OUTBOARD 3-71 3515-501 SN-UNKNOWN REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0				11-FEB-1982 0 0	W2		
270166 27.090	ACTUATOR, LOWER RUDDER TRIM 5793500-501 3219 REF: AMM 27-20-00	MOS HRSMSC AFL	O/C	0				11-FEB-1982 0 0	T1 \$1000. 16		
270301 27.260	ACTUATOR, SPEED BRAKE LEFT 3713515-503 1L-466P REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0				11-FEB-1982 0 0	W1		
270306 27.260	ACTUATOR, SPEED BRAKE RIGHT 3713515-503 1L-470P REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0				11-FEB-1982 0 0	W2		
270161 27.090	ACTUATOR, UPPER RUDDER TRIM 5793500-503 5220 REF: AMM 27-20-00	MOS HRSMSC AFL	O/C	0				11-FEB-1982 0 0	T1 \$1000. 16		

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
270101	AILERON, LEFT										W1	
27.010	5183003-407-2	MOS								11-FEB-1982		
	4376	HRS/MSC	O/C			0				0		
	REF: AMM 27-10-00	AFL								0		
+ 270140	CHECK AILERON CONTROL SYSTEM FREEPLAY										F5	
27.070	PKG 3	MOS								26-JUL-2000		
	ASSOCIATED	HRS/MSC	800							7325		
	REF: AMM 27-10-00	AFL								5360		
+ 270264	CLEAN/CHECK LEFT GUIDE ROLLERS										W1	
27.550	PKG 2, 3	MOS								26-JUN-2001		
	REF: AMM 5-20-03	HRS/MSC	400							7687		
		AFL								5594		
SB 1124-27-100 R2 L/H RODS	FLIGHT CONTROLS SERVICE BULLETIN										W1	
	ASSOCIATED	MOS										
		HRS/MSC	A/R							0		
	REF: BULLETINS	AFL								0		
	Method of Compliance: OPEN											
SB 1124-27-129 LEFT AILERON	FLIGHT CONTROLS SERVICE BULLETIN										W1	
	ASSOCIATED	MOS								26-JUL-2000		
		HRS/MSC	600							7325	7925	
	REF: BULLETINS	AFL								5360		
	Method of Compliance: OPEN											
+ 570106	INSPECT BELLCRANK										W1	
57.020	PKG 1, 2, 3	MOS								26-JUN-2001		
	REF: AMM 5-20-03	HRS/MSC	200							7687		
		AFL								5594		
+ 270262	INSPECT LEFT EXTERNAL PUSH-PULL TUBE										W1	
27.540	PKG 2, 3	MOS								26-JUN-2001		
	REF: AMM 5-20-03	HRS/MSC	400							7687		
		AFL								5594		
AD 1996-24-11 LEFT AILERON	TO PREVENT EXCESSIVE WEAR OF THE AILERON PUSH-PULL TUBE, WHICH COULD RESULT IN UNEVEN MOVEMENT OF THE CONTROL WHEEL, PERFORATION OF THE AILERON PUSH-PULL TUBE, AND CONSEQUENT REDUCED ROLL CONTROL OF THE AIRPLANE AIRWORTHINESS DIRECTIVE										W1	
	ASSOCIATED	MOS								26-JUL-2000		
		HRS/MSC	600							7325	7925	
	REF: AD	AFL								5360		
	Method of Compliance: OPEN											
AD 1992-12-02 LEFT AILERON	TO PREVENT REDUCED CONTROLLABILITY OF THE AIRPLANE AIRWORTHINESS DIRECTIVE										W1	
	ASSOCIATED	MOS										
		HRS/MSC	150							0		
	REF: AD	AFL								0		
	Method of Compliance: OPEN											
270106	AILERON, RIGHT										W2	
27.010	5183003-406-2	MOS								11-FEB-1982		
	4376	HRS/MSC	O/C			0				0		
	REF: AMM 27-10-00	AFL								0		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 270140 27.070 ASSOCIATED	CHECK AILERON CONTROL SYSTEM FREEPLAY PKG 3 REF: AMM 27-10-00	MOS HRS/MSC AFL	800							26-JUL-2000 7325 5360	F5	
+ 270265 27.550	CLEAN/CHECK RIGHT GUIDE ROLLERS PKG 2, 3 REF: AMM 5-20-03	MOS HRS/MSC AFL	400							26-JUN-2001 7687 5594	W2	
SB 1124-27-100 R2 R/H RODS ASSOCIATED	FLIGHT CONTROLS SERVICE BULLETIN REF: BULLETINS Method of Compliance: OPEN	MOS HRS/MSC AFL	A/R							0 0	W2	
SB 1124-27-129 RIGHT AILERON ASSOCIATED	FLIGHT CONTROLS SERVICE BULLETIN REF: BULLETINS Method of Compliance: OPEN	MOS HRS/MSC AFL	600							26-JUL-2000 7325 5360	7925 W2	
+ 270263 27.540	INSPECT RIGHT EXTERNAL PUSH-PULL TUBE PKG 2, 3 REF: AMM 5-20-03	MOS HRS/MSC AFL	400							26-JUN-2001 7687 5594	W2	
AD 1996-24-11 RIGHT AILERON ASSOCIATED	TO PREVENT EXCESSIVE WEAR OF THE AILERON PUSH-PULL TUBE, WHICH COULD RESULT IN UNEVEN MOVEMENT OF THE CONTROL WHEEL, PERFORATION OF THE AILERON PUSH-PULL TUBE, AND CONSEQUENT REDUCED ROLL CONTROL OF THE AIRPLANE AIRWORTHINESS DIRECTIVE REF: AD Method of Compliance: OPEN	MOS HRS/MSC AFL	600							26-JUL-2000 7325 5360	7925 W2	
AD 1992-12-02 RIGHT AILERON ASSOCIATED	TO PREVENT REDUCED CONTROLLABILITY OF THE AIRPLANE AIRWORTHINESS DIRECTIVE REF: AD Method of Compliance: OPEN	MOS HRS/MSC AFL	150							0 0	W2	
270291 27.250	BRAKE, SPEED LEFT 5-203007-507 SN-UNKNOWN REF: AMM 27-60-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	W1	
+ 270335 27.280 ASSOCIATED	OPERATIONAL CHECK SPEED BRAKES AND LIFT DUMPERS PKG 1, 2, 3 REF: AMM 27-60-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	F2	
270296 27.250	BRAKE, SPEED RIGHT 5-203007-506 SN-UNKNOWN REF: AMM 27-60-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	W2	

Report Date **13-MAY-2002**

(Alphabetical with Relations)

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 270335 27.280 ASSOCIATED	OPERATIONAL CHECK SPEED BRAKES AND LIFT DUMPERS PKG 1, 2, 3 REF: AMM 27-60-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	F2	
270138 27.080	CHAIN, AILERON LEFT 3533516-1 SN-UNKNOWN REF: AMM 27-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
270139 27.080	CHAIN, AILERON RIGHT 3533516-1 SN-UNKNOWN REF: AMM 27-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
270186 27.140	COLUMN, CONTROL COPILOT PN SN-UNKNOWN REF: AMM 27-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
270181 27.140	COLUMN, CONTROL PILOT PN SN-UNKNOWN REF: AMM 27-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
270191 27.150	ELEVATOR, LEFT 5463012-401-1 4381 REF: AMM 27-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	T1	
+ 270193 27.150	INSPECT SKIN SEPARATION PKG 1, 2, 3 REF: AMM 27-30-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	T1	
270213 27.190 ASSOCIATED	LUBRICATE ELEVATOR ATTACH POINTS PKG 1, 2, 3 REF: AMM 12-20-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	T1	
270210 27.570 ASSOCIATED	VISUAL INSPECT ELEVATOR CONTROL BELLCRANK ASSEMBLY REF: AMM 5-10-00	MOS HRS/MSC AFL	60 5000							16-JUN-1997 6135 4707 16-JUN-2002 11135		
270201 27.150	ELEVATOR, RIGHT 5463012-402-1 4381 REF: AMM 27-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	T1	
+ 270203 27.150	INSPECT SKIN SEPARATION PKG 1, 2, 3 REF: AMM 27-30-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	T1	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION TSN TSO TSR TSI ADJ	Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
270213	LUBRICATE ELEVATOR ATTACH POINTS PKG 1, 2, 3	MOS				26-JUN-2001		T1
27.190	ASSOCIATED	HRS/MS	200			7687		
	REF: AMM 12-20-00	AFL				5594		
270210	VISUAL INSPECT ELEVATOR CONTROL BELL CRANK ASSEMBLY	MOS	60			16-JUN-1997	16-JUN-2002	
27.570	ASSOCIATED	HRS/MS	5000			6135	11135	
	REF: AMM 5-10-00	AFL				4707		
270233	FLAP ASSEMBLY, CONTROL BOX 2813521-	MOS				11-FEB-1982		F3
27.490		HRS/MS	O/C	0		0		
	REF: NO REF	AFL		0		0		
270236	FLAP/VANE, LEFT 5193502-401	MOS				11-FEB-1982		W1
27.200		HRS/MS	O/C	0		0		
	REF: AMM 27-50-00	AFL				0		
+ 270248	FUNCTIONAL CHECK FLAP TIME EXCEED RELAY PKG 2, 3	MOS				26-JUN-2001		F3
27.200	ASSOCIATED	HRS/MS	400			7687		
	REF: AMM 27-50-00	AFL				5594		
+ 270240	INSPECT LEFT FLAP HINGE AND BEARING 200 HOURS PKG 1, 2, 3	MOS				26-JUN-2001		W1
27.200		HRS/MS	200			7687		
	REF: AMM 27-50-00	AFL				5594		
+ 270244	INSPECT LEFT FLAP HINGE AND BEARING 800 HOURS PKG 3	MOS				26-JUL-2000		W1
27.200		HRS/MS	800			7325		
	REF: AMM 27-50-00	AFL				5360		
+ 270237	INSPECT LEFT FLAP VANE PKG 1, 2, 3	MOS				26-JUN-2001		W1
27.200		HRS/MS	200			7687		
	REF: AMM 27-50-00	AFL				5594		
+ 270238	TAP TEST LEFT FLAP PKG 2, 3	MOS				26-JUN-2001		W1
27.200		HRS/MS	400			7687	.5	
	REF: AMM 27-50-00	AFL				5594		
270241	FLAP/VANE, RIGHT 5193502-402	MOS				11-FEB-1982		W2
27.200		HRS/MS	O/C	0		0		
	REF: AMM 27-50-00	AFL				0		
+ 270248	FUNCTIONAL CHECK FLAP TIME EXCEED RELAY PKG 2, 3	MOS				26-JUN-2001		F3
27.200	ASSOCIATED	HRS/MS	400			7687		
	REF: AMM 27-50-00	AFL				5594		

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 270247 27.200	INSPECT PKG 1, 2, 3	MOS								26-JUN-2001	W1	
	REF: AMM 27-50-00	HRS/MSC AFL	200							7687 5594		
+ 270242 27.200	INSPECT RIGHT FLAP HINGE AND BEARING PKG 1, 2, 3	MOS	200 HOURS							26-JUN-2001	W2	
	REF: AMM 27-50-00	HRS/MSC AFL	200							7687 5594		
+ 270245 27.200	INSPECT RIGHT FLAP HINGE AND BEARING PKG 3	MOS	800 HOURS							26-JUL-2000	W2	
	REF: AMM 27-50-00	HRS/MSC AFL	800							7325 5360		
+ 270243 27.200	TAP TEST PKG 2, 3	MOS								26-JUN-2001	W2	
	REF: AMM 27-50-00	HRS/MSC AFL	400							7687 5594	.5	
270276 27.400	GEARBOX, COMPARATOR LEFT 5-703541-501	MOS								11-FEB-1982	W1	
	SN-UNKNOWN	HRS/MSC	O/C	0						0	\$1570.	
	REF: AMM 27-50-00	AFL								0		
+ 270271 27.430 ASSOCIATED	ADJUST/TEST FLAP COMPARATOR PKG 3	MOS								26-JUL-2000	F3	
	REF: AMM 27-50-00	HRS/MSC AFL	800							7325 5360		
270281 27.400	GEARBOX, COMPARATOR RIGHT 5-703541-502	MOS								11-FEB-1982	W2	
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 27-50-00	AFL								0		
+ 270271 27.430 ASSOCIATED	ADJUST/TEST FLAP COMPARATOR PKG 3	MOS								26-JUL-2000	F3	
	REF: AMM 27-50-00	HRS/MSC AFL	800							7325 5360		
270121 27.030	INDICATOR, AILERON TRIM TAB 3883026-515	MOS								11-FEB-1982	F3	
	S0451	HRS/MSC	O/C	0						0		
	REF: AMM 27-10-00	AFL								0		
271101 27.470	INDICATOR, ANGLE-OF-ATTACK LEFT 3883765-501	MOS								11-FEB-1982	F3	
	JN1 066	HRS/MSC	O/C	0						0		
	REF: AMM 34-10-05	AFL								0		
271106 27.470	INDICATOR, ANGLE-OF-ATTACK RIGHT 3883765-501	MOS								11-FEB-1982	F3	
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 34-10-05	AFL								0		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
270288 27.420	INDICATOR, FLAP POSITION COPILOT 6883739-1 SN-UNKNOWN REF: AMM 27-50-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	
270286 27.420	INDICATOR, FLAP POSITION PILOT 6883789-1 81090110 REF: AMM 27-50-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3 \$338.	
270226 27.160	INDICATOR, HORIZONTAL STABILIZER TRIM 3883026-525 T0119 REF: AMM 27-40-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3 \$306.	
270171 27.120	INDICATOR, RUDDER TRIM 3883026-517 T0163 REF: AMM 27-20-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	
270224 27.185	JACKSCREW, HORIZONTAL STABILIZER ACTUATOR NO.1 21164-005 (ACT.ASSY) 0481-11A REF: NO REF	MOS HRSMSC AFL		0				10000		06-APR-1998 6346 4787	LIFE LIMIT T1 14787	
270225 27.185	JACKSCREW, HORIZONTAL STABILIZER ACTUATOR NO.2 21164-005 (ACT.ASSY) 0481-11AA REF: NO REF	MOS HRSMSC AFL		0				10000		06-APR-1998 6346 4787	LIFE LIMIT T1 14787	
270318 27.290	LIFT DUMPER, LEFT WING INBOARD 3713515-501 1L-900 REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W1	
270316 27.290	LIFT DUMPER, LEFT WING OUTBOARD 3713515-501 1L687P REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W1	
270321 27.300	LIFT DUMPER, RIGHT WING INBOARD 3713515-501 1L862P REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W2	
270323 27.300	LIFT DUMPER, RIGHT WING OUTBOARD 5-203007-510 1L881P REF: AMM 27-60-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W2	
270119 27.450	MOTOR, ALERON TRIM PN SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W1	

Report Date **13-MAY-2002**

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
270246	MOTOR, FLAP PRIME									OVERHAUL	F5
27.180	193543-1	MOS						06/01/1993	01-DEC-1992		\$4235.
	160	HRS/MSC	10000		0				5188	15188	1
	REF: AMM 27-50-00	AFL							3829		
270221	MOTOR, PRIMARY HORIZONTAL STABILIZER										T1
27.460	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C		0				0		
	REF: NO REF	AFL							0		
270169	MOTOR, RUDDER TRIM										T1
27.450	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C		0				0		
	REF: NO REF	AFL							0		
270223	MOTOR, SECONDARY HORIZONTAL STABILIZER										T1
27.460	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C		0				0		
	REF: NO REF	AFL							0		
270274	POTENTIOMETER, LINEAR LEFT										W1
27.410	833523-501	MOS							10-AUG-1986		
	SN-UNKNOWN	HRS/MSC	O/C						3515		
	REF: AMM 27-50-00	AFL									
270282	POTENTIOMETER, LINEAR RIGHT										W2
27.410	833523-501	MOS							10-AUG-1986		
	589	HRS/MSC	O/C						3515		
	REF: AMM 27-50-00	AFL									
270128	ROD, CONTROL LEFT AILERON										W1
27.530	513506-503	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C						0		
	REF: NO REF	AFL							0		
+ 270080	X-RAY INSPECT LEFT AILERON CONTROL ROD ASSEMBLIES										W1
27.530		MOS	60						16-JUN-1997	16-JUN-2002	
	SN-UNKNOWN	HRS/MSC	5000						6135	11135	
	REF: NO REF	AFL							4707		
270129	ROD, CONTROL RIGHT AILERON										W2
27.535	513506-503	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C						0		
	REF: NO REF	AFL							0		
+ 270081	X-RAY INSPECT ASSEMBLY										W2
27.535		MOS	60						16-JUN-1997	16-JUN-2002	
	SN-UNKNOWN	HRS/MSC	5000						6135	11135	
	REF: NO REF	AFL							4707		
270141	RUDDER										T1
27.100	5423026-402-2	MOS							11-FEB-1982		
	4370	HRS/MSC	O/C		0				0		
	REF: AMM 27-20-00	AFL							0		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 270150 27.560	X-RAY INSPECT CONTROL ROD ASSEMBLY	MOS	60							16-JUN-1997	16-JUN-2002	T1
		HRS/MS	5000						6135		11135	
	REF: NO REF	AFL							4707			
270279 27.230	SHAFT, FLEXIBLE INBOARD LEFT	MOS								11-FEB-1982	LIFE LIMIT	W1
	193545-501	HRS/MS	10000	0					0		10000	
	1200269	AFL							0			
	REF: AMM 27-50-00											
+ 270280 27.230	CLEAN/INSPECT/LUBRICATE LEFT INBOARD/OUTBOARD FLEXIBLE SHAFT	MOS								16-FEB-2001		W1
	ASSOCIATED	HRS/MS	1200						7551		8751	
	REF: AMM 27-50-00	AFL							5515			
270284 27.240	SHAFT, FLEXIBLE INBOARD RIGHT	MOS								11-FEB-1982	LIFE LIMIT	W2
	193545-505	HRS/MS	10000	0					0		10000	
	1200241	AFL							0			
	REF: AMM 27-50-00											
+ 270285 27.230	CLEAN/INSPECT/LUBRICATE RIGHT INBOARD/OUTBOARD FLEXIBLE SHAFT	MOS								16-FEB-2001		W2
	ASSOCIATED	HRS/MS	1200						7551		8751	
	REF: AMM 27-50-00	AFL							5515			
270278 27.230	SHAFT, FLEXIBLE OUTBOARD LEFT	MOS								11-FEB-1982	LIFE LIMIT	W1
	193545-501	HRS/MS	10000	0					0		10000	
	1200446	AFL							0			
	REF: AMM 27-50-00											
+ 270280 27.230	CLEAN/INSPECT/LUBRICATE LEFT INBOARD/OUTBOARD FLEXIBLE SHAFT	MOS								16-FEB-2001		W1
	ASSOCIATED	HRS/MS	1200						7551		8751	
	REF: AMM 27-50-00	AFL							5515			
270283 27.240	SHAFT, FLEXIBLE OUTBOARD RIGHT	MOS								11-FEB-1982	LIFE LIMIT	W2
	193545-501	HRS/MS	10000	0					0		10000	
	1200514	AFL							0			
	REF: AMM 27-50-00											
+ 270285 27.230	CLEAN/INSPECT/LUBRICATE RIGHT INBOARD/OUTBOARD FLEXIBLE SHAFT	MOS								16-FEB-2001		W2
	ASSOCIATED	HRS/MS	1200						7551		8751	
	REF: AMM 27-50-00	AFL							5515			
270126 27.040	TAB, AILERON SERVO	MOS								11-FEB-1982		W2
	5-183005-505	HRS/MS	O/C	0					0			
	SN-UNKNOWN	AFL							0			
	REF: AMM 27-10-00											
270111 27.020	TAB, AILERON TRIM	MOS								11-FEB-1982		W1
	5-183005-503	HRS/MS	O/C	0					0			
	SN-UNKNOWN	AFL							0			
	REF: AMM 27-10-00											

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
270156	TAB, RUDDER TRIM										T1	
27.110	PN	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: AMM 27-20-00	AFL							0			
+ 270158	INSPECT FREEPLAY										T1	
27.130	PKG 1, 2, 3	MOS							26-JUN-2001			
	REF: AMM 27-20-00	HRS/MSC	200						7687			
		AFL							5594			
271111	TRANSMITTER, ANGLE-OF-ATTACK LEFT										W1	
27.480	SLZ7259	MOS							06-APR-1998			
	KE1141	HRS/MSC	O/C						6346			
	REF: AMM 34-10-05	AFL							4787			
271116	TRANSMITTER, ANGLE-OF-ATTACK RIGHT										W2	
27.480	SLZ-9280	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: AMM 34-10-05	AFL		0					0			
270231	TRANSMITTER, TRIM POSITION INDICATOR										T1	
27.390	8TJ39-BAR-2	MOS							11-FEB-1982		\$543.	
	T1353	HRS/MSC	O/C	0					0			
	REF: AMM 27-40-00	AFL							0			
270336	VALVE, LIFT DUMPER CONTROL										F5	
27.330	723573-1	MOS							11-FEB-1982		\$362.	
	698	HRS/MSC	O/C	0					0			
	REF: AMM 27-60-00	AFL							0			
270311	VALVE, SPEED BRAKE CONTROL										F5	
27.270	723573-1	MOS							11-FEB-1982		\$362.	
	845	HRS/MSC	O/C	0					0			
	REF: AMM 27-60-00	AFL							0			
270136	WHEEL, CONTROL COPILOT										F3	
27.050	5-533060-35	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: AMM 27-10-00	AFL							0			
270131	WHEEL, CONTROL PILOT										F3	
27.050	5-533060-37	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: AMM 27-10-00	AFL							0			
CHAPTER 28	FUEL											
+ 281150	CHECK OPERATION OF FUEL BOOST PUMPS										F5	
28.010	PKG 1, 2, 3	MOS							26-JUN-2001			
	REF: AMM 28-00-00	HRS/MSC	200						7687			
		AFL							5594			
+ 281603	FUNCTIONAL CHECK FUEL DUMP SYSTEM										F5	
28.090		MOS							22-FEB-2000			
	REF: AMM 28-00-00	HRS/MSC	1200						7107	8307		
		AFL							5232			

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
+ 281602 28.090	OPERATIONAL CHECK FUEL DUMP SYSTEM PKG 3	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	F5	
281101 28.200	INDICATOR, FUEL QUANTITY LEFT 6883707-1 359 REF: AMM 28-00-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F3 \$444. 1	
281106 28.200	INDICATOR, FUEL QUANTITY RIGHT 6883707-1 361 REF: AMM 28-40-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F3 \$444. 1	
281108 28.210	INDICATOR, FUEL STATUS 6883710-501 173 REF: NO REF	MOS HRS/MSC AFL	O/C						11-FEB-1982	F3	
280626 28.160	PROBE, LEFT TIP TANK 6653505-519 227 REF: AMM 28-40-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	W1	
280616 28.140	PROBE, LEFT WING INBOARD 5653505-507 207 REF: AMM 28-40-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	W1	
280621 28.140	PROBE, LEFT WING OUTBOARD 5653505-505 214 REF: AMM 28-40-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	W1	
280646 28.160	PROBE, RIGHT TIP TANK 6653505-519 233 REF: AMM 28-40-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	W2	
280638 28.150	PROBE, RIGHT WING INBOARD 5653505-507 266 REF: AMM 28-40-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	W2	
280641 28.150	PROBE, RIGHT WING OUTBOARD 5653505-505 235 REF: AMM 28-40-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	W2	
280611 28.130	PROBE, FUSELAGE LEFT 3653505-509 224 REF: AMM 28-40-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F5	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
280631 28.130	PROBE, FUSELAGE RIGHT 6653505-509	MOS								11-FEB-1982	F5	
	291	HRS/MSC	O/C	0						0		
	REF: AMM 28-40-00	AFL								0		
280126 28.020	PUMP, ALTERNATE BOOST LEFT 5653744-505	MOS								11-FEB-1982	W1	
	T514	HRS/MSC	O/C	0						0		
	REF: AMM 28-20-00	AFL								0		
280128 28.020	CHECK BRUSH WEAR	MOS								11-FEB-1982	W1	
		HRS/MSC	O/C							0		
	REF: See Workcard	AFL								0		
+ 281150 28.010 ASSOCIATED	CHECK OPERATION OF FUEL BOOST PUMPS PKG 1, 2, 3	MOS								26-JUN-2001	F5	
		HRS/MSC	200							7687		
	REF: AMM 28-00-00	AFL								5594		
280136 28.020	PUMP, ALTERNATE BOOST RIGHT 5653744	MOS								30-OCT-1989	W2	
	853	HRS/MSC	O/C							4401		
	REF: AMM 28-20-00	AFL								2956		
280138 28.020	CHECK BRUSH WEAR	MOS								11-FEB-1982	W2	
		HRS/MSC	O/C							0		
	REF: See Workcard	AFL								0		
+ 281150 28.010 ASSOCIATED	CHECK OPERATION OF FUEL BOOST PUMPS PKG 1, 2, 3	MOS								26-JUN-2001	F5	
		HRS/MSC	200							7687		
	REF: AMM 28-00-00	AFL								5594		
280161 28.110	PUMP, FUSELAGE JET LEFT 3-653015	MOS								11-FEB-1982	F5	
	1095	HRS/MSC	O/C	0						0		
	REF: AMM 28-20-00	AFL								0		
280166 28.110	PUMP, FUSELAGE JET RIGHT 3-653015	MOS								11-FEB-1982	F5	
	1099	HRS/MSC	O/C	0						0		
	REF: AMM 28-20-00	AFL								0		
280181 28.100	PUMP, JET LEFT TIP TANK 3-653015	MOS								11-FEB-1982	W1	
	1309	HRS/MSC	O/C	0						0		
	REF: AMM 28-20-00	AFL								0		
280186 28.100	PUMP, JET RIGHT TIP TANK 3-653015	MOS								11-FEB-1982	W2	
	1311	HRS/MSC	O/C	0						0		
	REF: AMM 28-20-00	AFL								0		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
280167 28.230	PUMP, LONG RANGE BOOST 653009-513 SN-UNKNOWN REF: AMM 28-50-00	MOS HRSMSC AFL	O/C							11-FEB-1982	F4	
280121 28.010	PUMP, MAIN BOOST LEFT 2070C01T3 T-330 REF: AMM 28-20-00	MOS HRSMSC AFL	O/C		0					24-APR-2000 7233 5301	W1	
280123 28.010	CHECK BRUSH WEAR REF: NO REF	MOS HRSMSC AFL	O/C							24-APR-2000 7233 5301	W1	
+ 281150 28.010 ASSOCIATED	CHECK OPERATION OF FUEL BOOST PUMPS PKG 1, 2, 3 REF: AMM 28-00-00	MOS HRSMSC AFL	200							26-JUN-2001 7687 5594	F5	
280131 28.010	PUMP, MAIN BOOST RIGHT 2070C01T3 T1222 REF: AMM 28-20-00	MOS HRSMSC AFL	O/C		0	0	0			26-AUG-1992 5151 3777	W2	
280133 28.010	CHECK BRUSH WEAR REF: See Workcard	MOS HRSMSC AFL	O/C							26-AUG-1992 5151 3777	W2	
+ 281150 28.010 ASSOCIATED	CHECK OPERATION OF FUEL BOOST PUMPS PKG 1, 2, 3 REF: AMM 28-00-00	MOS HRSMSC AFL	200							26-JUN-2001 7687 5594	F5	
281121 28.210	SIGNAL CONDITIONER, FUEL 883711-501 157 REF: NO REF	MOS HRSMSC AFL	O/C		0					11-FEB-1982 0 0	F2	
280281 28.190	SWITCH, FUEL FLOAT LEFT 833006 A966 REF: NO REF	MOS HRSMSC AFL	O/C		0					11-FEB-1982 0 0	F5	
280286 28.190	SWITCH, FUEL FLOAT RIGHT 833006 A920 REF: NO REF	MOS HRSMSC AFL	O/C		0					11-FEB-1982 0 0	F5	
281141 28.170	SWITCH, LOW-LEVEL WARNING LEFT 3833006 SN-UNKNOWN REF: AMM 28-40-00	MOS HRSMSC AFL	O/C		0					11-FEB-1982 0 0	F5	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
281146	SWITCH, LOW-LEVEL WARNING RIGHT									F5	
28.170	3833006	MOS						11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C		0			0			
	REF: AMM 28-40-00	AFL						0			
281139	SWITCH, PRESSURE(LONG RANGE)									F4	
28.240	833010-518	MOS						11-FEB-1982			
	A-149	HRS/MSC	O/C		0			0			
	REF: NO REF	AFL						0			
280250	TANK, FUEL (LONG RANGE)									F5	
28.220	CMA61032-501	MOS				0		07-DEC-1989			
	NSN	HRS/MSC	O/C			0		4437			
	REF: AMM 28-50-00	AFL				0		2994			
281110	TRANSMITTER, QUANTITY (LONG RANGE)									F4	
28.240	DA515A050	MOS						11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C		0			0			
	REF: NO REF	AFL						0			
280191	VALVE, DUMP LEFT									W1	
28.090	3653014	MOS						11-FEB-1982		\$725.	
	168	HRS/MSC	O/C		0			0			
	REF: AMM 28-30-00	AFL						0			
+ 281603	FUNCTIONAL CHECK FUEL DUMP SYSTEM									F5	
28.090		MOS						22-FEB-2000			
ASSOCIATED		HRS/MSC	1200					7107	8307		
	REF: AMM 28-00-00	AFL						5232			
+ 281602	OPERATIONAL CHECK FUEL DUMP SYSTEM									F5	
28.090	PKG 3	MOS						26-JUL-2000			
ASSOCIATED		HRS/MSC	800					7325			
	REF: AMM 28-00-00	AFL						5360			
280196	VALVE, DUMP RIGHT									W2	
28.090	3653014	MOS						11-FEB-1982		\$725.	
	31360	HRS/MSC	O/C		0			0			
	REF: AMM 28-30-00	AFL						0			
+ 281603	FUNCTIONAL CHECK FUEL DUMP SYSTEM									F5	
28.090		MOS						22-FEB-2000			
ASSOCIATED		HRS/MSC	1200					7107	8307		
	REF: AMM 28-00-00	AFL						5232			
+ 281602	OPERATIONAL CHECK FUEL DUMP SYSTEM									F5	
28.090	PKG 3	MOS						26-JUL-2000			
ASSOCIATED		HRS/MSC	800					7325			
	REF: AMM 28-00-00	AFL						5360			
280141	VALVE, FIRE WALL SHUTOFF LEFT									E1	
28.040	3653012	MOS						11-FEB-1982			
	L38199	HRS/MSC	O/C		0			0			
	REF: AMM 28-20-00	AFL						0			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
280151 28.040	VALVE, FIREWALL SHUTOFF RIGHT 3-653012 L35008 REF: AMM 28-20-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	E2 \$725.	
280251 28.050	VALVE, FUEL AUTO SHUTOFF LEFT 3653669 0114 REF: AMM 28-10-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
280256 28.050	VALVE, FUEL AUTO SHUTOFF RIGHT 3653669 0087 REF: AMM 28-10-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
280106 28.030	VALVE, FUEL INTERCONNECT AFT 3653014 31395 REF: AMM 28-10-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5 \$725.	
280101 28.030	VALVE, FUEL INTERCONNECT FORWARD AV16B1683 L18181 REF: AMM 28-10-00	MOS HRSMSC AFL	O/C							16-JUN-1997 6135 4707	F5 \$725.	
280261 28.060	VALVE, FUEL PILOT LEFT 3653671 7732 REF: AMM 28-10-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
280266 28.060	VALVE, FUEL PILOT RIGHT 3653671 7728 REF: AMM 28-10-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
280194 28.070	VALVE, FUEL PRECHECK LEFT PN SN-UNKNOWN REF: AMM 28-10-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
280203 28.070	VALVE, FUEL PRECHECK RIGHT PN SN-UNKNOWN REF: AMM 28-10-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
280206 28.180	VALVE, FUEL SOLENOID LEFT MS-29527-1 744 REF: NO REF	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
280211 28.180	VALVE, FUEL SOLENOID RIGHT MS-29527-1 752 REF: NO REF	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
280171	VALVE, FUEL TRANSFER LEFT										F5	
28.120	4653572	MOS								11-FEB-1982	\$805.	
	101	HRS/MS	O/C	0					0			
	REF: AMM 28-20-00	AFL							0			
280176	VALVE, FUEL TRANSFER RIGHT										F5	
28.120	4653572	MOS								11-FEB-1982	\$805.	
	126	HRS/MS	O/C	0					0			
	REF: AMM 28-20-00	AFL							0			
280290	VALVE, SINGLE POINT REFUEL ADAPTER										F5	
28.250	3653670	MOS								11-FEB-1982		
	205	HRS/MS	O/C						0			
	REF: NO REF	AFL							0			
280271	VALVE, SINGLE POINT REFUEL VENT LEFT										F5	
28.080	3653672	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MS	O/C	0					0			
	REF: AMM 28-10-00	AFL		0					0			
280276	VALVE, SINGLE POINT REFUEL VENT RIGHT										F5	
28.080	3653672	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MS	O/C	0					0			
	REF: AMM 28-10-00	AFL		0					0			
CHAPTER 29	HYDRAULIC POWER											
290221	ACCUMULATOR, EMERGENCY										F5	
29.080	3713008	MOS								11-FEB-1982	\$472.	
	601	HRS/MS	O/C	0					0			
	REF: AMM 29-20-00	AFL							0			
290151	ACCUMULATOR, LEFT HYDRAULIC										F5	
29.130	4-713569-1	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MS	O/C	0					0			
	REF: NO REF	AFL							0			
290186	ACCUMULATOR, RIGHT HYDRAULIC										F5	
29.130	4-713569-1	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MS	O/C	0					0			
	REF: NO REF	AFL							0			
290261	ATTENUATOR, NO.1 ENG HYDRAULIC										F5	
29.040	3713562-1	MOS								11-FEB-1982		
	0601	HRS/MS	O/C	0					0			
	REF: AMM 29-10-00	AFL							0			
290266	ATTENUATOR, NO.2 ENG HYDRAULIC										F5	
29.040	3713562-1	MOS								11-FEB-1982		
	0591	HRS/MS	O/C	0					0			
	REF: AMM 29-10-00	AFL							0			
290119	CHECK VALVE, RESERVOIR BLEED AIR										F5	
29.180	PN	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MS	O/C	0					0			
	REF: NO REF	AFL							0			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
290248 29.110	FUSE, EMERGENCY HYDRAULIC 3713047 3383 REF: AMM 29-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F2	
290246 29.100	GAUGE, EMERGENCY HYDRAULIC PRESSURE 4883746-1 SN-UNKNOWN REF: AMM 29-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
290148 29.140	GAUGE, LEFT ACCUMULATOR PRESSURE 7253014-501 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5	
290183 29.140	GAUGE, RIGHT ACCUMULATOR PRESSURE 7253014-501 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5	
290236 29.160	INDICATOR, HYDRAULIC PRESSURE 4883746-1 8007104 REF: AMM 29-30-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
290211 29.060	PUMP, EMERGENCY HYDRAULIC 3713010-505 13747 REF: AMM 29-20-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5 \$805.	
290215 29.110	FUNCTIONAL TEST EMERGENCY HYDRAULIC FUSE REF: AMM 29-30-06	MOS HRS/MSC AFL	36 1200							30-NOV-1999 6991 5163	30-NOV-2002 8191	
290141 29.120	PUMP, HYDRAULIC NO. 1 5713524-507 B1-58 REF: AMM 29-10-00	MOS HRS/MSC AFL	O/C		0					09-OCT-1990 4718 3309	E1	
+ 290143 29.120	INSPECT/LUBRICATE NO.1 ENGINE HYDRAULIC PUMP SPLINES PKG 1, 2, 3 REF: AMM 29-10-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	E1 1	
290176 29.120	PUMP, HYDRAULIC NO. 2 5713524-507 A2-84 REF: AMM 29-10-00	MOS HRS/MSC AFL	O/C		0					04-FEB-1994 5390 4040	E2 1	
+ 290178 29.120	INSPECT/LUBRICATE NO.2 ENGINE HYDRAULIC PUMP SPLINES PKG 1, 2, 3 REF: AMM 29-10-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	E2 1	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
290121	REGULATOR, RESERVOIR AIR PRESSURE									F5	
29.050	3713015	MOS							11-FEB-1982	\$1046.	
	509	HRS/MSC	O/C		0				0		
	REF: AMM 29-10-00	AFL							0		
290118	CLEAN/CHECK HYDRAULIC RESERVOIR AIR PRESSURE CHECK VALVE									F5	
29.050	PKG 2, 3	MOS							26-JUN-2001		
	509	HRS/MSC	400						7687		
	REF: AMM 5-20-00	AFL							5594		
+ 290131	INSPECT/REPLACE RESERVOIR AIR PRESSURE FILTER									F5	
29.050	PKG 3	MOS							26-JUL-2000		
		HRS/MSC	800						7325		
	REF: AMM 29-10-00	AFL							5360		
+ 290116	INSPECT/REPLACE RESERVOIR AIR VENT FILTER									F5	
29.050	PKG 3	MOS							26-JUL-2000		
	509	HRS/MSC	800						7325		
	REF: AMM 29-10-10	AFL							5360		
290171	REPLACE NO.1 ENGINE HIGH PRESSURE HYDRAULIC FILTER ELEMENT									F5	
29.050	PKG 3	MOS							26-JUL-2000		
		HRS/MSC	800						7325		
	REF: AMM 29-10-10	AFL							5360		
290206	REPLACE NO.2 ENGINE HIGH PRESSURE HYDRAULIC FILTER ELEMENT									F5	
29.050	PKG 3	MOS							26-JUL-2000		
		HRS/MSC	800						7325		
	REF: AMM 29-10-10	AFL							5360		
290101	RESERVOIR, HYDRAULIC									F5	
29.010	5713014-505	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C		0				0		
	REF: AMM 29-10-00	AFL							0		
290106	REPLACE FILTER									F5	
29.010	PKG 3	MOS							26-JUL-2000		
		HRS/MSC	800						7325		
	REF: AMM 29-10-00	AFL							5360		
290226	SWITCH, EMERGENCY HYDRAULIC PRESSURE									F5	
29.090	4833010-515	MOS							11-FEB-1982		
	872	HRS/MSC	O/C		0				0		
	REF: AMM 29-20-00	AFL							0		
290241	SWITCH, NO.1 LOW HYDRAULIC PRESSURE WARNING									F5	
29.170	4713533-1	MOS							11-FEB-1982		
	798	HRS/MSC	O/C		0				0	1	
	REF: AMM 29-30-00	AFL							0		
290243	SWITCH, NO.2 LOW HYDRAULIC PRESSURE WARNING									F5	
29.170	4713533-1	MOS							11-FEB-1982		
	788	HRS/MSC	O/C		0				0		
	REF: AMM 29-30-00	AFL							0		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
290231	TRANSMITTER, HYDRAULIC PRESSURE										F5	
29.150	3883028	MOS								11-FEB-1982	\$507.	
	8005119	HRS/MSC	O/C	0					0			
	REF: AMM 29-30-00	AFL							0			
290133	VALVE, BLEED RETURN										F5	
29.180	PN	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
290216	VALVE, EMERGENCY THERMAL RELIEF										F5	
29.070	4713011-1	MOS								11-FEB-1982		
	1L82	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
290138	VALVE, HYDRAULIC PRESSURE RELIEF										F5	
29.190	373596-501	MOS								11-FEB-1982		
	158	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
290146	VALVE, LEFT HYDRAULIC SHUTOFF										E1	
29.020	713020-	MOS								11-FEB-1982	\$322.	
	080	HRS/MSC	O/C	0					0			
	REF: AMM 29-10-00	AFL							0			
290136	VALVE, MANUAL HIGH-PRESSURE RELIEF										F5	
29.030	3723628	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
290181	VALVE, RIGHT HYDRAULIC SHUTOFF										E2	
29.020	713020-	MOS								11-FEB-1982	\$322.	
	074	HRS/MSC	O/C	0					0			
	REF: AMM 29-10-00	AFL							0			
290271	VALVE, THERMAL HYDRAULIC RELIEF										F5	
29.190	3713554	MOS								11-FEB-1982		
	0168	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
CHAPTER 30	ICE AND RAIN PROTECTION											
+ 300133	FUNCTIONAL CHECK PNEUMATIC DE-ICER BOOTS.										F3	
30.100	PKG 3	MOS								26-JUL-2000		
		HRS/MSC	800						7325			
	REF: AMM 30-10-00	AFL							5360			
+ 300150	INSPECT COPILOT WINDSHIELD CYCLING CONTACTOR										F3	
30.140	PKG 1, 2, 3	MOS								26-JUN-2001		
		HRS/MSC	200						7687			
	REF: AMM 30-40-00	AFL							5594			
+ 300147	INSPECT PILOT WINDSHIELD CYCLING CONTACTOR										F3	
30.140	PKG 1, 2, 3	MOS								26-JUN-2001		
		HRS/MSC	200						7687			
	REF: AMM 30-40-00	AFL							5594			

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO	WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
					TSN	TSO	TSR	TSI	ADJ				
+ 300163	30.160	INSPECT WINDSHIELD WIPER ASSEMBLY PKG 1, 2, 3	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594		
300170	30.150	OPERATIONAL TEST P2T2 SENSOR HEATER PKG 1, 2, 3	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594		
300165	30.170	REPLACE WIPER BLADE ELEMENT NOTE: IT IS RECOMMENDED TO REPLACE WIPER BLADE ELEMENT EVERY 6 MONTHS OR 250 HOURS.	MOS HRS/MSC AFL								06-NOV-2001 7774 5641		
300101	30.010	CHECK VALVE, DE-ICER LEFT PN SN-UNKNOWN REF: AMM 30-10-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F4	
+ 300102	30.010	INSPECT PKG 2, 3	MOS HRS/MSC AFL	400							26-JUN-2001 7687 5594	F4	
300103	30.010	CHECK VALVE, DE-ICER RIGHT PN SN-UNKNOWN REF: AMM 30-10-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F4	
+ 300104	30.010	INSPECT PKG 2, 3	MOS HRS/MSC AFL	400							26-JUN-2001 7687 5594	F4	
300146	30.110	CONTROLLER, WINDSHIELD TEMPERATURE LEFT HYLZ9661 982B REF: AMM 30-40-00	MOS HRS/MSC AFL		0	O/C	0				22-FEB-2000 7107 5232	F3	
300148	30.110	CONTROLLER, WINDSHIELD TEMPERATURE RIGHT 833034-1 SN-UNKNOWN REF: AMM 30-40-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
300111	30.030	EJECTOR, AIR 850278-1 RF3295 REF: AMM 30-10-00	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F4	
300156	30.130	MOTOR, WINDSHIELD WIPER LEFT XW21126-315-R32 2-22826 REF: AMM 30-40-00	MOS HRS/MSC AFL		0	O/C	0				26-JUL-2000 7325 5360	F3 \$354. 7	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
300161 30.130	MOTOR, WINDSHIELD WIPER RIGHT 5823099-402 213743 REF: AMM 30-40-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F3	
300106 30.020	REGULATOR, PRESSURE 4753042-501 3300U REF: AMM 30-10-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F4 \$403.	
300116 30.040	SWITCH, PRESSURE 3753045-507 287 REF: AMM 30-10-00	MOS HRSMSC AFL	O/C	0					31-OCT-1992 5170 3802	F4	
300141 30.090	SWITCH, PRESSURE INDICATOR NO. 1 ENGINE 12299 SN-UNKNOWN REF: AMM 30-20-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	E1	
300144 30.090	SWITCH, PRESSURE INDICATOR NO. 2 ENGINE 12299 1246 REF: AMM 30-20-00	MOS HRSMSC AFL	O/C	0				06/29/1993	29-DEC-1992 5203 4938	E2	
300121 30.050	SWITCH, VACUUM 3-753064-501 277 REF: AMM 30-10-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F4	
300151 30.120	SWITCH, WINDSHIELD THERMOSTAT LEFT PN SN-UNKNOWN REF: AMM 30-40-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F3	
300153 30.120	SWITCH, WINDSHIELD THERMOSTAT RIGHT PN SN-UNKNOWN REF: AMM 30-40-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F3	
300131 30.070	TIMER, DE-ICER 3-753046-1 G426 REF: AMM 30-10-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F4	
300126 30.060	VALVE, DISTRIBUTOR 753511-1 41359U REF: AMM 30-10-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F4	
300136 30.080	VALVE, NO. 1 NACELLE ANTI-ICE F10A-5-SCP-102-5 193RW REF: AMM 30-20-00	MOS HRSMSC AFL	O/C	0					30-JAN-1984 1468 908	E1	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION			COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR			
300138	VALVE, NO.2 NACELLE ANTI-ICE								E2
30.080	F10A-5-SCP-102-5	MOS					12-OCT-1983		
	8100435	HRS/MSC	O/C	0			1321		
	REF: AMM 30-20-00	AFL					810		
CHAPTER 31	INDICATING/RECORDING SYSTEMS								
310101	CLOCK, COCKPIT DIGITAL								F3
31.010	811-B	MOS					11-FEB-1982		
	15324	HRS/MSC	O/C	0			0		
	REF: NO REF	AFL					0		
CHAPTER 32	LANDING GEAR								
321189U	-- REPL SPARE MAIN WHEEL BLT								
		MOS					26-NOV-1989		
		HRS/MSC	O/C				4427		
	REF:	AFL					2984		
322136	BLEED BRAKE SYSTEM								L2
32.400		MOS					17-JAN-2001		
		HRS/MSC	O/C				7494		
	REF: AMM 32-43-00	AFL					5466		
320678	DYE PENETRANT CHECK LEFT WHEEL AXLE								L1
32.550	PKG 2, 3	MOS					26-JUN-2001		
		HRS/MSC	400				7687		
	REF: AMM 5-20-04	AFL					5594		
321178	DYE PENETRANT CHECK RIGHT WHEEL AXLE								L2
32.550	PKG 2, 3	MOS					26-JUN-2001		
		HRS/MSC	400				7687		
	REF: AMM 5-20-04	AFL					5594		
+ 322176	FUNCTIONAL CHECK ANTI-SKID DETECTOR SYSTEM								F3
32.420	PKG 2, 3	MOS					26-JUN-2001		
		HRS/MSC	400				7687		1
	REF: AMM 32-44-00	AFL					5594		
+ 322211	FUNCTIONAL TEST EMERGENCY GEAR EXTENSION								F3
32.450	PKG 3	MOS					26-JUL-2000		
		HRS/MSC	800				7325		
	REF: AMM 32-30-00	AFL					5360		
+ 322206	FUNCTIONAL TEST EMERGENCY GEAR EXTENSION CONTROL CABLE								F3
32.440	PKG 1, 2, 3	MOS					26-JUN-2001		
		HRS/MSC	200				7687		1
	REF: AMM 32-30-00	AFL					5594		
+ 322191	FUNCTIONAL TEST LANDING GEAR (NORMAL)								F3
32.430	PKG 2, 3	MOS					26-JUN-2001		
		HRS/MSC	400				7687		
	REF: AMM 32-30-00	AFL					5594		
+ 322201	FUNCTIONAL TEST LANDING GEAR FREE FALL								F3
32.430	PKG 2, 3	MOS					26-JUN-2001		
		HRS/MSC	400				7687		
	REF: See Workcard	AFL					5594		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 320691 32.020	INSPECT LEFT MAIN GEAR/WELL (A) PKG 1, 2, 3	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	L1 1.5	
	REF: AMM 5-20-04											
+ 320201 32.0101	INSPECT NOSE GEAR (A) PKG 1, 2, 3	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	L3 1.5	
	REF: AMM 5-20-01											
+ 320206 32.0102	INSPECT NOSE GEAR (B) PKG 2, 3	MOS HRS/MSC AFL	400							26-JUN-2001 7687 5594	L3	
	REF: AMM 5-20-01											
+ 322156 32.410	INSPECT/CLEAN LEFT ANTI-SKID DETECTOR PKG 1, 2, 3	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	L1 1	
	REF: AMM 5-20-04											
+ 322171 32.410	INSPECT/CLEAN RIGHT ANTI-SKID DETECTOR PKG 1, 2, 3	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	L2 1	
	REF: AMM 5-20-04											
320607 32.570	LUBRICATE LEFT ACTUATOR BOLTS PKG 2, 3	MOS HRS/MSC AFL	400							26-JUN-2001 7687 5594	L1	
	REF: AMM 5-20-04/SL WW-2494R3											
321107 32.570	LUBRICATE RIGHT ACTUATOR BOLTS PKG 2, 3	MOS HRS/MSC AFL	400							26-JUN-2001 7687 5594	L2	
	REF: AMM 5-20-04/SL WW-2494R3											
+ 322174 32.425	OPERATIONAL CHECK ANTI-SKID LIGHTS PKG 1, 2, 3	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	F3 .5	
	REF: AMM 32-44-00											
320686 32.180	REPLACE LEFT MAIN WHEEL BOLTS	MOS HRS/MSC AFL	O/C							09-NOV-1996 5951 4589	L1	
	REF: NO REF											
321186 32.180	REPLACE RIGHT MAIN WHEEL BOLTS	MOS HRS/MSC AFL	O/C							09-NOV-1996 5951 4589	L2	
	REF: NO REF											
320186 32.150	RIG STEERING SYSTEM	MOS HRS/MSC AFL	C/C							11-FEB-1982 0 0	L3	
	REF: AMM 32-50-00											

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
320621	AXLE, PISTON ROD FORK/ LEFT									L1	
32.220	ES12908-503	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: AMM 32-20-01	AFL							0		
321121	AXLE, PISTON ROD FORK/ RIGHT									L2	
32.220	ES12908-504	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: AMM 32-20-01	AFL							0		
321611	BOTTLE, EMERGENCY STORAGE									LIFE LIMIT	
32.350	3753015-501	MOS	288	0					11-FEB-1982	11-FEB-2006	
	07510A1	HRS/MSC		0					0	1	
	REF: AMM 32-30-12	AFL		0					0		
+ 321616	CHECK LANDING GEAR EMERGENCY SYSTEM PRESSURE									F5	
32.350	PKG 2, 3	MOS							26-JUN-2001		
		HRS/MSC	400						7687		
	REF: AMM 12-10-04	AFL							5594		
+ 321613	HYDROSTATIC TEST									F5	
32.350		MOS	36						26-OCT-1999	26-OCT-2002	
		HRS/MSC							6961		
	REF: AMM 32-30-12	AFL							5135		
320171	BRACE ASSEMBLY, DRAG NOSE GEAR									L3	
32.240	PN	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: AMM 32-20-02	AFL							0		
320173	ADJUST PRELOAD									L3	
32.240		MOS							11-FEB-1982		
		HRS/MSC	C/C						0		
	REF: AMM 32-20-02	AFL							0		
320611	BRACE ASSEMBLY, SIDE/JURY LEFT MAIN GEAR									L1	
32.230	EA1681-503	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: AMM 32-10-02	AFL							0		
320616	ADJUST LEFT JURY BRACE PRELOAD									L1	
32.230		MOS							11-FEB-1982		
		HRS/MSC	C/C						0		
	REF: AMM 32-10-02	AFL							0		
321111	BRACE ASSEMBLY, SIDE/JURY RIGHT MAIN GEAR									L2	
32.230	EA1681-503	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: AMM 32-10-02	AFL							0		
321116	ADJUST RIGHT JURY BRACE PRELOAD									L2	
32.230		MOS							11-FEB-1982		
		HRS/MSC	C/C						0		
	REF: AMM 32-10-02	AFL							0		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
320232 32.600	BRACKET, LOWER STEERING NOSE GEAR A0122360300-001 SN-UNKNOWN REF: AMM 32-50-08	MOS HRS/MSC AFL	O/C							22-FEB-2000 7107 5232	L3	
+ 320238 32.600	INSPECT REF: AMM 32-50-08	MOS HRS/MSC AFL	1600							22-FEB-2000 7107 5232	L3	
SB 1124-32-139 LOWER ASSOCIATED	LANDING GEAR SERVICE BULLETIN REF: Method of Compliance: OPEN	MOS HRS/MSC AFL	A/R							0 0		
320231 32.600	BRACKET, UPPER STEERING NOSE GEAR A01223603000-001 SN-UNKNOWN REF: AMM 32-50-08	MOS HRS/MSC AFL	O/C							22-FEB-2000 7107 5232	L3	
+ 320237 32.600	INSPECT REF: AMM 32-50-08	MOS HRS/MSC AFL	1600							22-FEB-2000 7107 5232	L3	
SB 1124-32-139 UPPER ASSOCIATED	LANDING GEAR SERVICE BULLETIN PKG 3 REF: Method of Compliance: OPEN	MOS HRS/MSC AFL	800							26-JUL-2000 7325 5360	8125	
322113 32.390	BRAKE, LEFT MAIN GEAR 5002805-3 21139-1 REF: AMM 32-43-01	MOS HRS/MSC AFL	O/C	0	0	0				17-JAN-2001 7494 5466	L1 \$1978. 2	
322136 32.400 ASSOCIATED	BLEED BRAKE SYSTEM REF: AMM 32-43-00	MOS HRS/MSC AFL	O/C							17-JAN-2001 7494 5466	L2	
+ 322116 32.390	INSPECT/CHECK LEFT BRAKE LININGS PKG 1, 2, 3 REF: AMM 32-43-01	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	L1 1	
322128 32.390	BRAKE, RIGHT MAIN GEAR 5002805-3 JAN86-531 REF: AMM 32-43-01	MOS HRS/MSC AFL	O/C	0	0	0				17-JAN-2001 7494 5466	L2 \$1978. 2	
322136 32.400 ASSOCIATED	BLEED BRAKE SYSTEM REF: AMM 32-43-00	MOS HRS/MSC AFL	O/C							17-JAN-2001 7494 5466	L2	

Report Date **13-MAY-2002**

Aircraft Model - **1124 WESTWIND**
Owner Name - **R&S AIRCRAFT INVESTMENTS, LLC**
A/C Serial #: **368 A/C Reg. #: N368MD**

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 322131 32.390	INSPECT/CHECK RIGHT BRAKE LININGS PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594	L2 1		
	REF: AMM 32-43-01											
322141 32.490	CONTROL BOX, ANTI-SKID 5-823519-503	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F5 2		
	REF: AMM 32-44-01											
+ 322176 32.420	FUNCTIONAL CHECK ANTI-SKID DETECTOR SYSTEM PKG 2, 3	MOS HRS/MSC AFL	400						26-JUN-2001 7687 5594	F3 1		
	ASSOCIATED											
	REF: AMM 32-44-00											
320121 32.060	CYLINDER, ACTUATOR NOSE GEAR 5713059-505	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L3 \$483. 3		
	REF: AMM 32-30-06											
320646 32.310	CYLINDER, AFT ACTUATING LEFT MAIN GEAR 5713061-505	MOS HRS/MSC AFL	O/C						09-JUN-1989 4274 2800	L1 \$443.		
	SN-UNKNOWN											
	REF: AMM 32-30-03											
321146 32.310	CYLINDER, AFT ACTUATING RIGHT MAIN GEAR 5713061-505	MOS HRS/MSC AFL	O/C	0					13-NOV-1995 5718 4397	L2 \$443.		
	REF: AMM 32-30-03											
320641 32.300	CYLINDER, FORWARD ACTUATING LEFT MAIN GEAR 5713061-505	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L1 \$443.		
	REF: AMM 32-30-03											
321141 32.300	CYLINDER, FORWARD ACTUATING RIGHT MAIN GEAR 5713061-505	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L2 \$443.		
	REF: AMM 32-30-03											
320181 32.140	CYLINDER, STEERING ACTUATING LEFT 4713096-509	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L3 5		
	REF: AMM 32-50-02											
320184 32.140	CYLINDER, STEERING ACTUATING RIGHT 4713096-509	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L3 5		
	REF: AMM 32-50-02											
320651 32.260	CYLINDER, UNLOCK LEFT MAIN GEAR 4713058-505	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L1		
	REF: AMM 32-30-05											

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
321151 32.260	CYLINDER, UNLOCK RIGHT MAIN GEAR 4713058-505 1091 REF: AMM 32-30-05	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	L2	
320126 32.070	CYLINDER, UPLOCK NOSE GEAR 4713005-501 0567 REF: AMM 32-30-08	MOS HRSMSC AFL	O/C	0				06/08/1995		08-DEC-1994 5526 4218	L3	
322151 32.410	DETECTOR, ANTI-SKID LEFT MAIN GEAR 5-713513-503 200 REF: AMM 32-44-06	MOS HRSMSC AFL	O/C	0						13-JUL-1988 3978 2511	L1 \$1064. 1	
+ 322176 32.420 ASSOCIATED	FUNCTIONAL CHECK ANTI-SKID DETECTOR SYSTEM PKG 2, 3 REF: AMM 32-44-00	MOS HRSMSC AFL	400							26-JUN-2001 7687 5594	F3 1	
+ 322156 32.410 ASSOCIATED	INSPECT/CLEAN LEFT ANTI-SKID DETECTOR PKG 1, 2, 3 REF: AMM 5-20-04	MOS HRSMSC AFL	200							26-JUN-2001 7687 5594	L1 1	
+ 322174 32.425 ASSOCIATED	OPERATIONAL CHECK ANTI-SKID LIGHTS PKG 1, 2, 3 REF: AMM 32-44-00	MOS HRSMSC AFL	200							26-JUN-2001 7687 5594	F3 .5	
322166 32.410	DETECTOR, ANTI-SKID RIGHT MAIN GEAR 5-713513-504 553 REF: AMM 32-44-06	MOS HRSMSC AFL	O/C	0						17-DEC-1983 1454 878	L2 \$1064. 1	
+ 322176 32.420 ASSOCIATED	FUNCTIONAL CHECK ANTI-SKID DETECTOR SYSTEM PKG 2, 3 REF: AMM 32-44-00	MOS HRSMSC AFL	400							26-JUN-2001 7687 5594	F3 1	
+ 322171 32.410 ASSOCIATED	INSPECT/CLEAN RIGHT ANTI-SKID DETECTOR PKG 1, 2, 3 REF: AMM 5-20-04	MOS HRSMSC AFL	200							26-JUN-2001 7687 5594	L2 1	
+ 322174 32.425 ASSOCIATED	OPERATIONAL CHECK ANTI-SKID LIGHTS PKG 1, 2, 3 REF: AMM 32-44-00	MOS HRSMSC AFL	200							26-JUN-2001 7687 5594	F3 .5	
322111 32.380	FUSE, BRAKE HYDRAULIC LEFT 3-713047 1797 REF: AMM 32-43-04	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W1	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
322126	FUSE, BRAKE HYDRAULIC RIGHT										W2	
32.380	3-71 3047	MOS								11-FEB-1982		
	3371	HRS/MSC	O/C		0					0		
	REF: AMM 32-43-04	AFL								0		
320601	GEAR ASSEMBLY, MAIN LEFT										L1	
32.210	400-144-511	MOS								11-FEB-1982		
	1L195	HRS/MSC	O/C		0					0		
	REF: AMM 32-10-01	AFL								0		
320631	CHECK MAIN GEAR PARALLELISM										L1	
32.470		MOS								11-FEB-1982		
		HRS/MSC	C/C							0		
	REF: AMM 32-10-01	AFL								0		
320634	CHECK LEFT MAIN GEAR CLEARANCE										L1	
32.480		MOS								11-FEB-1982		
		HRS/MSC	C/C							0		
	REF: AMM 32-10-01	AFL								0		
+ 322211	FUNCTIONAL TEST EMERGENCY GEAR EXTENSION										F3	
32.450	PKG 3	MOS								26-JUL-2000		
	ASSOCIATED	HRS/MSC	800							7325		
	REF: AMM 32-30-00	AFL								5360		
+ 322206	FUNCTIONAL TEST EMERGENCY GEAR EXTENSION CONTROL CABLE										F3	
32.440	PKG 1, 2, 3	MOS								26-JUN-2001		
	ASSOCIATED	HRS/MSC	200							7687	1	
	REF: AMM 32-30-00	AFL								5594		
+ 322191	FUNCTIONAL TEST LANDING GEAR (NORMAL)										F3	
32.430	PKG 2, 3	MOS								26-JUN-2001		
	ASSOCIATED	HRS/MSC	400							7687		
	REF: AMM 32-30-00	AFL								5594		
+ 322201	FUNCTIONAL TEST LANDING GEAR FREE FALL										F3	
32.430	PKG 2, 3	MOS								26-JUN-2001		
	ASSOCIATED	HRS/MSC	400							7687		
	REF: See Workcard	AFL								5594		
SL WW-2494 R3 LEFT	LANDING GEAR SERVICE LETTER										L1	
	ASSOCIATED	MOS								26-JUN-2001		
		HRS/MSC	300							7687	7987	
	REF: See Workcard	AFL								5594		
	Method of Compliance: OPEN											
320606	LUBRICATE LEFT MAIN GEAR										L1	
32.030	PKG 1, 2, 3	MOS								26-JUN-2001		
		HRS/MSC	200							7687	.5	
	REF: AMM 12-20-00	AFL								5594		
320636	SERVICE LEFT MAIN GEAR SHOCK STRUT										L1	
32.040	PKG 2, 3	MOS								26-JUN-2001		
		HRS/MSC	400							7687	2	
	REF: AMM 12-10-04	AFL								5594		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL



AIRCRAFT Status Report

(Alphabetical with Relations)

Report Date 13-MAY-2002

Aircraft Model - 1124 WESTWIND
 Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
 A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
SL WW-241 03 LEFT	SERVICE LETTER										L1	
ASSOCIATED		MOS										
	REF:	HRS/MSC	A/R						0			
	Method of Compliance: OPEN	AFL							0			
321101	GEAR ASSEMBLY, MAIN RIGHT										L2	
32.210	400-144-512	MOS							11-FEB-1982			
	1L195	HRS/MSC	O/C		0				0			
	REF: AMM 32-10-01	AFL							0			
321134	CHECK RIGHT MAIN GEAR CLEARANCE										L2	
32.480		MOS							11-FEB-1982			
		HRS/MSC	C/C						0			
	REF: AMM 32-10-01	AFL							0			
+ 322211	FUNCTIONAL TEST EMERGENCY GEAR EXTENSION										F3	
32.450	PKG 3	MOS							26-JUL-2000			
ASSOCIATED		HRS/MSC	800						7325			
	REF: AMM 32-30-00	AFL							5360			
+ 322206	FUNCTIONAL TEST EMERGENCY GEAR EXTENSION CONTROL CABLE										F3	
32.440	PKG 1, 2, 3	MOS							26-JUN-2001			
ASSOCIATED		HRS/MSC	200						7687		1	
	REF: AMM 32-30-00	AFL							5594			
+ 322191	FUNCTIONAL TEST LANDING GEAR (NORMAL)										F3	
32.430	PKG 2, 3	MOS							26-JUN-2001			
ASSOCIATED		HRS/MSC	400						7687			
	REF: AMM 32-30-00	AFL							5594			
+ 322201	FUNCTIONAL TEST LANDING GEAR FREE FALL										F3	
32.430	PKG 2, 3	MOS							26-JUN-2001			
ASSOCIATED		HRS/MSC	400						7687			
	REF: See Workcard	AFL							5594			
SL WW-2494 R3 RIGHT	LANDING GEAR SERVICE LETTER										L2	
ASSOCIATED		MOS							26-JUN-2001			
	REF: See Workcard	HRS/MSC	300						7687	7987		
	Method of Compliance: OPEN	AFL							5594			
321106	LUBRICATE RIGHT MAIN GEAR										L2	
32.030	PKG 1, 2, 3	MOS							26-JUN-2001			
		HRS/MSC	200						7687		.5	
	REF: AMM 12-20-00	AFL							5594			
SL WW-241 03 RIGHT	SERVICE LETTER										L2	
ASSOCIATED		MOS										
	REF:	HRS/MSC	A/R						0			
	Method of Compliance: OPEN	AFL							0			
321136	SERVICE RIGHT MAIN GEAR SHOCK STRUT										L2	
32.040	PKG 2, 3	MOS							26-JUN-2001			
		HRS/MSC	400						7687		2	
	REF: AMM 12-10-04	AFL							5594			

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
320101	NOSE GEAR ASSEMBLY, 400-143-511	MOS								L3	
32.050	1L184 REF: AMM 32-20-01	HRS/MSC AFL	O/C	0				11-FEB-1982 0 0			
320179	INSPECT NOSE STEERING CABLES PKG 3	MOS								L1	
32.580	REF: AMM 32-50-07	HRS/MSC AFL	800					26-JUL-2000 7325 5360			
320120	INSPECT OUTER STRUT BODY FORGING	MOS								L3	
32.520	REF: AMM 32-20-01	HRS/MSC AFL	1200					22-FEB-2000 7107 5232	8307		
320118	INSPECT/LUBRICATE UPPER/LOWER STRUT BEARINGS BODY	MOS								L3	
32.540	REF: AMM 32-20-01	HRS/MSC AFL	1200	24				22-FEB-2000 7107 5232	22-FEB-2002 8307		
320106	LUBRICATE NOSE GEAR/DOORS PKG 1, 2, 3	MOS								L3	
32.030	REF: AMM 12-20-00	HRS/MSC AFL	200					26-JUN-2001 7687 5594		.5	
320180	LUBRICATE NOSE STEERING CONTROL CABLES PKG 3	MOS								L1	
32.590	REF: AMM 12-20-00	HRS/MSC AFL	800					26-JUL-2000 7325 5360			
SB 900280	SB WW 24-28A SERVICE BULLETIN	MOS								L3	
ASSOCIATED	REF: See Workcard Method of Compliance: OPEN	HRS/MSC AFL	1200					22-FEB-2000 7107 5232			
320116	SERVICE SHOCK STRUT PKG 2, 3	MOS								L3	
32.040	REF: AMM 12-10-04	HRS/MSC AFL	400					26-JUN-2001 7687 5594		2.5	
320172	TEST DRAG BRACE DOWNLOCK TENSION PKG 3	MOS								L3	
32.240	REF: AMM 32-20-02	HRS/MSC AFL	800					26-JUL-2000 7325 5360			
+ 320110	X-RAY INSPECT NOSE GEAR SHAFT AND DOOR ASSEMBLIES	MOS								L3	
32.560	REF: AMM 5-10-00	HRS/MSC AFL	5000	60				16-JUN-1997 6135 4707	16-JUN-2002 11135		
321603	SELECTOR, GEAR VALVE 713025-501	MOS								F3	
32.200	IL-41 REF: NO REF	HRS/MSC AFL	O/C	0				06/09/1995 09-DEC-1994 5526 4218			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
320661 32.280	SWITCH, DOWNLOCK LEFT MAIN GEAR 4-823051	MOS							11-FEB-1982	L1	
	SN-UNKNOWN REF: NO REF	HRS/MSC AFL	O/C	0				0 0			
320663 32.280	ADJUST	MOS							11-FEB-1982	L1	
	REF: AMM 32-60-00	HRS/MSC AFL	C/C					0 0			
320131 32.080	SWITCH, DOWNLOCK NOSE GEAR 4-823012-501	MOS							11-FEB-1982	L3	
	SN-UNKNOWN REF: AMM 32-60-00	HRS/MSC AFL	O/C	0				0 0			
320133 32.080	ADJUST	MOS							11-FEB-1982	L3	
	REF: AMM 32-60-00	HRS/MSC AFL	C/C					0 0			
321161 32.280	SWITCH, DOWNLOCK RIGHT MAIN GEAR 4-823051	MOS							11-FEB-1982	L2	
	SN-UNKNOWN REF: NO REF	HRS/MSC AFL	O/C	0				0 0			
321163 32.280	ADJUST	MOS							11-FEB-1982	L2	
	REF: AMM 32-60-00	HRS/MSC AFL	C/C					0 0			
320666 32.290	SWITCH, GROUND CONTACT LEFT MAIN GEAR 4-823051	MOS							11-FEB-1982	L1	
	SN-UNKNOWN REF: NO REF	HRS/MSC AFL	O/C	0				0 0			
320668 32.290	ADJUST	MOS							11-FEB-1982	L1	
	REF: AMM 32-60-00	HRS/MSC AFL	C/C					0 0			
320141 32.100	SWITCH, GROUND CONTACT NOSE GEAR 4-823053-501	MOS							11-FEB-1982	L3	
	SN-UNKNOWN REF: See Workcard	HRS/MSC AFL	O/C	0				0 0			
320143 32.100	ADJUST	MOS							11-FEB-1982	L3	
	REF: AMM 32-60-00	HRS/MSC AFL	C/C					0 0			
321166 32.290	SWITCH, GROUND CONTACT RIGHT MAIN GEAR 4-823024-505	MOS							11-FEB-1982	L2	
	SN-UNKNOWN REF: See Workcard	HRS/MSC AFL	O/C	0				0 0			

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
321168 32.290	ADJUST	MOS HRS/MSA AFL								11-FEB-1982 0 0	L2	
	REF: AMM 32-60-00											
320656 32.270	SWITCH, UNLOCK LEFT MAIN GEAR 3-823003	MOS HRS/MSA AFL								11-FEB-1982 0 0	L1	
	SN-UNKNOWN REF: NO REF		O/C		0							
320658 32.270	ADJUST	MOS HRS/MSA AFL								11-FEB-1982 0 0	L1	
	REF: AMM 32-60-00											
320136 32.090	SWITCH, UNLOCK NOSE GEAR 3-823003	MOS HRS/MSA AFL								11-FEB-1982 0 0	L3	
	SN-UNKNOWN REF: AMM 32-60-00		O/C		0							
320138 32.090	ADJUST	MOS HRS/MSA AFL								11-FEB-1982 0 0	L3	
	REF: AMM 32-60-00											
321156 32.270	SWITCH, UNLOCK RIGHT MAIN GEAR 3-823003	MOS HRS/MSA AFL								11-FEB-1982 0 0	L2	
	SN-UNKNOWN REF: NO REF		O/C		0							
321158 32.270	ADJUST	MOS HRS/MSA AFL								11-FEB-1982 0 0	L2	
	REF: AMM 32-60-00											
320681 32.180	TIRE, LEFT MAIN GEAR 249K83-3	MOS HRS/MSA AFL								09-NOV-1996 5951 4589	L1 2	
	SN-UNKNOWN REF: AMM 32-41-00		O/C		0							
321181 32.190	TIRE, RIGHT MAIN GEAR 249K83-3	MOS HRS/MSA AFL								09-NOV-1996 5951 4589	L2 2	
	SN-UNKNOWN REF: AMM 32-41-00		O/C		0							
320161 32.110	TIRE, LEFT NOSE GEAR 164F43-2	MOS HRS/MSA AFL								22-NOV-1995 5720 4401	L3	
	31162139 REF: AMM 32-42-00		O/C		0							
320166 32.120	TIRE, RIGHT NOSE GEAR 164F43-2	MOS HRS/MSA AFL								29-NOV-1995 5720 4401	L3	
	22051064 REF: AMM 32-42-00		O/C		0							

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
320626 32.250	UPLOCK, LEFT MAIN GEAR 5-17 3057-501 SN-UNKNOWN REF: AMM 32-32-04	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L1	
321126 32.250	UPLOCK, RIGHT MAIN GEAR 5-17 3057-502 SN-UNKNOWN REF: AMM 32-30-04	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L2	
320176 32.130	VALVE ASSEMBLY, STEERING BA1801-2 1L185 REF: AMM 32-50-01	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	L3	
322146 32.500	VALVE, ANTI-SKID CONTROL LEFT 5723578-1 313A REF: AMM 32-44-02	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F5	
322149 32.500	CLEAN FILTERS REF: AMM 32-41-00	MOS HRS/MSC AFL	1200					22-FEB-2000 7107 5232	8307	F5	
+ 322176 32.420 ASSOCIATED	FUNCTIONAL CHECK ANTI-SKID DETECTOR SYSTEM PKG 2, 3 REF: AMM 32-44-00	MOS HRS/MSC AFL	400					26-JUN-2001 7687 5594		F3 1	
322161 32.500	VALVE, ANTI-SKID CONTROL RIGHT 5723578-1 503A REF: AMM 32-44-02	MOS HRS/MSC AFL	O/C	0				11-FEB-1982 0 0		F5	
322169 32.500	CLEAN FILTERS REF: AMM 32-41-00	MOS HRS/MSC AFL	1200					22-FEB-2000 7107 5232	8307	F5	
+ 322176 32.420 ASSOCIATED	FUNCTIONAL CHECK ANTI-SKID DETECTOR SYSTEM PKG 2, 3 REF: AMM 32-44-00	MOS HRS/MSC AFL	400					26-JUN-2001 7687 5594		F3 1	
322106 32.370	VALVE, BRAKE SHUTTLE LEFT 4-71 3066 2752 REF: AMM 32-43-03	MOS HRS/MSC AFL	O/C	0				11-FEB-1982 0 0		W1	
322121 32.370	VALVE, BRAKE SHUTTLE RIGHT 4-71 3066 2775 REF: AMM 32-43-03	MOS HRS/MSC AFL	O/C	0				11-FEB-1982 0 0		W2	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
321606 32.340	VALVE, EMERGENCY GEAR EXTENSION 874521B SN-UNKNOWN REF: AMM 32-30-11	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5	
321601 32.320	VALVE, LANDING GEAR CONTROL 4753036 372 REF: AMM 32-30-01	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F2 \$644. 25	
320177 32.170	VALVE, NOSE STEERING SOLENOID 713557-501 SN-UNKNOWN REF: AMM 32-50-00	MOS HRS/MSC AFL	O/C							11-FEB-1982 0 0	L3	
320191 32.160	OPERATIONAL CHECK NOSE STEERING REF: AMM 32-50-00	MOS HRS/MSC AFL	C/C							11-FEB-1982 0 0	L3	
322181 32.510	VALVE, PARKING MOTOR 3-713551 L34900 REF: AMM 32-44-03	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5	
+ 322176 32.420 ASSOCIATED	FUNCTIONAL CHECK ANTI-SKID DETECTOR SYSTEM PKG 2, 3 REF: AMM 32-44-00	MOS HRS/MSC AFL	400							26-JUN-2001 7687 5594	F3 1	
322101 32.360	VALVE, POWER BRAKE 5713001-501 617AB REF: AMM 32-43-02	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F2 \$1932. 5	
320221 32.330	VALVE, SHUTTLE NOSE GEAR 4713066 SN-UNKNOWN REF: AMM 32-30-07	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	L3	
320671 32.180	WHEEL HALF, INBOARD LEFT MAIN GEAR 5002806-2 JUN89-537 REF: AMM 32-41-00	MOS HRS/MSC AFL	O/C							09-NOV-1996 5951 4589	L1 1	
320681 32.180 ASSOCIATED	CHANGE LEFT MAIN GEAR TIRE 249K83-3 SN-UNKNOWN REF: AMM 32-41-00	MOS HRS/MSC AFL	O/C	0 0 0						09-NOV-1996 5951 4589	L1 2	
320672 32.180 ASSOCIATED	CHANGE LEFT MAIN GEAR OUTBOARD WHEEL HALF 5002806-2 JUN89-537 REF: AMM 32-41-00	MOS HRS/MSC AFL	O/C							09-NOV-1996 5951 4589	L1 1	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
320678	DYE PENETRANT CHECK LEFT WHEEL AXLE										L1	
32.550	PKG 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	400						7687			
	REF: AMM 5-20-04	AFL							5594			
+ 320691	INSPECT LEFT MAIN GEAR/WELL (A)										L1	
32.020	PKG 1, 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	200						7687	1.5		
	REF: AMM 5-20-04	AFL							5594			
+ 322156	INSPECT/CLEAN LEFT ANTI-SKID DETECTOR										L1	
32.410	PKG 1, 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	200						7687	1		
	REF: AMM 5-20-04	AFL							5594			
+ 320676	INSPECT/LUBRICATE LEFT MAIN GEAR INBOARD WHEEL BEARINGS										L1	
32.180	PKG 1, 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	200						7687	1		
	REF: AMM 32-41-00	AFL							5594			
+ 322174	OPERATIONAL CHECK ANTI-SKID LIGHTS										F3	
32.425	PKG 1, 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	200						7687	.5		
	REF: AMM 32-44-00	AFL							5594			
320686	REPLACE LEFT MAIN WHEEL BOLTS										L1	
32.180		MOS							09-NOV-1996			
	ASSOCIATED	HRS/MSC	O/C						5951			
	REF: NO REF	AFL							4589			
321171	WHEEL HALF, INBOARD RIGHT MAIN GEAR										L2	
32.190	5002806-2	MOS							09-NOV-1996			
	MAR84-662	HRS/MSC	O/C						5951	1		
	REF: AMM 32-41-00	AFL							4589			
321181	CHANGE RIGHT MAIN GEAR TIRE										L2	
32.190	249K83-3	MOS						0	09-NOV-1996			
	ASSOCIATED	HRS/MSC	O/C					0	5951	2		
	REF: AMM 32-41-00	AFL						0	4589			
321172	CHANGE RIGHT MAIN GEAR OUTBOARD WHEEL HALF										L2	
32.190	5002806-2	MOS							09-NOV-1996			
	ASSOCIATED	HRS/MSC	O/C						5951	1		
	MAR84-662	HRS/MSC	O/C						5951	1		
	REF: AMM 32-41-00	AFL							4589			
321178	DYE PENETRANT CHECK RIGHT WHEEL AXLE										L2	
32.550	PKG 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	400						7687			
	REF: AMM 5-20-04	AFL							5594			
+ 322171	INSPECT/CLEAN RIGHT ANTI-SKID DETECTOR										L2	
32.410	PKG 1, 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	200						7687	1		
	REF: AMM 5-20-04	AFL							5594			

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION			COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR			
+ 321176	INSPECT/LUBRICATE RIGHT MAIN GEAR INBOARD WHEEL BEARINGS							L2	
32.180	PKG 1, 2, 3	MOS				26-JUN-2001			
	REF: AMM 32-41-00	HRS/MSC	200			7687		1	
		AFL				5594			
+ 322174	OPERATIONAL CHECK ANTI-SKID LIGHTS							F3	
32.425	PKG 1, 2, 3	MOS				26-JUN-2001			
ASSOCIATED		HRS/MSC	200			7687		.5	
	REF: AMM 32-44-00	AFL				5594			
321186	REPLACE RIGHT MAIN WHEEL BOLTS							L2	
32.180		MOS				09-NOV-1996			
ASSOCIATED		HRS/MSC	O/C			5951			
	REF: NO REF	AFL				4589			
320672	WHEEL HALF, OUTBOARD LEFT MAIN GEAR							L1	
32.180	5002806-2	MOS				09-NOV-1996			
	JUN89-537	HRS/MSC	O/C			5951		1	
	REF: AMM 32-41-00	AFL				4589			
320681	CHANGE LEFT MAIN GEAR TIRE							L1	
32.180	249K83-3	MOS			0	09-NOV-1996			
ASSOCIATED	SN-UNKNOWN	HRS/MSC	O/C		0	5951		2	
	REF: AMM 32-41-00	AFL			0	4589			
320678	DYE PENETRANT CHECK LEFT WHEEL AXLE							L1	
32.550	PKG 2, 3	MOS				26-JUN-2001			
ASSOCIATED		HRS/MSC	400			7687			
	REF: AMM 5-20-04	AFL				5594			
+ 320691	INSPECT LEFT MAIN GEAR/WELL (A)							L1	
32.020	PKG 1, 2, 3	MOS				26-JUN-2001			
ASSOCIATED		HRS/MSC	200			7687		1.5	
	REF: AMM 5-20-04	AFL				5594			
+ 322156	INSPECT/CLEAN LEFT ANTI-SKID DETECTOR							L1	
32.410	PKG 1, 2, 3	MOS				26-JUN-2001			
ASSOCIATED		HRS/MSC	200			7687		1	
	REF: AMM 5-20-04	AFL				5594			
+ 320680	INSPECT/LUBRICATE LEFT MAIN GEAR OUTBOARD WHEEL BEARINGS							L1	
32.180	PKG 1, 2, 3	MOS				26-JUN-2001			
		HRS/MSC	200			7687			
	REF: AMM 32-41-00	AFL				5594			
+ 322174	OPERATIONAL CHECK ANTI-SKID LIGHTS							F3	
32.425	PKG 1, 2, 3	MOS				26-JUN-2001			
ASSOCIATED		HRS/MSC	200			7687		.5	
	REF: AMM 32-44-00	AFL				5594			
320686	REPLACE LEFT MAIN WHEEL BOLTS							L1	
32.180		MOS				09-NOV-1996			
ASSOCIATED		HRS/MSC	O/C			5951			
	REF: NO REF	AFL				4589			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL



AIRCRAFT Status Report

(Alphabetical with Relations)

Report Date 13-MAY-2002

Aircraft Model - 1124 WESTWIND
 Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
 A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
321172	WHEEL HALF, OUTBOARD RIGHT MAIN GEAR										L2	
32.190	5002806-2	MOS							09-NOV-1996			
	MAR84-662	HRS/MS	O/C						5951		1	
	REF: AMM 32-41-00	AFL							4589			
321181	CHANGE RIGHT MAIN GEAR TIRE										L2	
32.190	249K83-3	MOS							09-NOV-1996			
ASSOCIATED	SN-UNKNOWN	HRS/MS	O/C						5951		2	
	REF: AMM 32-41-00	AFL							4589			
321178	DYE PENETRANT CHECK RIGHT WHEEL AXLE										L2	
32.550	PKG 2, 3	MOS							26-JUN-2001			
ASSOCIATED		HRS/MS	400						7687			
	REF: AMM 5-20-04	AFL							5594			
+ 321191	INSPECT RIGHT MAIN GEAR/WELL (A)										L2	
32.020	PKG 1, 2, 3	MOS							26-JUN-2001			
		HRS/MS	200						7687		1.5	
	REF: AMM 5-20-04	AFL							5594			
+ 322171	INSPECT/CLEAN RIGHT ANTI-SKID DETECTOR										L2	
32.410	PKG 1, 2, 3	MOS							26-JUN-2001			
ASSOCIATED		HRS/MS	200						7687		1	
	REF: AMM 5-20-04	AFL							5594			
321180	INSPECT/LUBRICATE RIGHT MAIN GEAR OUTBOARD WHEEL BEARINGS										L2	
32.180	PKG 1, 2, 3	MOS							26-JUN-2001			
		HRS/MS	200						7687		1	
	REF: AMM 32-41-00	AFL							5594			
+ 322174	OPERATIONAL CHECK ANTI-SKID LIGHTS										F3	
32.425	PKG 1, 2, 3	MOS							26-JUN-2001			
ASSOCIATED		HRS/MS	200						7687		.5	
	REF: AMM 32-44-00	AFL							5594			
321186	REPLACE RIGHT MAIN WHEEL BOLTS										L2	
32.180		MOS							09-NOV-1996			
ASSOCIATED		HRS/MS	O/C						5951			
	REF: NO REF	AFL							4589			
320146	WHEEL, LEFT NOSE GEAR										L3	
32.110	41874	MOS							22-NOV-1995			
	APR66-109	HRS/MS	O/C				0		5720		4	
	REF: AMM 32-42-00	AFL							4401			
320161	CHANGE NOSE GEAR LEFT TIRE										L3	
32.110	164F43-2	MOS							22-NOV-1995			
ASSOCIATED	31162139	HRS/MS	O/C				0		5720			
	REF: AMM 32-42-00	AFL							4401			
+ 320156	INSPECT/CLEAN/LUBRICATE BEARINGS										L3	
32.110	PKG 1, 2, 3	MOS							26-JUN-2001			
		HRS/MS	200						7687		1.5	
	REF: AMM 5-20-01	AFL							5594			

Report Date **13-MAY-2002**

(Alphabetical with Relations)

Aircraft Model - 1124 WESTWIND

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
320151	WHEEL, RIGHT NOSE GEAR										L3
32.120	9541874	MOS							29-NOV-1995		
	OCT75-64 1	HRS/MSC	O/C		0				5720		4
	REF: AMM 32-42-00	AFL							4401		
320166	CHANGE NOSE GEAR RIGHT TIRE										L3
32.120	164F43-2	MOS							29-NOV-1995		
ASSOCIATED	22051064	HRS/MSC	O/C		0				5720		
	REF: AMM 32-42-00	AFL							4401		
+ 320158	INSPECT/CLEAN/LUBRICATE BEARINGS										L3
32.120	PKG 1, 2, 3	MOS							26-JUN-2001		
		HRS/MSC	200						7687		1.5
	REF: AMM 5-20-01	AFL							5594		
CHAPTER 33	LIGHTS										
330226	BATTERY, EMERGENCY LIGHT										F4
33.100	AD-2058	MOS			0				06-OCT-1998		
	SN-UNKNOWN	HRS/MSC	O/C		0				6520		
	REF: AMM 33-50-00	AFL			0				4889		
330320	INVERTER, LIGHT POWER (CF-38-3)										F2
33.070	CF-38-3	MOS							11-FEB-1982		
	291	HRS/MSC	O/C		0				0		
	REF: NO REF	AFL							0		
330111	LIGHT, TAIL CONE										F1
33.020	4-823006-501	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C		0				0		
	REF: AMM 33-40-00	AFL							0		
330161	LIGHT, ANTI-COLLISION LOWER										F1
33.030	G-9950-11	MOS						10/28/1989	28-APR-1989		\$635.
	11709	HRS/MSC	O/C						4240		
	REF: AMM 33-40-00	AFL							2767		
330156	LIGHT, ANTI-COLLISION UPPER										T1
33.030	G9950-11	MOS			0				26-JUL-2000		\$635.
	11709	HRS/MSC	O/C		0				7325		
	REF: AMM 33-40-00	AFL			0				5360		
330221	LIGHT, EMERGENCY										F4
33.090	3-823551-503	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C		0				0		
	REF: AMM 33-50-00	AFL							0		
330226	CHANGE EMERGENCY LIGHT BATTERY										F4
33.100	AD-2058	MOS			0				06-OCT-1998		
ASSOCIATED	SN-UNKNOWN	HRS/MSC	O/C		0				6520		
	REF: AMM 33-50-00	AFL			0				4889		
330228	CHARGE BATTERY										F4
33.100		MOS	3						06-NOV-2001	06-FEB-2002	
		HRS/MSC	200						7774	7974	
	REF: AMM 12-10-06	AFL							5641		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
330136 33.060	LIGHT, LANDING LEFT 5-21 3004-1 SN-UNKNOWN REF: AMM 33-40-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W1	
330146 33.060	LIGHT, LANDING RIGHT 5-21 3004-2 SN-UNKNOWN REF: AMM 33-40-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W2	
330101 33.010	LIGHT, POSITION LEFT WING 301085-1 4224 REF: AMM 33-40-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W1	
330106 33.010	LIGHT, POSITION RIGHT WING 301085-2 5772 REF: AMM 33-40-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W2	
330166 33.040	LIGHT, STROBE LEFT WING 31-3 172-11 SN-UNKNOWN REF: AMM 33-40-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W1	
330171 33.040	LIGHT, STROBE RIGHT WING 31-3 172-11 SN-UNKNOWN REF: AMM 33-40-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W2	
330116 33.050	LIGHT, TAXI LEFT 5-82 3521-1 GE-4587 REF: AMM 33-40-00	MOS HRSMSC AFL	O/C							30-AUG-1989 4350 2898	L1	
330126 33.050	LIGHT, TAXI RIGHT 5-82 3521-2 GE-4587 REF: AMM 33-40-00	MOS HRSMSC AFL	O/C							30-AUG-1989 4350 2898	L2	
330505 33.085	POWER SUPPLY, 60-2799-1 SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL	O/C							11-FEB-1982 0 0	W1	
330241 33.080	POWER SUPPLY, NO. 1 60-2799-1 6701 REF: NO REF	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	W1	
330246 33.080	POWER SUPPLY, NO. 2 60-2799-1 SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL	O/C	0						25-APR-1984 1641 1010	W2	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
330522 33.085	POWER SUPPLY, NO.4 60-2799-1	MOS								11-FEB-1982	W2	
	SN-UNKNOWN REF: NO REF	HRS/MSC AFL	O/C							0 0		
330325 33.070	UNIT, LIGHT POWER (CV-38) CV-38	MOS								11-FEB-1982	F2	
	6125 REF: NO REF	HRS/MSC AFL	O/C							0 0		
CHAPTER 34	NAVIGATION											
340121 34.060	DRAIN PITOT/STATIC SYSTEM PKG 1, 2, 3	MOS								26-JUN-2001	F2	
	REF: AMM 34-10-00	HRS/MSC AFL	200							7687 5594	1.5	
340111 34.040	LEAK CHECK LEFT PITOT SYSTEM	MOS								26-MAR-1996	F1	
	REF: AMM 34-10-01	HRS/MSC AFL	O/C									
+ 340146 34.050	LEAK CHECK LEFT STATIC SYSTEM	MOS	24							18-JAN-2001	MANDATORY 18-JAN-2003	F1
	REF: AMM 34-10-01	HRS/MSC AFL								7494 5466		
340116 34.040	LEAK CHECK RIGHT PITOT SYSTEM	MOS								11-FEB-1982	F1	
	REF: AMM 34-10-01	HRS/MSC AFL	O/C							0 0		
+ 340151 34.050	LEAK CHECK RIGHT STATIC SYSTEM	MOS	24							18-JAN-2001	MANDATORY 18-JAN-2003	F1
	REF: AMM 34-10-01	HRS/MSC AFL								7494 5466		
343141 34.390	SWING CHECK NO.1 COMPASS	MOS								11-FEB-1982	F3	
	REF: AMM 34-20-08	HRS/MSC AFL	O/C							0 0		
343186 34.390	SWING CHECK NO.2 COMPASS	MOS								11-FEB-1982	F3	
	REF: AMM 34-20-08	HRS/MSC AFL	O/C							0 0		
345101 34.490	ADVISORY, FLIGHT PROFILE 622-4569-001	MOS								11-FEB-1982	F3	
	SN-UNKNOWN REF: NO REF	HRS/MSC AFL	O/C	0						0 0		
345629 34.310	ALERTER, ALTITUDE 540-25100-004	MOS								11-FEB-1982	F3	
	SN-UNKNOWN REF: AMM 34-10-03	HRS/MSC AFL	O/C	0						0 0		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L



AIRCRAFT Status Report

(Alphabetical with Relations)

Aircraft Model - 1124 WESTWIND
 Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
 A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
341111 34.071	ALTIMETER, COPILOT 4883778-501 3008 REF: NO REF	MOS HRS/MSC AFL							11-FEB-1982 0 0	F3	
+ 340151 34.050 ASSOCIATED	LEAK CHECK RIGHT STATIC SYSTEM REF: AMM 34-10-01	MOS HRS/MSC AFL	24						18-JAN-2001 7494 5466	MANDATORY F1	
+ 341116 34.071	TEST FAR 91.411 REF:	MOS HRS/MSC AFL	24						18-JAN-2001 7494 5466	MANDATORY F3	
341101 34.070	ALTIMETER, PILOT 622-3975-003 1323 REF: AMM 34-10-03	MOS HRS/MSC AFL							11-FEB-1982 0 0	F3	
+ 340146 34.050 ASSOCIATED	LEAK CHECK LEFT STATIC SYSTEM REF: AMM 34-10-01	MOS HRS/MSC AFL	24						18-JAN-2001 7494 5466	MANDATORY F1	
+ 341106 34.070	TEST FAR 91.411 REF:	MOS HRS/MSC AFL	24						18-JAN-2001 7494 5466	MANDATORY F3	
341121 34.075	ALTIMETER, STAND-BY 622-3975-003 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL							11-FEB-1982 0 0	F3	
+ 340146 34.050 ASSOCIATED	LEAK CHECK LEFT STATIC SYSTEM REF: AMM 34-10-01	MOS HRS/MSC AFL	24						18-JAN-2001 7494 5466	MANDATORY F1	
+ 340151 34.050 ASSOCIATED	LEAK CHECK RIGHT STATIC SYSTEM REF: AMM 34-10-01	MOS HRS/MSC AFL	24						18-JAN-2001 7494 5466	MANDATORY F1	
343176 34.170	ANNUNCIATOR, COMPASS COPILOT PN SN-UNKNOWN REF: AMM 34-20-08	MOS HRS/MSC AFL							11-FEB-1982 0 0	F3	
343131 34.170	ANNUNCIATOR, COMPASS PILOT PN SN-UNKNOWN REF: AMM 34-20-08	MOS HRS/MSC AFL							11-FEB-1982 0 0	F3	

Report Date **13-MAY-2002**

(Alphabetical with Relations)

Aircraft Model - **1124 WESTWIND**
Owner Name - **R&S AIRCRAFT INVESTMENTS, LLC**
A/C Serial #: **368** A/C Reg. #: **N368MD**

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
346681 34.640	ANTENNA, #1 VLF 10085-2 6025 REF: AMM 34-60-02	MOS HRS/MSC AFL	O/C	0						03-APR-1989 4215 2745	F5	
347681 34.570	ANTENNA, GLIDESLOPE DMN-25-1 1896 REF: AMM 34-50-01	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F2	
346611 34.350	ANTENNA, NO.1 ADF LOOP 522-3761-001 4428 REF: AMM 34-50-03/04	MOS HRS/MSC AFL	O/C	0						31-JAN-1986 2855 1770	F1	
346131 34.330	ANTENNA, NO.1 ATC TRANSPONDER DMNI-50-6 323 REF: AMM 34-50-06	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F1	
347121 34.360	ANTENNA, NO.1 DME 4-873127-501 3234 REF: AMM 34-50-02	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F1 2	
348111 34.660	ANTENNA, NO.1 LRN 42804-000100-00 1346 REF: AMM 34-60-04	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0		
346206 34.550	ANTENNA, NO.1 MARKER BEACON DMN-27-1/A 1919 REF: AMM 34-50-01	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5	
346546 34.580	ANTENNA, NO.1 VOR DMN-4-15-3/D 10987 REF: NO REF	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F5	
346636 34.350	ANTENNA, NO.2 ADF LOOP 522-3761-001 SN-UNKNOWN REF: AMM 34-50-03/04	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F1	
346136 34.330	ANTENNA, NO.2 ATC TRANSPONDER DMNI-50-6 3259 REF: AMM 34-50-06	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F1	
347621 34.360	ANTENNA, NO.2 DME 4-873127-503 3242 REF: AMM 34-50-02	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F1 2	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
348114 34.700	ANTENNA, NO.2 LRN 42804-000100-00 SN-UNKNOWN REF: AMM 34-60-04	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0		
346216 34.550	ANTENNA, NO.2 MARKER BEACON PN SN-UNKNOWN REF: AMM 34-50-01	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
346576 34.600	ANTENNA, NO.2 VOR DMN-4-15-3A 10993 REF: NO REF	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	
345626 34.340	ANTENNA, RADIO ALTIMETER RECEIVER 522-4140-001 509 REF: AMM 34-10-04	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F1	
345621 34.340	ANTENNA, RADIO ALTIMETER TRANSMIT 622-4550-001 459 REF: AMM 34-10-04	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F1	
345831 34.520	ANTENNA, WEATHER RADAR 622-2504-001 270 REF: AMM 34-40-01,-02,-03,-04	MOS HRSMSC AFL	O/C	5222 3870				04/19/1993	19-FEB-1993	5222 3870	F2	
344611 34.370	BATTERY, EMERGENCY GYRO POWER SUPPLY 501-1075-05PS823A/T 1186 REF:	MOS HRSMSC AFL	O/C							06-APR-1998 6346 4787	F5 1	
344621 34.370	DEEP CYCLE POWER SUPPLY GNS-500 NAV SYSTEM REF: MSC BFG SL-80J/JET TP-329	MOS HRSMSC AFL	O/C							06-APR-1998 6346 4787	F5	
+ 344616 34.370	INSPECT EMERGENCY POWER SUPPLY BATTERY/STAND-BY ATTITUDE GYRO REF: AMM NO REF	MOS HRSMSC AFL	3 200							06-NOV-2001 7774 5641	06-FEB-2002 7974	F5
347626 34.150	BOX, DME DUAL CONTROL PN SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F2 1	
347641 34.580	BOX, HORIZONTAL SITUATION INDICATOR CONTROL 622-4569-001 SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F4	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
346551	BOX, NO.1 VOR CONTROL									F3	
34.590	622-2899-012	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: NO REF	AFL							0		
346581	BOX, NO.2 VOR CONTROL									F3	
34.590	DMN-4-15-3/D	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: NO REF	AFL							0		
342601	COMPASS, STAND-BY MAGNETIC									F3	
34.100	2-883023-501	MOS							11-FEB-1982		
	1A234	HRS/MSC	O/C	0					0		
	REF: NO REF	AFL							0		
342611	SWING CHECK									F3	
34.100		MOS							11-FEB-1982		
		HRS/MSC	O/C						0		
	REF: CMM	AFL							0		
343113	COMPENSATOR, NO.1									F3	
34.440	656767	MOS							11-FEB-1982		
	81082033	HRS/MSC	O/C	0					0		
	REF: NO REF	AFL							0		
343158	COMPENSATOR, NO.2									F3	
34.440	656767	MOS							11-FEB-1982		
	81092117	HRS/MSC	O/C	0					0		
	REF: NO REF	AFL							0		
344131	COMPUTER, FLIGHT COPILOT									F2	
34.220	622-5224-005	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: AMM 4-20-04/21-04	AFL							0		
343631	COMPUTER, FLIGHT PILOT									F2	
34.220	622-5224-004	MOS							11-FEB-1982		
	5128	HRS/MSC	O/C	0					0	1	
	REF: AMM 4-20-04/21-04	AFL							0		
340201	COMPUTER, NAVIGATION									F3	
34.460	622-5107-001	MOS							11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0					0		
	REF: NO REF	AFL							0		
343671	COMPUTER, NO.1 AIR DATA									F3	
34.480	622-5465-214	MOS							26-MAR-1996		
	1080	HRS/MSC	O/C								
	REF: AMM 22-20-00	AFL									
+ 343672	CALIBRATE FAR 91.411									MANDATORY F3	
34.480		MOS	24						18-JAN-2001	18-JAN-2003	
		HRS/MSC							7494		
	REF: See Workcard	AFL							5466		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
341604 34.410	COMPUTER, SAT TAS 630-30980-135 1589 REF: NO REF	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
346616 34.260	CONTROL, NO.1 ADF 622-4526-003 10601 REF: NO REF	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
346641 34.260	CONTROL, NO.2 ADF PN SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
346251 34.470	CONTROLLER, NO.1 NAVIGATION 622-4524-079 7898 REF: NO REF	MOS HRSMSC AFL								14-JAN-1992 5012 3648	F3	
346261 34.470	CONTROLLER, NO.2 NAVIGATION 622-4524-079 7863 REF: NO REF	MOS HRSMSC AFL							07/15/1992	15-JAN-1992 5012 3648	F3	
346141 34.540	CONTROLLER, TRANSPONDER 622-4527-011 6475 REF: NO REF	MOS HRSMSC AFL								11-FEB-1982 0 0	F4	
346306 34.460	CONVERTER, NAV RECEIVER/VHF POWER 622-2093-001 17233 REF: NO REF	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
347201 34.650	CONVERTER, NO.1 DME SYNCHRO 622-1920-001 SN-UNKNOWN REF: AMM 34-50-02	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
347211 34.650	CONVERTER, NO.2 DME SYNCHRO 622-1920-001 SN-UNKNOWN REF: AMM 34-50-02	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
341096 34.420	CONVERTER, RADIO ALTIMETER 995-29400-112 SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
343641 34.230	COUPLER, NO.1 FLIGHT DIRECTOR MODE 161E-2A SN-UNKNOWN REF: AMM 22-03-06	MOS HRSMSC AFL								11-FEB-1982 0 0	F2	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
348146 34.740	COUPLER, NO.1 LRN 42807-001100-001 1585 REF: NO REF	MOS HRS/MS AFL	O/C	0					11-FEB-1982 0 0		
344141 34.230	COUPLER, NO.2 FLIGHT DIRECTOR MODE 161E-2A SN-UNKNOWN REF: AMM 22-03-06	MOS HRS/MS AFL	O/C	0					11-FEB-1982 0 0	F2	
348151 34.740	COUPLER, NO.2 LRN 42807-001100-001 SN-UNKNOWN REF: NO REF	MOS HRS/MS AFL	O/C	0					11-FEB-1982 0 0		
345833 34.530	DISH, WEATHER RADAR FLAT ANT-318 270 REF: AMM 34-40-01	MOS HRS/MS AFL	O/C	5222 3870				04/19/1993	19-FEB-1993 5222 3870	F2	
348116 34.670	DISPLAY, NO.1 LRN CONTROL 622-5493-001 040 REF: AMM 34-60-04	MOS HRS/MS AFL	O/C	0					11-FEB-1982 0 0		
348121 34.670	DISPLAY, NO.2 LRN CONTROL 622-5493-001 SN-UNKNOWN REF: AMM 34-60-04	MOS HRS/MS AFL	O/C	0					11-FEB-1982 0 0		
345631 34.300	GENERATOR, TONE (ALERTER) 540-25100-004 SN-UNKNOWN REF: AMM 34-10-03	MOS HRS/MS AFL	O/C	0					11-FEB-1982 0 0	F3	
343101 34.110	GYRO, NO.1 DIRECTIONAL 622-4176-004 871 REF: AMM 34-20-08	MOS HRS/MS AFL	O/C		0			04/02/1992	02-OCT-1991 4931 3454	F4	
343106 34.110	BENCH CHECK REF: CMM	MOS HRS/MS AFL	O/C						11-FEB-1982 0 0	F4	
343651 34.200	GYRO, NO.1 VERTICAL 792-6694-001 6381 REF: AMM 34-20-07(1124/A),34-21-05(1124A)	MOS HRS/MS AFL	O/C	0					06-JAN-1986 2808 1739	F3 2	
343146 34.110	GYRO, NO.2 DIRECTIONAL 2587193-43 81095980 REF: AMM 34-20-08	MOS HRS/MS AFL	O/C	0					24-SEP-1987 3737 2345	F4	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
343151 34.110	BENCH CHECK	MOS								11-FEB-1982	F4	
	REF: CMM	HRS/MSC AFL	O/C							0 0		
344151 34.200	GYRO, NO.2 VERTICAL 792-6694-001	MOS								11-FEB-1982	F3	
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 34-20-07(1124/A),34-21-05(1124A)	AFL								0		
347611 34.140	INDICATOR, DME COPILOT PN	MOS								11-FEB-1982	F3	
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: NO REF	AFL								0		
347111 34.140	INDICATOR, DME PILOT PN	MOS								11-FEB-1982	F3	
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: NO REF	AFL								0		
344101 34.280	INDICATOR, FLIGHT DIRECTOR COPILOT 622-4808-004	MOS								11-FEB-1982	F3	
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 4-20-01/21-02	AFL								0		
343601 34.280	INDICATOR, FLIGHT DIRECTOR PILOT 622-4808-004	MOS								11-FEB-1982	F3	
	823	HRS/MSC	O/C	0						0		
	REF: AMM 4-20-01/21-02	AFL								0		
341601 34.080	INDICATOR, LEFT MACH/AIRSPEED 622-4382-013	MOS								07-APR-1987	F3	
	1302	HRS/MSC	O/C	0						3676		
	REF: NO REF	AFL								2288		
341606 34.080	CALIBRATE	MOS								10-APR-1990	F3	
	REF: CMM	HRS/MSC AFL	O/C							4560 3132		
340111 34.040	LEAK CHECK LEFT PITOT SYSTEM	MOS								26-MAR-1996	F1	
	ASSOCIATED	HRS/MSC	O/C									
	REF: AMM 34-10-01	AFL										
+ 340146 34.050	LEAK CHECK LEFT STATIC SYSTEM	MOS	24							18-JAN-2001	MANDATORY F1	
	ASSOCIATED	HRS/MSC								7494		
	REF: AMM 34-10-01	AFL								5466		
342090 34.380	INDICATOR, LEFT VERTICAL NAV/SPEED 622-4782-003/VNI-80	MOS								22-OCT-1982	F3	
	SN-UNKNOWN	HRS/MSC	O/C	0						482		
	REF: NO REF	AFL										

Report Date **13-MAY-2002**

Aircraft Model - **1124 WESTWIND**
Owner Name - **R&S AIRCRAFT INVESTMENTS, LLC**
A/C Serial #: **368** A/C Reg. #: **N368MD**

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
342101 34.090	INDICATOR, LEFT VERTICAL SPEED 4883748-1 640 REF: AMM 34-10-03	MOS HRS/MSC AFL								11-FEB-1982 0 0	F3 \$486.	
342106 34.090	BENCH CHECK REF: See Workcard	MOS HRS/MSC AFL								11-FEB-1982 0 0	F3	
+ 340146 34.050 ASSOCIATED	LEAK CHECK LEFT STATIC SYSTEM REF: AMM 34-10-01	MOS HRS/MSC AFL	24							18-JAN-2001 7494 5466	MANDATORY F1 18-JAN-2003	
342801 34.430	INDICATOR, NO.1 GYRO ATTITUDE 4020531-170 80110830 REF: NO REF	MOS HRS/MSC AFL								0 0 0 25-MAR-1991 4830 3441	F3	
347651 34.560	INDICATOR, NO.1 HORIZONTAL SITUATION 622-4176-004 871 REF: AMM 4-20-02/21-02	MOS HRS/MSC AFL								0 0 0 10-MAR-1987 3623 2255	F3	
342811 34.430	INDICATOR, NO.2 GYRO ATTITUDE 4020531-170 6020225 REF: NO REF	MOS HRS/MSC AFL								19-MAR-1991 4827 3439	F3	
347655 34.560	INDICATOR, NO.2 HORIZONTAL SITUATION 622-4176-004 1854 REF: AMM 4-20-02/21-02	MOS HRS/MSC AFL								0 0 0 11-FEB-1982 0 0	F3	
340601 34.380	INDICATOR, OUTSIDE AIR TEMPERATURE 4883753-3 64128-13 REF: NO REF	MOS HRS/MSC AFL								0 0 0 14-APR-1984 1645	F3	
345611 34.250	INDICATOR, RADIO ALTIMETER 521-29007-203 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL								0 0 0 11-FEB-1982 0 0	F3	
343166 34.160	INDICATOR, RADIO MAGNETIC COPILOT 622-2506-002 1546 REF: AMM 34-50-05	MOS HRS/MSC AFL								0 0 0 14-DEC-1986 3484 2157	F3 1	
343121 34.160	INDICATOR, RADIO MAGNETIC PILOT 622-2506-002 1213 REF: AMM 34-50-05	MOS HRS/MSC AFL								0 0 0 05-NOV-1986 3385 2098	F3 1	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
341056 34.400	INDICATOR, RATE OF CLIMB COPILOT 229-0324-010 SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL			0					11-FEB-1982 0 0	F3	
341046 34.400	INDICATOR, RATE OF CLIMB PILOT 622-7689-003 166 REF: NO REF	MOS HRSMSC AFL				0				31-MAY-1993 5278 3928	F3	
341611 34.080	INDICATOR, RIGHT MACH/AIRSPEED 883615-513 149 REF: NO REF	MOS HRSMSC AFL			0					11-FEB-1982 0 0	F3	
341616 34.080	CALIBRATE REF: CMM VENDOR	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
340116 34.040 ASSOCIATED	LEAK CHECK RIGHT PITOT SYSTEM REF: AMM 34-10-01	MOS HRSMSC AFL								11-FEB-1982 0 0	F1	
+ 340151 34.050 ASSOCIATED	LEAK CHECK RIGHT STATIC SYSTEM REF: AMM 34-10-01	MOS HRSMSC AFL	24							18-JAN-2001 7494 5466	MANDATORY 18-JAN-2003 F1	
342111 34.090	INDICATOR, RIGHT VERTICAL SPEED RCS-60-IL-10 MD12158 REF: AMM 34-10-03	MOS HRSMSC AFL			0					11-FEB-1982 0 0	F3 \$486.	
342116 34.090	BENCH CHECK REF: See Workcard	MOS HRSMSC AFL								11-FEB-1982 0 0	F3	
+ 340151 34.050 ASSOCIATED	LEAK CHECK RIGHT STATIC SYSTEM REF: AMM 34-10-01	MOS HRSMSC AFL	24							18-JAN-2001 7494 5466	MANDATORY 18-JAN-2003 F1	
341605 34.410	INDICATOR, SAT TAS 622-2294-002 SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL			0					11-FEB-1982 0 0	F3	
344601 34.290	INDICATOR, STAND-BY HORIZON 501-1105-03 6010212 REF: AMM 34-20-09	MOS HRSMSC AFL			0					18-NOV-1984 2085 1284	F3	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
345801 34.500	INDICATOR, WEATHER RADAR 622-4331-001 176 REF: AMM 34-40-01,-02,-03,-04	MOS HRS/MSC AFL	O/C		0				09/18/1993	18-MAR-1993 5231 3880	F3	
347101 34.270	INTERROGATOR, NO.1 DME 622-1233-001 13710 REF: AMM 34-50-02	MOS HRS/MSC AFL	O/C		0					11-FEB-1982 0 0	F2	
347601 34.270	INTERROGATOR, NO.2 DME 622-1233-001 15123 REF: AMM 34-50-02	MOS HRS/MSC AFL	O/C		0					11-FEB-1982 0 0	F2	
343663 34.190	PANEL, NO.1 FLIGHT GUIDANCE 622-2313-029 2661 REF: AMM 34-21-03	MOS HRS/MSC AFL	O/C		0 0					11-FEB-1982	F3	
343665 34.190	PANEL, NO.2 FLIGHT GUIDANCE 622-2265-030 SN-UNKNOWN REF: AMM 34-21-03	MOS HRS/MSC AFL	O/C		0 0					11-FEB-1982 0 0	F3	
345811 34.540	PANEL, WEATHER RADAR CONTROL DCP-320 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C		0 0					11-FEB-1982 0 0	F3	
340126 34.020	PORT, LEFT HEATED STATIC 3-883053-501 SN-UNKNOWN REF: AMM 34-10-01	MOS HRS/MSC AFL	O/C		0					11-FEB-1982 0 0	F1	
340121 34.060 ASSOCIATED	DRAIN PITOT/STATIC SYSTEM PKG 1, 2, 3 REF: AMM 34-10-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	F2 1.5	
+ 340146 34.050 ASSOCIATED	LEAK CHECK LEFT STATIC SYSTEM REF: AMM 34-10-01	MOS HRS/MSC AFL	24							18-JAN-2001 7494 5466	MANDATORY F1 18-JAN-2003	
340131 34.030	PORT, LEFT UNHEATED STATIC 4-883050 SN-UNKNOWN REF: AMM 34-10-01	MOS HRS/MSC AFL	O/C		0					11-FEB-1982 0 0	F1	
340121 34.060 ASSOCIATED	DRAIN PITOT/STATIC SYSTEM PKG 1, 2, 3 REF: AMM 34-10-00	MOS HRS/MSC AFL	200							26-JUN-2001 7687 5594	F2 1.5	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 340146	LEAK CHECK LEFT STATIC SYSTEM											
34.050		MOS	24						18-JAN-2001	MANDATORY 18-JAN-2003	F1	
	ASSOCIATED	HRS/MSC							7494			
	REF: AMM 34-10-01	AFL							5466			
340136	PORT, RIGHT HEATED STATIC										F1	
34.020	3-883053-502	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: AMM 34-10-01	AFL							0			
340121	DRAIN PITOT/STATIC SYSTEM										F2	
34.060	PKG 1, 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	200						7687		1.5	
	REF: AMM 34-10-00	AFL							5594			
+ 340151	LEAK CHECK RIGHT STATIC SYSTEM										MANDATORY F1	
34.050		MOS	24						18-JAN-2001	18-JAN-2003		
	ASSOCIATED	HRS/MSC							7494			
	REF: AMM 34-10-01	AFL							5466			
340141	PORT, RIGHT UNHEATED STATIC										F1	
34.030	4-883050	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: AMM 34-10-01	AFL							0			
340121	DRAIN PITOT/STATIC SYSTEM										F2	
34.060	PKG 1, 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	200						7687		1.5	
	REF: AMM 34-10-00	AFL							5594			
+ 340151	LEAK CHECK RIGHT STATIC SYSTEM										MANDATORY F1	
34.050		MOS	24						18-JAN-2001	18-JAN-2003		
	ASSOCIATED	HRS/MSC							7494			
	REF: AMM 34-10-01	AFL							5466			
340606	PROBE, OUTSIDE AIR TEMPERATURE										F1	
34.380	MS28038-1	MOS							11-FEB-1982			
	9223	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
347659	PROGRAMMER, RNS										F1	
34.740	622-5110-001	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
346601	RECEIVER, NO.1 ADF										F4	
34.130	622-2362-001	MOS							11-FEB-1982			
	8945	HRS/MSC	O/C	0					0		1	
	REF: AMM 34-50-03/04	AFL							0			
346301	RECEIVER, NO.1 VHF NAVIGATION										F3	
34.450	622-0876-001	MOS							11-FEB-1982			
	16803	HRS/MSC	O/C	0					0			
	REF: AMM 34-50-01	AFL							0			

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
346536 34.580	RECEIVER, NO.1 VOR PN SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
346626 34.130	RECEIVER, NO.2 ADF 622-2362-001 8946 REF: AMM 34-50-03/04	MOS HRS/MSC AFL	O/C	0						06-APR-1985 2317 1423	F4	
346311 34.450	RECEIVER, NO.2 VHF NAVIGATION 622-0876-001 SN-UNKNOWN REF: AMM 34-50-01	MOS HRS/MSC AFL	O/C	0 0						11-FEB-1982 0 0	F3	
346566 34.600	RECEIVER, NO.2 VOR PN SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
345608 34.420	RECEIVER, RADIO ALTIMETER 622-3201-001 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0 0						11-FEB-1982 0 0	F3	
346201 34.540	RECEIVER/TRANSMITTER, MARKER BEACON PN SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0 0						11-FEB-1982 0 0	F3	
345601 34.240	RECEIVER/TRANSMITTER, RADIO ALTIMETER 622-3201-001 3652 REF: AMM 34-10-04	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F2	
345821 34.510	RECEIVER/TRANSMITTER, WEATHER RADAR 622-4022-001 2126 REF: AMM 34-40-01,-02,-03,-04	MOS HRS/MSC AFL	O/C							12-APR-1995 5613 4281	F3	
344161 34.210	SELECTOR, MODE COPILOT 614E-23R SN-UNKNOWN REF: AMM 34-20-03	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3	
343661 34.210	SELECTOR, MODE PILOT 614E-20R SN-UNKNOWN REF: AMM 34-20-03	MOS HRS/MSC AFL	O/C	0						11-FEB-1982 0 0	F3 1	
343677 34.490	SELECTOR, NO.1 REMOTE 622-4178-003 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0 0						11-FEB-1982 0 0	F3	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
344177 34.490	SELECTOR, NO.2 REMOTE 622-4178-003 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL								11-FEB-1982 0 0		
344121 34.180	SENSOR, RATE-OF-TURN COPILOT 622-0181-001 SN-UNKNOWN REF: AMM 22-11-05(1124A),34-20-06(1124)	MOS HRS/MSC AFL								11-FEB-1982 0 0	F3	
343621 34.180	SENSOR, RATE-OF-TURN PILOT 772-5140-001 3984 REF: AMM 22-11-05(1124A),34-20-06(1124)	MOS HRS/MSC AFL								05-OCT-1983 1300 794	F3	
346101 34.320	TRANSPONDER, NO.1 ATC 622-1270-001 9608 REF: AMM 34-50-06	MOS HRS/MSC AFL						06/11/1996		11-DEC-1995 5726 4410	F3 1	
346106 34.320	BENCH CHECK REF: See Workcard	MOS HRS/MSC AFL								25-SEP-1991	F3	
+ 346111 34.320	TEST FAR 91.413 REF: CMM FAR 91.413	MOS HRS/MSC AFL	24							18-JAN-2001 7494 5466	MANDATORY 18-JAN-2003 F3	
346116 34.320	TRANSPONDER, NO.2 ATC 622-1270-001 13112 REF: AMM 34-50-06	MOS HRS/MSC AFL								11-FEB-1982 0 0	F3 3	
346121 34.320	BENCH CHECK REF: CMM VENDOR MM	MOS HRS/MSC AFL								25-SEP-1991	F3 4	
+ 346126 34.320	TEST FAR 91.413 REF: CMM FAR 91.413	MOS HRS/MSC AFL	24							18-JAN-2001 7494 5466	MANDATORY 18-JAN-2003 F3	
340101 34.010	TUBE, LEFT PITOT 4883049-1 59912 REF: AMM 34-10-01	MOS HRS/MSC AFL								11-FEB-1982 0 0	F1	
340121 34.060 ASSOCIATED	DRAIN PITOT/STATIC SYSTEM PKG 1, 2, 3 REF: AMM 34-10-00	MOS HRS/MSC AFL						200		26-JUN-2001 7687 5594	F2 1.5	

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
340.111	LEAK CHECK LEFT PITOT SYSTEM										F1	
34.040		MOS							26-MAR-1996			
	ASSOCIATED	HRS/MSC	O/C									
	REF: AMM 34-10-01	AFL										
340.106	TUBE, RIGHT PITOT										F1	
34.010	4883049-1	MOS							11-FEB-1982			
	58348	HRS/MSC	O/C	0					0			
	REF: AMM 34-10-01	AFL							0			
340.121	DRAIN PITOT/STATIC SYSTEM										F2	
34.060	PKG 1, 2, 3	MOS							26-JUN-2001			
	ASSOCIATED	HRS/MSC	200						7687	1.5		
	REF: AMM 34-10-00	AFL							5594			
340.116	LEAK CHECK RIGHT PITOT SYSTEM										F1	
34.040		MOS							11-FEB-1982			
	ASSOCIATED	HRS/MSC	O/C						0			
	REF: AMM 34-10-01	AFL							0			
346.648	UNIT, CONTROL DISPLAY PROCESS										F3	
34.460	622-2899-016	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
348.165	UNIT, FMS AUXILIARY EQUIPMENT										F3	
34.770	622-5615-001/AEU-90	MOS						10/27/1989	27-JUL-1989			
	92	HRS/MSC	O/C						4311			
	REF: AMM 34-60-03	AFL							2856			
348.160	UNIT, FMS COMPUTER RECEIVER										F3	
34.760	622-5614-020/CRU-90	MOS							12-FEB-1990			
	52	HRS/MSC	O/C						4504			
	REF: AMM 34-60-03	AFL							3073			
348.170	UNIT, FMS CONTROL DISPLAY										F3	
34.790	622-5611-001/CDU-90	MOS							11-FEB-1982			
	040	HRS/MSC	O/C	0					0			
	REF: AMM 34-60-03	AFL							0			
348.175	UNIT, FMS DATA ENTRY										F3	
34.780	622-5613-001/DEU-90	MOS							16-AUG-1984			
	183	HRS/MSC	O/C	0					1890			
	REF: NO REF	AFL										
348.155	UNIT, FMS RADIO TUNING										F3	
34.750	622-5612-007/RTU-90	MOS							10-MAR-1987			
	50	HRS/MSC	O/C	0					3623			
	REF: AMM 34-60-03	AFL							2255			
348.136	UNIT, NO. 1 LRN EQUIPMENT										F3	
34.690	622-5494-001	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: AMM 34-60-04	AFL							0			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
348126 34.680	UNIT, NO.1 LRN RECEIVER COMP 622-5492-001 SN-UNKNOWN REF: AMM 34-60-04	MOS HRS/MS AFL								11-FEB-1982 0 0		
348141 34.690	UNIT, NO.2 LRN EQUIPMENT 622-5494-001 SN-UNKNOWN REF: AMM 34-60-04	MOS HRS/MS AFL								11-FEB-1982 0 0		
348131 34.720	UNIT, NO.2 LRN RECEIVER COMP 622-5494-001 SN-UNKNOWN REF: AMM 34-60-04	MOS HRS/MS AFL								11-FEB-1982 0 0		
346651 34.610	UNIT, VLF CONTROL DISPLAY 10060-6 2579 REF: AMM 34-10-06	MOS HRS/MS AFL								24-SEP-1987 3737 2345	F3	
346671 34.630	UNIT, VLF OPTIONAL EQUIPMENT 10600-2-210 2695 REF: AMM 34-60-02	MOS HRS/MS AFL					0			05-SEP-1989 4355 2904	F3	
346661 34.620	UNIT, VLF RECEIVER COMPUTER 10050-4-4A-3140 1937 REF: AMM 34-60-02	MOS HRS/MS AFL					0			05-SEP-1989 4355 2904	F5	
343111 34.120	VALVE, NO.1 FLUX 2594484 81096488 REF: AMM 34-20-01	MOS HRS/MS AFL					0			11-FEB-1982 0 0	W1	
343156 34.120	VALVE, NO.2 FLUX 2594484 81096489 REF: AMM 34-20-08	MOS HRS/MS AFL					0			11-FEB-1982 0 0	W2	
CHAPTER 35	OXYGEN											
350101 35.010	CYLINDER, OXYGEN 6350A25-EE-Z 49928W REF: AMM 35-00-00	MOS HRS/MS AFL	288				0			04-FEB-1982	LIFE LIMIT 04-FEB-2006	F2
350106 35.010	HYDROSTATIC TEST REF: AMM 35-00-00	MOS HRS/MS AFL	36 3000							26-JUL-2000 7325 5360	26-JUL-2003 10325	F2
350141 35.040	GAUGE, OXYGEN PRESSURE PN SN-UNKNOWN REF: NO REF	MOS HRS/MS AFL					0			11-FEB-1982 0 0		F3

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
350126	INDICATOR, OXYGEN DISCHARGE										F1	
35.040	118082	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
350181	MASK, PASSENGER OXYGEN L1										F4	
35.080	PN	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
350191	MASK, PASSENGER OXYGEN L2										F4	
35.080	PN	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
350201	MASK, PASSENGER OXYGEN R1										F4	
35.090	PN	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
350211	MASK, PASSENGER OXYGEN R2										F4	
35.090	PN	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
350221	MASK, PASSENGER OXYGEN R3										F4	
35.090	PN	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
350246	OUTLET, THERAPEUTIC OXYGEN										F4	
35.120	23599-11	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0					0			
	REF: NO REF	AFL							0			
350158	REGULATOR, MASK COPILOT									OVERHAUL	F3	
35.120	MC-1013-02	MOS	72	0					09-NOV-1996	09-NOV-2002		
	8161	HRS/MSC							5951			
	REF: NO REF	AFL							4589			
+ 350169U	CHECK										F3	
35.070		MOS	12						26-JUN-2001	26-JUN-2002		
		HRS/MSC	600						7687	8287		
	REF: AMM 35-00-00	AFL							5594			
350148	REGULATOR, MASK PILOT									OVERHAUL	F3	
35.120	MC-1013-02	MOS	72	0					09-NOV-1996	09-NOV-2002		
	7750	HRS/MSC		0					5951			
	REF: NO REF	AFL		0					4589			
+ 350166U	CHECK										F3	
35.070		MOS	12						26-JUN-2001	26-JUN-2002		
		HRS/MSC	600						7687	8287		
	REF: AMM 35-00-00	AFL							5594			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
350241	REGULATOR, OXYGEN DEMAND CONTROL PANEL (PURITAN) COPILOT										F3	
35.110	101202-11	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 35-10-00	AFL							0			
350236	REGULATOR, OXYGEN DEMAND CONTROL PANEL (PURITAN) PILOT										F3	
35.110	101202-11	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 35-10-00	AFL							0			
350116	REGULATOR, PRESSURE REDUCER										F3	
35.030	112031-06	MOS								11-FEB-1982	\$970.	
	670A	HRSMSC	O/C	0					0		8	
	REF: AMM 35-00-00	AFL							0			
350136	SWITCH, ALTITUDE PRESSURE										F3	
35.060	101800	MOS								11-FEB-1982		
	8024154	HRSMSC	O/C	0					0			
	REF: AMM 35-00-00	AFL							0			
350231	SYSTEM, PASSENGER OXYGEN SUPPLY										F3	
35.100	5753004-400	MOS								11-FEB-1982	\$950.	
	189	HRSMSC	O/C	0					0		6	
	REF: AMM 35-20-00	AFL							0			
350163	INSPECT/SERVICE OXYGEN SYSTEM										F3	
35.140	189	MOS								13-NOV-1995		
	REF: AMM 35-00-00	HRSMSC	O/C						5718			
		AFL							4397			
+ 350243	TEST										F4	
35.130	PKG 3	MOS								26-JUL-2000		
		HRSMSC	800						7325			
	REF: AMM 35-00-00	AFL							5360			
350103	VALVE, OXYGEN CYLINDER										F2	
35.150	6350-A25-DDC	MOS								11-DEC-1984		
	SN-UNKNOWN	HRSMSC	O/C						2119			
	REF: NO REF	AFL							1302			
350111	VALVE, OXYGEN FILLER										F1	
35.020	26875-48	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 35-00-00	AFL							0			
350131	VALVE, OXYGEN SHUTOFF										F2	
35.050	110115	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 35-00-00	AFL							0			
350108	VALVE, TOGGLE										F2	
35.150	170001	MOS								11-FEB-1982		
	8894	HRSMSC	O/C	0					0			
	REF: NO REF	AFL							0			
CHAPTER 49	AIRBORNE AUXILIARY POWER											

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
49APU1	APU, PN SN-UNKNOWN REF:	MOS HRS/MSC AFL	E/C								
CHAPTER 52	DOORS										
520181	LUBRICATE CABIN ENTRANCE STEP									F4	
52.020		MOS HRS/MSC AFL	O/C						11-FEB-1982 0 0		
	REF: AMM 12-20-00										
520161	DOOR, COMPARTMENT									F5	
52.040	CMA21212-002 SN-UNKNOWN REF: AMM 52-30-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0		
520171	DOOR, COMPARTMENT REAR BAGGAGE									F5	
52.050	CMA22211-001 SN-UNKNOWN REF: AMM 52-30-01	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0		
520101	DOOR, ENTRANCE CABIN									F4	
52.010	333045-505 SN-UNKNOWN REF:	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0		
+ 520106	INSPECT/LUBRICATE									F4	
52.010	PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		
	REF: AMM 52-10-00/12-20-00										
+ 520116	OPERATIONAL CHECK									F4	
52.010	PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		
	REF: AMM 52-10-00										
520136	HATCH, EMERGENCY EXIT LEFT									F4	
52.030	5-333031-501 SN-UNKNOWN REF: AMM 52-20-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0		
+ 520141	INSPECT/LUBRICATE SEAL									F4	
52.030	PKG 3	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360		
	REF: See Workcard										
520146	HATCH, EMERGENCY EXIT RIGHT									F4	
52.030	5-333031-501 SN-UNKNOWN REF: AMM 52-20-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0		
+ 520151	INSPECT/LUBRICATE SEAL									F4	
52.030	PKG 3	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360		
	REF: See Workcard										

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L



AIRCRAFT Status Report

(Alphabetical with Relations)

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
520166 52.060	SEAL, COMPARTMENT DOOR CMA21212-057 SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F5	
520173 52.060	SEAL, COMPARTMENT DOOR REAR BAGGAGE CMA22211-006 SN-UNKNOWN REF: NO REF	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F5	
520126 52.010	SEAL, ENTRANCE DOOR CABIN 333045-181 SN-UNKNOWN REF: AMM 52-10-00	MOS HRSMSC AFL	O/C	0					01-DEC-1995 5727 4410	F4	
520176 52.020	STEP, ENTRANCE CABIN 5-123580-1 SN-UNKNOWN REF: AMM 52-60-00	MOS HRSMSC AFL	O/C	0					11-FEB-1982 0 0	F4	
CHAPTER 53 FUSELAGE											
+ 530121 53.0202	INSPECT NOSE COMPARTMENT (B) PKG 2, 3 REF: AMM 5-20-01,-05	MOS HRSMSC AFL	400						26-JUN-2001 7687 5594	F2	
+ 530300 53.170	INSPECT AFT FUSELAGE STRUCTURE REF: AMM 5-40-02	MOS HRSMSC AFL	4800						24-AUG-1993 5326 3975	MANDATORY F5	
+ 530235 53.120	INSPECT AFT PRESSURE BULKHEAD AFT WEBS REF: AMM 5-40-01	MOS HRSMSC AFL	15000						15000	MANDATORY F5	
+ 530230 53.110	INSPECT AFT PRESSURE BULKHEAD FORWARD WEBS. REF: AMM 5-40-01	MOS HRSMSC AFL	9600						9600	MANDATORY F5	
+ 530250 53.150	INSPECT AFT PRESSURE BULKHEAD J-BEAM SPLICE FROM CABIN SIDE REF: AMM 5-40-01	MOS HRSMSC AFL	9600						9600	MANDATORY F5	
+ 530255 53.160	INSPECT AFT PRESSURE BULKHEAD J-BEAM SPLICE FROM FUEL COMPARTMENT REF: AMM 5-40-01	MOS HRSMSC AFL	15000						15000	MANDATORY F5	
+ 530240 53.130	INSPECT AFT PRESSURE BULKHEAD PERIPHERAL SECTION FROM CABIN SIDE. REF: AMM 5-40-01	MOS HRSMSC AFL	9600						9600	MANDATORY F5	

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 530245 53.140	INSPECT AFT PRESSURE BULKHEAD PERIPHERAL SECTION FROM FUEL COMPARTMENT	MOS HRS/MSC AFL	15000							MANDATORY	F5	
	REF: AMM 5-40-01									15000		
+ 530176 53.060	INSPECT AUXILIARY FUEL TANK STRUCTURE	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360		F5	
	REF: AMM 5-20-09											
+ 530146 53.0401	INSPECT CABIN (A)	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		F4	
	REF: AMM 5-20-02											
+ 530156 53.0402	INSPECT CABIN (C)	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360		F4	
	REF: AMM 5-20-02											
+ 530131 53.0301	INSPECT COCKPIT (A)	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		F3	
	REF: AMM 5-20-02,-03											
+ 530136 53.0302	INSPECT COCKPIT (B)	MOS HRS/MSC AFL	400						26-JUN-2001 7687 5594		F3	
	REF: AMM 5-20-02											
+ 530141 53.0303	INSPECT COCKPIT (C)	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360		F3	
	REF: AMM 5-20-02											
+ 530220 53.100	INSPECT ENTRY DOOR STOPS	MOS HRS/MSC AFL	5400						24-AUG-1993 5326 3975	MANDATORY 10726	F4	
	REF: AMM 5-40-01											
+ 530205 53.180	INSPECT FORWARD TO AFT MAIN FRAME	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	8125	F4	
	REF: AMM 5-40-01											
+ 530200 53.080	INSPECT FORWARD TO AFT PRESSURE BULKHEAD-FUSELAGE	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	8125	MANDATORY F4	
	REF: AMM 5-40-01											
+ 530101 53.010	INSPECT FUSELAGE (A)	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		F1	
	REF: AMM 5-20-02											

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 530210 53.090	INSPECT FUSELAGE SKINS FLIGHT COMPARTMENT SIDE WINDOW	MOS								MANDATORY	F4	
	REF: AMM 5-40-01	HRS/MSC AFL	4800						24-AUG-1993 5326 3975	10126		
+ 530116 53.0201	INSPECT NOSE COMPARTMENT (A) PKG 1, 2, 3	MOS									F2	
	REF: AMM 5-20-01,-05	HRS/MSC AFL	200						26-JUN-2001 7687 5594			
+ 530161 53.0501	INSPECT REAR COMPARTMENT (A) PKG 1, 2, 3	MOS									F5	
	REF: AMM 5-20-05	HRS/MSC AFL	200						26-JUN-2001 7687 5594			
+ 530166 53.0502	INSPECT REAR COMPARTMENT (B) PKG 2, 3	MOS									F5	
	REF: AMM 5-20-05	HRS/MSC AFL	400						26-JUN-2001 7687 5594			
531101 53.070	CONE, NOSE F10A-5-RD5-20000-7	MOS								11-FEB-1982	F2	
	SN-UNKNOWN	HRS/MSC	O/C				0		0			
	REF: NO REF	AFL					0		0			
CHAPTER 54 NACELLES/PYLONS												
+ 540200 54.020	INSPECT ENGINE SUPPORT INSTALLATION	MOS								MANDATORY		
	REF: AMM 5-40-04	HRS/MSC AFL	4800						24-AUG-1993 5326 3975	10126		
+ 540101U 54.0101	INSPECT NO. 1 ENGINE NACELLE/PYLON (A) PKG 1, 2, 3	MOS									E1	
	REF: AMM 5-20-07,-08/12-02-00	HRS/MSC AFL	200						26-JUN-2001 7687 5594			
+ 540106U 54.0102	INSPECT NO. 1 ENGINE NACELLE/PYLON (B) PKG 2, 3	MOS									E1	
	REF: AMM 5-20-07,-08/12-02-00	HRS/MSC AFL	400						26-JUN-2001 7687 5594		3	
+ 540111U 54.0103	INSPECT NO. 1 ENGINE NACELLE/PYLON (C) PKG 3	MOS									E1	
	REF: AMM 5-20-07,-08/12-02-00	HRS/MSC AFL	800						26-JUL-2000 7325 5360			
+ 540121U 54.0101	INSPECT NO. 2 ENGINE NACELLE/PYLON (A) PKG 1, 2, 3	MOS									E2	
	REF: AMM 5-20-07,-08/12-02-00	HRS/MSC AFL	200						26-JUN-2001 7687 5594			
+ 540126U 54.0102	INSPECT NO. 2 ENGINE NACELLE/PYLON (B) PKG 2, 3	MOS									E2	
	REF: AMM 5-20-07,-08/12-02-00	HRS/MSC AFL	400						26-JUN-2001 7687 5594		3	

Report Date **13-MAY-2002**

Aircraft Model - **1124 WESTWIND**
Owner Name - **R&S AIRCRAFT INVESTMENTS, LLC**
A/C Serial #: **368** A/C Reg. #: **N368MD**

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION			Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR				
+ 540131U 54.0103	INSPECT NO. 2 ENGINE NACELLE/PYLON (C) PKG 3	MOS HRS/MSC AFL	800					26-JUL-2000 7325 5360	E2	
REF: AMM 5-20-07,-08/12-02-00										
CHAPTER 55 STABILIZERS										
+ 550101 55.0101	INSPECT EMPENNAGE (A) PKG 1, 2, 3	MOS HRS/MSC AFL	200					26-JUN-2001 7687 5594	T1	
REF: AMM 5-20-06/12-20-00										
+ 550106 55.0102	INSPECT EMPENNAGE (B) PKG 2, 3	MOS HRS/MSC AFL	400					26-JUN-2001 7687 5594	T1	
REF: AMM 5-20-05,-06/12-20-00										
+ 550200 55.060	INSPECT EMPENNAGE (MAJOR)	MOS HRS/MSC AFL	4800					24-AUG-1993 5326 3975	MANDATORY T1	
REF: AMM 5-40-03										
550651 55.030	STABILIZER, HORIZONTAL 5453015-413-1 SN-UNKNOWN REF: AMM 55-10-00	MOS HRS/MSC AFL	O/C	0				11-FEB-1982 0 0	T1	
550656 55.040	CHECK AFT SPAR SPLICE-HINGE FITTING OUTBOARD LUGS FOR CRACKS PKG 1, 2, 3	MOS HRS/MSC AFL	200					26-JUN-2001 7687 5594	T1	
REF: AMM 55-10-00										
550658 55.050	CHECK ASSEMBLY RADIAL/AXIAL PLAY PKG 3	MOS HRS/MSC AFL	800					26-JUL-2000 7325 5360	T1	
REF: See Workcard										
270214 27.195 ASSOCIATED	LUBRICATE AFT HINGE FITTING BEARINGS PKG 1, 2, 3	MOS HRS/MSC AFL	200					26-JUN-2001 7687 5594	T1	
REF: NO REF										
270215 27.195 ASSOCIATED	LUBRICATE FORWARD SCISSOR ASSEMBLY PKG 1, 2, 3	MOS HRS/MSC AFL	200					26-JUN-2001 7687 5594	T1	
REF: NO REF										
SB 1124-55-097 ASSOCIATED	STABILIZER SCISSR SERVICE BULLETIN	MOS HRS/MSC AFL	A/R					0 0	T1	
REF: See Workcard										
Method of Compliance: OPEN										
550601 55.020	STABILIZER, VERTICAL 5413027-411 SN-UNKNOWN REF: See Workcard	MOS HRS/MSC AFL	O/C	0				11-FEB-1982 0 0	T1	
REF: See Workcard										

CHAPTER 56 WINDOWS

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
561601	WINDOW, EMERGENCY EXIT NO.L3 LEFT										F4	
56.075	PN	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
561606	WINDOW, EMERGENCY EXIT NO.R4 RIGHT										F4	
56.075	PN	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
560601	WINDOW, NO.L1 LEFT										F4	
56.050	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
560606	WINDOW, NO.L2 LEFT										F4	
56.060	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
560611	WINDOW, NO.L4 LEFT										F4	
56.070	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
560616	WINDOW, NO.L5 LEFT										F4	
56.080	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
561101	WINDOW, NO.R1 RIGHT										F4	
56.050	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
561106	WINDOW, NO.R2 RIGHT										F4	
56.060	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
561111	WINDOW, NO.R3 RIGHT										F4	
56.070	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
561116	WINDOW, NO.R5 RIGHT										F4	
56.080	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			
561121	WINDOW, NO.R6 RIGHT										F4	
56.080	5-34 3016-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRSMSC	O/C	0					0			
	REF: AMM 56-20-00	AFL							0			

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
560121	WINDOW, OVERHEAD										F3	
56.040	5-34 3021-1	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 56-10-02	AFL		0						0		
560126	WINDOW, OVERHEAD										F3	
56.040	5-34 3021-2	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 56-10-02	AFL		0						0		
560116	WINDOW, SIDE COPILOT										F3	
56.030	5-34 3003-501	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 56-10-04	AFL		0						0		
+ 560118	INSPECT										F3	
56.030	PKG 3	MOS								26-JUL-2000		
		HRS/MSC	800							7325		
	REF: See Workcard	AFL								5360		
560111	WINDOW, SIDE PILOT										F3	
56.030	5-34 3017-505	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 56-10-03	AFL		0						0		
+ 560112	INSPECT										F3	
56.030	PKG 3	MOS								26-JUL-2000		
		HRS/MSC	800							7325		
	REF: AMM 56-10-03	AFL								5360		
560107	WINDSHIELD, INNER COPILOT										F3	
56.020	5343035	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 56-10-01	AFL								0		
560102	WINDSHIELD, INNER PILOT										F3	
56.020	5343035	MOS								11-FEB-1982		
	SN-UNKNOWN	HRS/MSC	O/C	0						0		
	REF: AMM 56-10-01	AFL								0		
560106	WINDSHIELD, OUTER COPILOT										F3	
56.010	PPG 343030-2	MOS								26-AUG-2000		
	99064H0109	HRS/MSC	O/C	0						7352		
	REF: AMM 56-10-01	AFL								5381		
560101	WINDSHIELD, OUTER PILOT										F3	
56.010	343030-1	MOS								22-FEB-2000		
	98342H0422	HRS/MSC	O/C	0						7107		
	REF: AMM 56-10-01	AFL								5232		
CHAPTER 57	WINGS											
+ 570220	INSPECT LEFT OUTER WING PANELS										MANDATORY	
57.050		MOS								24-AUG-1993	W1	
		HRS/MSC	4800							5326	10126	
	REF: AMM 5-40-05	AFL								3975		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 570101 57.0101	INSPECT LEFT WING (A) PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		W1 1.5	
	REF: AMM 5-20-03											
+ 570104 57.0102	INSPECT LEFT WING (B) PKG 2, 3	MOS HRS/MSC AFL	400						26-JUN-2001 7687 5594		W1	
	REF: AMM 5-20-03											
+ 570200 57.040	INSPECT LEFT WING STRUCTURE	MOS HRS/MSC AFL	15000							MANDATORY 15000	W1	
	REF: AMM 5-40-05											
+ 570120 57.020	INSPECT RIGHT AILERON BELLCRANK PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		W2	
	REF: AMM 5-20-03											
+ 570221 57.050	INSPECT RIGHT OUTER WING PANELS	MOS HRS/MSC AFL	4800						24-AUG-1993 5326 3975	10126	MANDATORY W2	
	REF: AMM 5-40-05											
+ 570116 57.0101	INSPECT RIGHT WING (A) PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		W2 1.5	
	REF: AMM 5-20-03											
+ 570119 57.0102	INSPECT RIGHT WING (B) PKG 2, 3	MOS HRS/MSC AFL	400						26-JUN-2001 7687 5594		W2	
	REF: AMM 5-20-03											
+ 570201 57.040	INSPECT RIGHT WING STRUCTURE	MOS HRS/MSC AFL	15000							MANDATORY 15000	W2	
	REF: AMM 5-40-05											
570031 57.030	TANK, TIP LEFT 5213003-405	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0		W1	
	SN-UNKNOWN REF: AMM 57-20-00											
570041 57.030	TANK, TIP RIGHT 5213003-406	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0		W2	
	SN-UNKNOWN REF: AMM 57-20-00											
CHAPTER 71	POWER PLANT											
+ 710650U	-- INSP #1 ENG INLET NACELLE PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594		E1	
	REF:											

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
+ 713650U	-- INSP #2 ENG INLET NACELLE PKG 1, 2, 3	MOS HRS/MSC AFL	200						26-JUN-2001 7687 5594	E2	
71EN1	ENGINE, NO. 1 3072500-2 P-77482 REF:	MOS HRS/MSC AFL	E/C								
71EN2	ENGINE, NO. 2 3072500-2 P77488 REF:	MOS HRS/MSC AFL	E/C								
CHAPTER 73	ENGINE FUEL AND CONTROL										
731101U	COMPUTER, FUEL CONT ENG #1 2101144-1 SN-UNKNOWN REF:	MOS HRS/MSC AFL	O/C	3972 2456				03-APR-1989 4215 2745	F5 \$4400. 3		
733601U	COMPUTER, FUEL CONT ENG #2 2101144-1 51-2172 REF:	MOS HRS/MSC AFL	O/C	4215 2745			31-MAY-1989 4265 2793	F5 \$4400. 3			
732106U	INDICATOR, FUEL FLO ENG #1 6-883708-1 SN-UNKNOWN REF:	MOS HRS/MSC AFL	O/C	3209 1976			30-JUL-1986 3209 1976	F3 \$372.			
734606U	INDICATOR, FUEL FLO ENG #2 6-883708-1 SN-UNKNOWN REF:	MOS HRS/MSC AFL	O/C	3017 1772			30-JUL-1986 3209 1976	F3 \$372.			
CHAPTER 75	AIR										
750116 75.030	SENSOR, TEMPERATURE INLET 3070816-2 SN-UNKNOWN REF: See Workcard	MOS HRS/MSC AFL	O/C	3972 2456			03-APR-1989 4215 2745	E1			
750616 75.030	SENSOR, TEMPERATURE INLET 3070816-2 15594 REF: See Workcard	MOS HRS/MSC AFL	O/C	1592			31-MAY-1989 4265 2793	E2			
CHAPTER 77	ENGINE INDICATING										
771606 77.020	INDICATOR, (N1) LOW-PRESSURE NO. 2 ENGINE 6-883619-1 4162 REF: AMM 77-00-00	MOS HRS/MSC AFL	O/C	0			11-FEB-1982 0 0	F3 \$1100.			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L



AIRCRAFT Status Report

(Alphabetical with Relations)

Report Date 13-MAY-2002

Aircraft Model - 1124 WESTWIND
 Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
 A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
770106 77.020	INDICATOR, (N1) LOW PRESSURE NO. 1 ENGINE 6883619-1 SN-UNKNOWN REF: AMM 77-00-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3 \$1100.	
770606 77.040	INDICATOR, (N2) HIGH-PRESSURE NO. 1 ENGINE 6883620-1 SN-UNKNOWN REF: AMM 77-00-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	
772106 77.040	INDICATOR, (N2) HIGH-PRESSURE NO. 2 ENGINE 6-883620-1 SN-UNKNOWN REF: AMM 77-00-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F3	
771106 77.060	INDICATOR, ITT NO. 1 ENGINE 6883621-503 R0097 REF: AMM 77-00-00	MOS HRSMSC AFL	O/C		0					31-MAY-1993 5278 3928	F3 \$507.	
772606 77.060	INDICATOR, ITT NO. 2 ENGINE 6883621-503 R0031R REF: AMM 77-00-00	MOS HRSMSC AFL	O/C		0					31-MAY-1993 5278 3928	F3 \$507.	
CHAPTER 78 EXHAUST												
+ 780119 78.140	CHECK #1 THRUST REVERSER SECONDARY LATCH SOLENOID SWITCH PKG 3 REF: AMM 78-30-00	MOS HRSMSC AFL		800						26-JUL-2000 7325 5360	E1	
+ 780120 78.140	CHECK #2 THRUST REVERSER SECONDARY LATCH SOLENOID SWITCH PKG 3 REF: AMM 78-30-00	MOS HRSMSC AFL		800						26-JUL-2000 7325 5360	E2	
+ 780116 78.110	OPERATIONAL CHECK NO.1 THRUST REVERSER PKG 3 REF: AMM 78-30-00	MOS HRSMSC AFL		800						26-JUL-2000 7325 5360	E1	
+ 780616 78.110	OPERATIONAL CHECK NO.2 THRUST REVERSER PKG 3 REF: AMM 78-30-00	MOS HRSMSC AFL		800						26-JUL-2000 7325 5360	E2	
780156 78.040	ACCUMULATOR, THRUST REVERSER 4723565-1 SN-UNKNOWN REF: AMM 78-34-00	MOS HRSMSC AFL	O/C	0						11-FEB-1982 0 0	F5	
780146 78.020	ACTUATOR, THRUST REVERSER NO. 1 F10A-5-SCH203-1 0419 REF: AMM 78-34-00	MOS HRSMSC AFL	O/C	0						02-JAN-1987 3504 2168	E1	

? - Insufficient Information
 + Task exists in FAA Manual
 5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Report Date **13-MAY-2002**

Aircraft Model - **1124 WESTWIND**
Owner Name - **R&S AIRCRAFT INVESTMENTS, LLC**
A/C Serial #: **368 A/C Reg. #: N368MD**

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
780646	ACTUATOR, THRUST REVERSER NO. 2									E2	
78.020	F10A-5-SCH203-1	MOS						11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: AMM 78-34-00	AFL						0			
780161	BOTTLE, THRUST REVERSER GAS STORAGE								LIFE LIMIT	F5	
78.050	3753015-501	MOS	288	0				11-FEB-1982	11-FEB-2006		
	07511A1	HRS/MSC									
	REF: AMM 78-34-00	AFL									
+ 780163	HYDROSTATIC TEST									F5	
78.050		MOS	36					26-OCT-1999	26-OCT-2002		
		HRS/MSC						6961			
	REF: See Workcard	AFL						5135			
780131	CONTROL ASSEMBLY, THROTTLE RETARDER FEEDBACK NO. 1								LIFE LIMIT	E1	
78.090	F10A-5SCP203-1	MOS						11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	10000	0				0	10000		
	REF: AMM 78-32-00	AFL						0			
780136	CLEAN/LUBRICATE NO.1 THROTTLE RETARDER CABLE AND CASING									E1	
78.090		MOS	36					06-NOV-2001	06-NOV-2004		
		HRS/MSC						7774			
	REF: AMM 12-20-00	AFL						5641			
780631	CONTROL ASSEMBLY, THROTTLE RETARDER FEEDBACK NO. 2								LIFE LIMIT	E2	
78.090	F10A-5SCP203-2	MOS						11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	10000	0				0	10000		
	REF: AMM 78-32-00	AFL						0			
780636	CLEAN/LUBRICATE NO.2 THROTTLE RETARDER CABLE AND CASING									E2	
78.090		MOS	36					06-NOV-2001	06-NOV-2004		
		HRS/MSC						7774			
	REF: AMM 78-32-00	AFL						5641			
780171	RELEASE VALVE, THRUST REVERSER									F5	
78.070	3723581-1	MOS						11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: AMM 78-34-00	AFL						0			
780158	SWITCH, THRUST REVERSER LOW-PRESSURE									F5	
78.080	4713533-1	MOS						11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: AMM 78-34-00	AFL						0			
780141	THRUST REVERSER ASSEMBLY, NO. 1									E1	
78.010	F10A-5-B20202-1	MOS						11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C	0				0			
	REF: NO REF	AFL						0			
+ 780148	INSPECT								INSPECT	E1	
78.130		MOS						20-AUG-1991			
		HRS/MSC	5000					4906	9906		
	REF: See Workcard	AFL									

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
780143 78.100	LUBRICATE PKG 3 REF: AMM 12-20-00	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	E1	
780641 78.011	THRUST REVERSER ASSEMBLY, NO. 2 F10A-5-B20202-2 SN-UNKNOWN REF: NO REF	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	E2	
+ 780648 78.130	INSPECT REF: See Workcard	MOS HRS/MSC AFL	5000						20-AUG-1991 4906 9906	INSPECT E2	
780643 78.100	LUBRICATE PKG 3 REF: AMM 12-20-00	MOS HRS/MSC AFL	800						26-JUL-2000 7325 5360	E2	
780166 78.060	VALVE, RELIEF PN SN-UNKNOWN REF: AMM 78-34-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F5	
780151 78.030	VALVE, THRUST REVERSER CONTROL NO. 1 723573 525 REF: AMM 78-34-00	MOS HRS/MSC AFL	O/C	0					08-APR-1987 3684 2293	F5 \$588. 2	
780651 78.030	VALVE, THRUST REVERSER CONTROL NO. 2 723573 SN-UNKNOWN REF: AMM 78-34-00	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F5 \$588. 2	
CHAPTER 79	OIL										
791121U	IND, PRESS/TEMP ENG #1 6-883706-1 SN-UNKNOWN REF:	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F3 \$805.	
792621U	IND, PRESS/TEMP ENG #2 6-883706-1 SN-UNKNOWN REF:	MOS HRS/MSC AFL	O/C	0					11-FEB-1982 0 0	F3 \$805.	
790616U	VALVE, OIL TEMP ENG #1 157025-2 SN-UNKNOWN REF:	MOS HRS/MSC AFL	O/C	3972 2456					03-APR-1989 4215 2745	E1	
792116U	VALVE, OIL TEMP ENG #2 157025-2 SN-UNKNOWN REF:	MOS HRS/MSC AFL	O/C	4215					31-MAY-1989 4265 2793	E2	

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
ENGINE NO. 1												
CHAPTER 71												
POWER PLANT												
710140U	NO. 1 ENGINE - -- RUN ADJ/TEST #1 ENG	MOS								13-NOV-1999		
	REF:	HRS/MSC	C/C							6961		
		ENC								5135		
		(AFL)										
+ 714010	NO. 1 ENGINE - CHECK ELECTRICAL WIRES AND CONNECTIONS	MOS								26-JUL-2000		
71.040		HRS/MSC	800							7325	8125	
	REF: EMM 72-00-00	ENC								5360		
		(AFL)										
+ 715010	NO. 1 ENGINE - CHECK PLUMBING LINES AND CONNECTIONS	MOS								26-JUL-2000		
71.050		HRS/MSC	800							7325	8125	
	REF: EMM 72-00-00	ENC								5360		
		(AFL)										
+ 710130	NO. 1 ENGINE - INSPECT FAN ROTOR ASSEMBLY BLADES	MOS								16-FEB-2001		
71.020	PKG 6, 6	HRS/MSC	300							7551	.5	
	REF: EMM 72-00-00	ENC								5515		
		(AFL)										
+ 710120	NO. 1 ENGINE - MAJOR PERIODIC INSPECTION	MOS								13-NOV-1999		
71.010		HRS/MSC	1400							6961	8361	
	REF: EMM 72-00-00	ENC								5135		
		(AFL)										
710110U	NO. 1 ENGINE - ENGINE, #1	MOS								03-APR-1989		
	3072500-2	HRS/MSC	O/C			3972				4215		
	P-77482	ENC								2745		
	REF:	(AFL)				2456						
CHAPTER 72												
ENGINE												
+ 724120	NO. 1 ENGINE - INSPECT COMBUSTION PLENUM CASE	MOS								13-NOV-1999		
72.030		HRS/MSC	1400							6961	8361	
	REF: EMM 72-40-04	ENC								5135		
		(AFL)										
+ 723110	NO. 1 ENGINE - INSPECT COMPRESSOR CORE	MOS								26-APR-1994		
72.010		HRS/MSC	4200							5442	9642	
	REF: NO REF	ENC								4106		
		(AFL)										

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION TSN TSO TSR TSI ADJ	Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
+ 727110 72.300	NO. 1 ENGINE - PERIODIC INSPECT FAN SUPPORT ASSEMBLY	MOS					26-APR-1994	
	REF: EMM 72-70-06	HRS/MSC	4200			5442	9642	
		ENC						4106
		(AFL)						
724110 72.020	NO. 1 ENGINE - CASE, COMBUSTION PLENUM	MOS					03-APR-1989	
	3072443-4	HRS/MSC	O/C	3972		4215		
	IP8088	ENC						2456
	REF: NO REF	(AFL)						
+ 724120 72.030	NO. 1 ENGINE - INSPECT COMBUSTION PLENUM CASE	MOS					13-NOV-1999	
	ASSOCIATED	HRS/MSC	1400			6961	8361	
	REF: EMM 72-40-04	ENC						5135
		(AFL)						
725050 72.090	NO. 1 ENGINE - DISC, FAN ROTOR	MOS					13-NOV-1999	LIFE LIMIT
	3073563-2	HRS/MSC		0		6961		
	970322902451	ENC						5135
	REF: NO REF	(AFL)	10000	0				15135
725060 72.100	NO. 1 ENGINE - DISC, STAGE 1 LOW PRESSURE COMPRESSOR	MOS					03-APR-1989	LIFE LIMIT
	3072395	HRS/MSC		3972		4215		
	1-12 112-1531	ENC						2456
	REF: NO REF	(AFL)	10000	2456		2745	10289	
725010 72.040	NO. 1 ENGINE - DISC, STAGE 1 LOW PRESSURE TURBINE	MOS					12-JUL-1991	LIFE LIMIT
	3072352-4	HRS/MSC		0		4879		
	0-03 229-1212	ENC						3494
	REF: NO REF	(AFL)	3000	0				6494
725070 72.110	NO. 1 ENGINE - DISC, STAGE 2 LOW PRESSURE COMPRESSOR	MOS					03-APR-1989	LIFE LIMIT
	3072396	HRS/MSC		3972		4215		
	1-12 112-429	ENC						2745
	REF: NO REF	(AFL)	10000	2456		2745	10289	
725020 72.050	NO. 1 ENGINE - DISC, STAGE 2 LOW PRESSURE TURBINE	MOS					20-MAY-1993	LIFE LIMIT
	3072351-5	HRS/MSC		0		5278		
	1-03 226-1486	ENC						3928
	REF: NO REF	(AFL)	3000	0				6928
725080 72.120	NO. 1 ENGINE - DISC, STAGE 3 LOW PRESSURE COMPRESSOR	MOS					03-APR-1989	LIFE LIMIT
	3072397	HRS/MSC		3972		4215		
	0-12 112-4057	ENC						2745
	REF: NO REF	(AFL)	10000	2456		2745	10289	

Report Date **13-MAY-2002**

(Alphabetical with Relations)

Engine Model - TFE731-3

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION			COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR			
725030	NO. 1 ENGINE - DISC, STAGE 3 LOW PRESSURE TURBINE							LIFE LIMIT	
72.060	3074097-1	MOS					13-NOV-1999		
	97533220 2025	HRS/MSC		0			6961		
	REF: NO REF	ENC							
		(AFL)	7000	0			5135	12135	
725090	NO. 1 ENGINE - DISC, STAGE 4 LOW PRESSURE COMPRESSOR							LIFE LIMIT	
72.130	3072398	MOS					03-APR-1989		
	0-03 160-3697	HRS/MSC		3972			4215		
	REF: NO REF	ENC							
		(AFL)	10000	2456			2745	10289	
725160	NO. 1 ENGINE - DUCT, TURBINE INTERSTAGE TRANSITION								
72.200	3072318	MOS					03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C				4215		
	REF: EMM 72-50-05	ENC							
		(AFL)					2745		
726110	NO. 1 ENGINE - GEARBOX, ACCESSORY								
72.250	3070003-5	MOS					03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C	3972			4215		
	REF: EMM 72-60-01	ENC							
		(AFL)		2456			2745		
+ 726120	NO. 1 ENGINE - INSPECT								
72.260		MOS					26-APR-1994		
		HRS/MSC	4200				5442	9642	
	REF: EMM 72-60-02	ENC							
		(AFL)					4106		
726130	NO. 1 ENGINE - GEARBOX, TRANSFER								
72.270	3070093-3	MOS					03-APR-1989		
	P-2768	HRS/MSC	O/C	0			4215		
	REF: EMM 72-60-01	ENC							
		(AFL)		0			2745		
725110	NO. 1 ENGINE - IMPELLER, HIGH PRESSURE							LIFE LIMIT	
72.150	3073398-1	MOS					03-APR-1989		
	4-23 365-1094	HRS/MSC		3972			4215		
	REF: NO REF	ENC							
		(AFL)	10000	2456			2745	10289	
725180	NO. 1 ENGINE - NOZZLE, STAGE 1 LOW PRESSURE TURBINE								
72.220	3072319-11	MOS					13-NOV-1999		
	990134506659	HRS/MSC	O/C	0			6961		
	REF: NO REF	ENC							
		(AFL)		0			5135		
725140	NO. 1 ENGINE - PLATE, HIGH PRESSURE ROTOR SEAL							LIFE LIMIT	
72.180	3072411-1	MOS					13-NOV-1999		
	7-18040-2569	HRS/MSC		3816			6961		
	REF: NO REF	ENC							
		(AFL)	10000	2507			5135	12628	

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL



AIRCRAFT Status Report

(Alphabetical with Relations)

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
725040 72.070	NO. 1 ENGINE - ROTOR, HIGH PRESSURE TURBINE 3072316 1-18040-598 REF: EMM 72-50-06	MOS HRS/MSC ENC (AFL)	7000		3972 2456					03-APR-1989 4215 2745	LIFE LIMIT 7289	
725170 72.210	NO. 1 ENGINE - SEAL PLATE, STAGE 1 LOW PRESSURE TURBINE 3073552 SN-UNKNOWN REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C							11-FEB-1982 0 0		
725190 72.230	NO. 1 ENGINE - SEAL, LOW PRESSURE TURBINE ROTATING AIR 3073355 SN-UNKNOWN REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C		0 0 0					0 0 0		
725120 72.160	NO. 1 ENGINE - SEAL, ROTATING 3072729-1 0-23151-343 REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C		0 0 0					12-JUL-1991 4879 3494		
725150 72.190	NO. 1 ENGINE - SHAFT, FAN DRIVE 3071955-3 1P-39726 REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C		3972 2456					03-APR-1989 4215 2745		
725130 72.170	NO. 1 ENGINE - SHAFT, HIGH PRESSURE SHOULDERED 3072545-1 1P-39446 REF: NO REF	MOS HRS/MSC ENC (AFL)	12000		3972 3456					03-APR-1989 4215 2745	LIFE LIMIT 11289	
725191 72.240	NO. 1 ENGINE - SUPPORT, LOW PRESSURE TURBINE ROTATING AIR SEAL 3073764 SN-UNKNOWN REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C									
725091 72.140	NO. 1 ENGINE - TIE ROD, LOW PRESSURE 3073049-1 1P-15433 REF: EMM 72-30-10	MOS HRS/MSC ENC (AFL)	O/C		3972 2456					03-APR-1989 4215 2745		
CHAPTER 73	ENGINE FUEL AND CONTROL											
+ 731120 73.020	NO. 1 ENGINE - REMOVE AND REPLACE FILTER ELEMENT REF: EMM 73-21-02	MOS HRS/MSC ENC (AFL)	600							16-FEB-2001 7551 5515	8151	

? - Insufficient Information
 + Task exists in FAA Manual
 5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Engine Model - TFE731-3
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

(Alphabetical with Relations)

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
732110	NO. 1 ENGINE - CONTROL UNIT, FUEL											
73.060	3070800-8	MOS								18-MAY-1989		
	SN-UNKNOWN	HRS/MSC	O/C							4215		
	REF: EMM 73-20-01	ENC										
	(AFL)									2456		
										2745		
732120	NO. 1 ENGINE - CHANGE PRESSURE LIMITER VALVE											
73.070	3070685-4	MOS								03-APR-1989		
ASSOCIATED	SN-UNKNOWN	HRS/MSC	O/C							4215		
	REF: NO REF	ENC										
	(AFL)									2456		
										2745		
731150	NO. 1 ENGINE - COOLER, FUEL/OIL											
73.050	158610-5	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C							4215		
	REF: EMM 79-20-07	ENC										
	(AFL)									2456		
										2745		
731140	NO. 1 ENGINE - HEATER, FUEL											
73.040	158670-3	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C							4215		
	REF: EMM 73-10-04	ENC										
	(AFL)									2456		
										2745		
731110	NO. 1 ENGINE - PUMP, ENGINE FUEL											
73.010	3070850-8	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C							4215		
	REF: EMM 73-20-01	ENC										
	(AFL)									2456		
										2745		
+ 731120	NO. 1 ENGINE - REMOVE AND REPLACE FILTER ELEMENT											
73.020		MOS								16-FEB-2001		
ASSOCIATED		HRS/MSC	600							7551	8151	
	REF: EMM 73-21-02	ENC										
	(AFL)									5515		
732160	NO. 1 ENGINE - TRANSMITTER, FUEL FLOW											
73.110	6883709-1	MOS								06-MAY-1992		
	564	HRS/MSC	O/C							5105		
	REF: NO REF	ENC										
	(AFL)									0		
										3725		
731130	NO. 1 ENGINE - VALVE, FLOW DIVIDER/DRAIN											
73.030	394366-4	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C							4215		
	REF: NO REF	ENC										
	(AFL)									2456		
										2745		
732110	NO. 1 ENGINE - CHANGE FUEL CONTROL UNIT											
73.060	3070800-8	MOS								18-MAY-1989		
ASSOCIATED	SN-UNKNOWN	HRS/MSC	O/C							4215		
	REF: EMM 73-20-01	ENC										
	(AFL)									2456		
										2745		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Engine Model - TFE731-3

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
732120	NO. 1 ENGINE - CHANGE PRESSURE LIMITER VALVE											
73.070	3070685-4	MOS								03-APR-1989		
ASSOCIATED	SN-UNKNOWN	HRS/MSC	O/C	3972					4215			
	REF: NO REF	ENC										
		(AFL)		2456					2745			
732120	NO. 1 ENGINE - VALVE, PRESSURE LIMITER											
73.070	3070685-4	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C	3972					4215			
	REF: NO REF	ENC										
		(AFL)		2456					2745			
732140	NO. 1 ENGINE - VALVE, SOLENOID CONTROL											
73.090	109696-3-1	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C	3972					4215			
	REF: EMM 76-10-01	ENC										
		(AFL)		2456					2745			
732130	NO. 1 ENGINE - VALVE, SURGE BLEED											
73.080	978812-4-1	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C	3972					4215			
	REF: EMM 76-10-01	ENC										
		(AFL)		2456					2745			
CHAPTER 74	IGNITION											
+ 742120	NO. 1 ENGINE - INSPECT 6 O'CLOCK IGNITER PLUG											
74.040		MOS								26-JUL-2000		
		HRS/MSC	800						7325	8125		
	REF: EMM 74-00-01	ENC										
		(AFL)							5360			
+ 742140	NO. 1 ENGINE - INSPECT 7 O'CLOCK IGNITER PLUG											
74.060		MOS								26-JUL-2000		
		HRS/MSC	800						7325	8125		
	REF: EMM 74-00-01	ENC										
		(AFL)							5360			
+ 741120	NO. 1 ENGINE - OPERATIONAL CHECK IGNITION SYSTEM											
74.020		MOS								26-JUL-2000		
		HRS/MSC	800						7325	8125	1	
	REF: EMM 74-00-01	ENC										
		(AFL)							5360			
742110	NO. 1 ENGINE - IGNITER PLUG, 6 O'CLOCK											
74.030	3071589-2	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MSC	O/C	3972					4215			
	REF: EMM 74-00-01	ENC										
		(AFL)		2456					2745			
+ 742120	NO. 1 ENGINE - INSPECT 6 O'CLOCK IGNITER PLUG											
74.040		MOS								26-JUL-2000		
ASSOCIATED		HRS/MSC	800						7325	8125		
	REF: EMM 74-00-01	ENC										
		(AFL)							5360			

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
742130	NO. 1 ENGINE - IGNITER PLUG, 7 O'CLOCK											
74.050	3071589-2	MOS							03-APR-1989			
	SN-UNKNOWN	HRS/MSC	O/C			3972			4215			
	REF: EMM 74-00-01	ENC										
		(AFL)				2456			2745			
+ 742140	NO. 1 ENGINE - INSPECT 7 O'CLOCK IGNITER PLUG											
74.060		MOS							26-JUL-2000			
	ASSOCIATED	HRS/MSC	800						7325	8125		
	REF: EMM 74-00-01	ENC										
		(AFL)							5360			
741110	NO. 1 ENGINE - UNIT, IGNITION											
74.010	3070378-2	MOS							03-APR-1989			
	SN-UNKNOWN	HRS/MSC	O/C			3972			4215			
	REF: EMM 74-00-01	ENC										
		(AFL)				2456			2745			
+ 741120	NO. 1 ENGINE - OPERATIONAL CHECK IGNITION SYSTEM											
74.020		MOS							26-JUL-2000			
	ASSOCIATED	HRS/MSC	800						7325	8125	1	
	REF: EMM 74-00-01	ENC										
		(AFL)							5360			
CHAPTER 75	AIR											
751010	NO. 1 ENGINE - VALVE, ANTI-ICE SHUTOFF											
75.010	978944-1-1	MOS							03-APR-1989			
	SN-UNKNOWN	HRS/MSC	O/C			3972			4215			
	REF: EMM 75-10-01	ENC										
		(AFL)				2456			2745			
CHAPTER 77	ENGINE INDICATING											
772110	NO. 1 ENGINE - HARNESS, ITT THERMOCOUPLE											
77.030	3073595-1	MOS							12-JUL-1991			
	1-20219-407	HRS/MSC	O/C			0			4879			
	REF: EMM 77-20-01	ENC										
		(AFL)							3494			
771120	NO. 1 ENGINE - TRANSDUCER, HIGH PRESSURE (N2)											
77.020	3070722-2	MOS							03-APR-1989			
	SN-UNKNOWN	HRS/MSC	O/C			3972			4215			
	REF: EMM 77-10-05	ENC										
		(AFL)				2456			2745			
771110	NO. 1 ENGINE - TRANSDUCER, LOW PRESSURE (N1)											
77.010	3071928-5	MOS							03-APR-1989			
	SN-UNKNOWN	HRS/MSC	O/C			3972			4215			
	REF: EMM 77-10-03	ENC										
		(AFL)				2456			2745			
CHAPTER 79	OIL											

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 790110 79.010	NO. 1 ENGINE - ANALYZE ENGINE OIL PKG 4, 4,6, 6	MOS HRS/MSC ENC (AFL)	150							26-JUN-2001 7687	1	
	REF: EMM 72-00-00									5594		
790120 79.020	NO. 1 ENGINE - CHANGE OIL	MOS HRS/MSC ENC (AFL)	1400							13-NOV-1999 6961	8361	
	REF: EMM 72-00-00									5135		
+ 790130 79.030	NO. 1 ENGINE - INSPECT CHIP DETECTOR PKG 4, 4,6, 6	MOS HRS/MSC ENC (AFL)	150							26-JUN-2001 7687		
	REF: EMM 72-00-00									5594		
792150 79.080	NO. 1 ENGINE - COOLER, OIL LOWER LEFT 159900-1 SN-UNKNOWN REF: EMM 79-20-09	MOS HRS/MSC ENC (AFL)	O/C	3972						03-APR-1989 4215		
										2745		
792160 79.090	NO. 1 ENGINE - COOLER, OIL LOWER RIGHT 159910-1 SN-UNKNOWN REF: EMM 79-20-09	MOS HRS/MSC ENC (AFL)	O/C	3972						03-APR-1989 4215		
										2745		
792140 79.070	NO. 1 ENGINE - COOLER, OIL UPPER 158600-4 SN-UNKNOWN REF: EMM 79-20-09	MOS HRS/MSC ENC (AFL)	O/C	3972						03-APR-1989 4215		
										2745		
792110 79.040	NO. 1 ENGINE - PUMP, OIL 3071949-7 SN-UNKNOWN REF: EMM 79-20-03	MOS HRS/MSC ENC (AFL)	O/C	3972						03-APR-1989 4215		
										2745		
790120 79.020 ASSOCIATED	NO. 1 ENGINE - CHANGE OIL REF: EMM 72-00-00	MOS HRS/MSC ENC (AFL)	1400							13-NOV-1999 6961	8361	
										5135		
793120 79.120	NO. 1 ENGINE - SWITCH, OIL PRESSURE 3833518 SN-UNKNOWN REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C	3972						03-APR-1989 4215		
										2745		

Engine Model - TFE731-3

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
793110	NO. 1 ENGINE - TRANSMITTER, OIL PRESSURE											
79.110	101-412-80-13	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MS	O/C	3972						4215		
	REF: NO REF	ENC										
		(AFL)		2456						2745		
792120	NO. 1 ENGINE - VALVE, OIL FILTER BYPASS											
79.050	3070000NP69	MOS								03-APR-1989		
	SN-UNKNOWN	HRS/MS	O/C	3972						4215		
	REF: EMM 79-30-01	ENC										
		(AFL)		2456						2745		
792130	NO. 1 ENGINE - VALVE, PRESSURE BREATHER											
79.060	3071564-8	MOS								18-MAY-1989		
	SN-UNKNOWN	HRS/MS	O/C							4215		
	REF: EMM 79-20-02	ENC										
		(AFL)								2745		

Report Date **13-MAY-2002**

Engine Model - TFE731-3
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
ENGINE NO. 2											
CHAPTER 71 POWER PLANT											
710140U	NO. 2 ENGINE - -- RUN ADJ/TEST #2 ENG	MOS							31-MAY-1993		
	REF:	HRS/MSC	C/C						5278		
		ENC							3928		
		(AFL)									
+ 714010	NO. 2 ENGINE - CHECK ELECTRICAL WIRES AND CONNECTIONS	MOS							26-JUL-2000		
71.040		HRS/MSC	800						7325	8125	
	REF: EMM 72-00-00	ENC							5360		
		(AFL)									
+ 715010	NO. 2 ENGINE - CHECK PLUMBING LINES AND CONNECTIONS	MOS							26-JUL-2000		
71.050		HRS/MSC	800						7325	8125	
	REF: EMM 72-00-00	ENC							5360		
		(AFL)									
+ 710130	NO. 2 ENGINE - INSPECT FAN ROTOR ASSEMBLY BLADES	MOS							16-FEB-2001		
71.020	PKG 7, 7	HRS/MSC	300						7551	.5	
	REF: EMM 72-00-00	ENC							5515		
		(AFL)									
+ 710120	NO. 2 ENGINE - MAJOR PERIODIC INSPECTION	MOS							17-OCT-1998		
71.010		HRS/MSC	1400						6520	7920	
	REF: EMM 72-00-00	ENC							4889		
		(AFL)									
710110U	NO. 2 ENGINE - ENGINE, #2	MOS							31-MAY-1993		
	3072500-2	HRS/MSC	O/C	5227					5278		
	P77488	ENC							3928		
	REF:	(AFL)		3867							
CHAPTER 72 ENGINE											
+ 724120	NO. 2 ENGINE - INSPECT COMBUSTION PLENUM CASE	MOS							17-SEP-1998		
72.030		HRS/MSC	1400						6520	7920	
	REF: EMM 72-40-04	ENC							4889		
		(AFL)									
+ 723110	NO. 2 ENGINE - INSPECT COMPRESSOR CORE	MOS							17-OCT-1998		
72.010		HRS/MSC	4200						6520	10720	
	REF: NO REF	ENC							4889		
		(AFL)									

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 727110 72.300	NO. 2 ENGINE - PERIODIC INSPECT FAN SUPPORT ASSEMBLY	MOS								17-MAY-1989		
	REF: EMM 72-70-06	HRS/MSC ENC (AFL)	4200							4265 8465 2793		
724110 72.020	NO. 2 ENGINE - CASE, COMBUSTION PLENUM 3072443-4	MOS								31-MAY-1989		
	OP-52337	HRS/MSC	O/C	4215						4265		
	REF: NO REF	ENC (AFL)								2793		
+ 724120 72.030 ASSOCIATED	NO. 2 ENGINE - INSPECT COMBUSTION PLENUM CASE	MOS								17-SEP-1998		
	REF: EMM 72-40-04	HRS/MSC ENC (AFL)	1400							6520 7920 4889		
725050 72.090	NO. 2 ENGINE - DISC, FAN ROTOR 3073539-2	MOS								20-MAY-1993	LIFE LIMIT	
	0-18040-4768	HRS/MSC		4087						5278		
	REF: NO REF	ENC (AFL)	4100	2660						3928 5368		
725060 72.100	NO. 2 ENGINE - DISC, STAGE 1 LOW PRESSURE COMPRESSOR 3072395	MOS								31-MAY-1989	LIFE LIMIT	
	1-12112-1647	HRS/MSC		4215						4265		
	REF: NO REF	ENC (AFL)	10000	2745						2793 10048		
725010 72.040	NO. 2 ENGINE - DISC, STAGE 1 LOW PRESSURE TURBINE 3072351-5	MOS								20-MAY-1993	LIFE LIMIT	
	1-03229-1486	HRS/MSC		0						5278		
	REF: NO REF	ENC (AFL)	3000	0						3928 6928		
725070 72.110	NO. 2 ENGINE - DISC, STAGE 2 LOW PRESSURE COMPRESSOR 3072396	MOS								31-MAY-1989	LIFE LIMIT	
	1-12112-581	HRS/MSC		4215						4265		
	REF: NO REF	ENC (AFL)	10000	2745						2793 10048		
725020 72.050	NO. 2 ENGINE - DISC, STAGE 2 LOW PRESSURE TURBINE 3072542-5	MOS								20-MAY-1993	LIFE LIMIT	
	1-03229-1277	HRS/MSC		0						5278		
	REF: NO REF	ENC (AFL)	3000	0						3928 6928		
725080 72.120	NO. 2 ENGINE - DISC, STAGE 3 LOW PRESSURE COMPRESSOR 3072397	MOS								31-MAY-1989	LIFE LIMIT	
	0-12112-1718	HRS/MSC		4215						4265		
	REF: NO REF	ENC (AFL)	10000	2745						2793 10048		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Engine Model - TFE731-3

Report Date **13-MAY-2002**

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
725030 72.060	NO. 2 ENGINE - DISC, STAGE 3 LOW PRESSURE TURBINE 3072544-2 6-18040-4905 REF: NO REF	MOS HRS/MSC ENC (AFL)								31-MAY-1989 4265 2793	LIFE LIMIT 5793	
725090 72.130	NO. 2 ENGINE - DISC, STAGE 4 LOW PRESSURE COMPRESSOR 3072398 0-12112-3229 REF: NO REF	MOS HRS/MSC ENC (AFL)								31-MAY-1989 4265 2793	LIFE LIMIT 10048	
725160 72.200	NO. 2 ENGINE - DUCT, TURBINE INTERSTAGE TRANSITION 3072318 SN-UNKNOWN REF: EMM 72-50-05	MOS HRS/MSC ENC (AFL)					O/C			31-MAY-1989 4265 2793		
726110 72.250	NO. 2 ENGINE - GEARBOX, ACCESSORY 3070003-5 P-948 REF: EMM 72-60-01	MOS HRS/MSC ENC (AFL)					O/C			31-MAY-1989 4265 2793		
+ 726120 72.260	NO. 2 ENGINE - INSPECT REF: EMM 72-60-02	MOS HRS/MSC ENC (AFL)					4200			17-MAY-1989 4265 2793	8465	
726130 72.270	NO. 2 ENGINE - GEARBOX, TRANSFER 3070093-3 P-3691 REF: EMM 72-60-01	MOS HRS/MSC ENC (AFL)					O/C			31-MAY-1989 4265 2793		
725110 72.150	NO. 2 ENGINE - IMPELLER, HIGH PRESSURE 3073394-1 0-23369-4190 REF: NO REF	MOS HRS/MSC ENC (AFL)								31-MAY-1989 4265 2793	LIFE LIMIT 12793	
725180 72.220	NO. 2 ENGINE - NOZZLE, STAGE 1 LOW PRESSURE TURBINE 3072319 SN-UNKNOWN REF: NO REF	MOS HRS/MSC ENC (AFL)					O/C			31-MAY-1989 4265 2793		
725140 72.180	NO. 2 ENGINE - PLATE, HIGH PRESSURE ROTOR SEAL 3072411-1 1-18040-5077 REF: NO REF	MOS HRS/MSC ENC (AFL)								31-MAY-1989 4265 2793	LIFE LIMIT 10048	

Report Date **13-MAY-2002**

Engine Model - TFE731-3
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
725040	NO. 2 ENGINE - ROTOR, HIGH PRESSURE TURBINE										LIFE LIMIT	
72.070	3072316	MOS							31-MAY-1989			
	1-18040-451	HRS/MSC				4215			4265			
	REF: EMM 72-50-06	ENC										
		(AFL)	7000			2745			2793	7048		
725170	NO. 2 ENGINE - SEAL PLATE, STAGE 1 LOW PRESSURE TURBINE											
72.210	3073552	MOS							11-FEB-1982			
	SN-UNKNOWN	HRS/MSC	O/C						0			
	REF: NO REF	ENC										
		(AFL)							0			
725190	NO. 2 ENGINE - SEAL, LOW PRESSURE TURBINE ROTATING AIR											
72.230	3073355	MOS				0						
	SN-UNKNOWN	HRS/MSC	O/C			0			0			
	REF: NO REF	ENC										
		(AFL)				0			0			
725120	NO. 2 ENGINE - SEAL, ROTATING											
72.160	3072729-1	MOS							31-MAY-1989			
	7-23151-1814	HRS/MSC	O/C			0			4265			
	REF: NO REF	ENC										
		(AFL)				0			2793			
725150	NO. 2 ENGINE - SHAFT, FAN DRIVE											
72.190	3071955-3	MOS							31-MAY-1989			
	IP-41464	HRS/MSC	O/C			4215			4265			
	REF: NO REF	ENC										
		(AFL)				2745			2793			
725130	NO. 2 ENGINE - SHAFT, HIGH PRESSURE SHOULDERED										LIFE LIMIT	
72.170	3072545-1	MOS							31-MAY-1989			
	1P-39469	HRS/MSC				4215			4265			
	REF: NO REF	ENC										
		(AFL)	12000			2745			2793	12048		
725191	NO. 2 ENGINE - SUPPORT, LOW PRESSURE TURBINE ROTATING AIR SEAL											
72.240	3073764	MOS										
	SN-UNKNOWN	HRS/MSC	O/C									
	REF: NO REF	ENC										
		(AFL)										
725091	NO. 2 ENGINE - TIE ROD, LOW PRESSURE											
72.140	3073049-1	MOS							31-MAY-1989			
	1P-15412	HRS/MSC	O/C			4215			4265			
	REF: EMM 72-30-10	ENC										
		(AFL)				2745			2793			
CHAPTER 73	ENGINE FUEL AND CONTROL											
+ 731120	NO. 2 ENGINE - REMOVE AND REPLACE FILTER ELEMENT											
73.020		MOS							16-FEB-2001			
		HRS/MSC	600						7551	8151		
	REF: EMM 73-21-02	ENC										
		(AFL)							5515			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Engine Model - TFE731-3

Report Date 13-MAY-2002

(Alphabetical with Relations)

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
732110 73.060	NO. 2 ENGINE - CONTROL UNIT, FUEL 3070800-2 A3593PT REF: EMM 73-20-01	MOS HRS/MSC ENC (AFL)	O/C							31-MAY-1989 4265 2793		
732120 73.070 ASSOCIATED	NO. 2 ENGINE - CHANGE PRESSURE LIMITER VALVE 3070685-4 A6760 REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C	4215						31-MAY-1989 4265 2793		
731150 73.050	NO. 2 ENGINE - COOLER, FUEL/OIL 158610-7 21-3736 REF: EMM 79-20-07	MOS HRS/MSC ENC (AFL)	O/C	4215						31-MAY-1989 4265 2793		
731140 73.040	NO. 2 ENGINE - HEATER, FUEL 158670-3 71-2903 REF: EMM 73-10-04	MOS HRS/MSC ENC (AFL)	O/C	4215						31-MAY-1989 4265 2793		
731110 73.010	NO. 2 ENGINE - PUMP, ENGINE FUEL 3070850-8 MX364112 REF: EMM 73-20-01	MOS HRS/MSC ENC (AFL)	O/C	4215						31-MAY-1989 4265 2793		
+ 731120 73.020 ASSOCIATED	NO. 2 ENGINE - REMOVE AND REPLACE FILTER ELEMENT REF: EMM 73-21-02	MOS HRS/MSC ENC (AFL)	600							16-FEB-2001 7551 8151 5515		
732160 73.110	NO. 2 ENGINE - TRANSMITTER, FUEL FLOW 883709-1 SN-UNKNOWN REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C	4215						31-MAY-1989 4265 2793		
731130 73.030	NO. 2 ENGINE - VALVE, FLOW DIVIDER/DRAIN 394366-4 SN-UNKNOWN REF: NO REF	MOS HRS/MSC ENC (AFL)	O/C	4215						31-MAY-1989 4265 2793		
732110 73.060 ASSOCIATED	NO. 2 ENGINE - CHANGE FUEL CONTROL UNIT 3070800-2 A3593PT REF: EMM 73-20-01	MOS HRS/MSC ENC (AFL)	O/C							31-MAY-1989 4265 2793		

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
732120	NO. 2 ENGINE - CHANGE PRESSURE LIMITER VALVE										
73.070	3070685-4	MOS							31-MAY-1989		
ASSOCIATED	A6760	HRS/MSC	O/C	4215					4265		
	REF: NO REF	ENC									
		(AFL)		2745					2793		
732120	NO. 2 ENGINE - VALVE, PRESSURE LIMITER										
73.070	3070685-4	MOS							31-MAY-1989		
	A6760	HRS/MSC	O/C	4215					4265		
	REF: NO REF	ENC									
		(AFL)		2745					2793		
732140	NO. 2 ENGINE - VALVE, SOLENOID CONTROL										
73.090	109696-3-1	MOS							31-MAY-1989		
	P-3683	HRS/MSC	O/C	4215					4265		
	REF: EMM 76-10-01	ENC									
		(AFL)		2745					2793		
732130	NO. 2 ENGINE - VALVE, SURGE BLEED										
73.080	978812-4-1	MOS							31-MAY-1989		
	P-3683	HRS/MSC	O/C	4215					4265		
	REF: EMM 76-10-01	ENC									
		(AFL)		2745					2793		
CHAPTER 74	IGNITION										
+ 742120	NO. 2 ENGINE - INSPECT 6 O'CLOCK IGNITER PLUG										
74.040		MOS							26-JUL-2000		
		HRS/MSC	800						7325	8125	
	REF: EMM 74-00-01	ENC									
		(AFL)							5360		
+ 742140	NO. 2 ENGINE - INSPECT 7 O'CLOCK IGNITER PLUG										
74.060		MOS							26-JUL-2000		
		HRS/MSC	800						7325	8125	
	REF: EMM 74-00-01	ENC									
		(AFL)							5360		
+ 741120	NO. 2 ENGINE - OPERATIONAL CHECK IGNITION SYSTEM										
74.020		MOS							26-JUL-2000		
		HRS/MSC	800						7325	8125	
	REF: EMM 74-00-01	ENC								1	
		(AFL)							5360		
742110	NO. 2 ENGINE - IGNITER PLUG, 6 O'CLOCK										
74.030	3071589-2	MOS							17-OCT-1998		
	SN-UNKNOWN	HRS/MSC	O/C						6520		
	REF: EMM 74-00-01	ENC									
		(AFL)							4889		
+ 742120	NO. 2 ENGINE - INSPECT 6 O'CLOCK IGNITER PLUG										
74.040		MOS							26-JUL-2000		
ASSOCIATED		HRS/MSC	800						7325	8125	
	REF: EMM 74-00-01	ENC									
		(AFL)							5360		

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
742130	NO. 2 ENGINE - IGNITER PLUG, 7 O'CLOCK 3071589-2	MOS							09-NOV-1996		
74.050	SN-UNKNOWN REF: EMM 74-00-01	HRS/MS ENC (AFL)	O/C					5951		4589	
+ 742140	NO. 2 ENGINE - INSPECT 7 O'CLOCK IGNITER PLUG 3071589-2	MOS							26-JUL-2000		
74.060	SN-UNKNOWN REF: EMM 74-00-01	HRS/MS ENC (AFL)	800					7325	8125	5360	
741110	NO. 2 ENGINE - UNIT, IGNITION 3070378-2	MOS							31-MAY-1989		
74.010	SN-UNKNOWN REF: EMM 74-00-01	HRS/MS ENC (AFL)	O/C	1142				4265		2793	
+ 741120	NO. 2 ENGINE - OPERATIONAL CHECK IGNITION SYSTEM 3070378-2	MOS							26-JUL-2000		
74.020	SN-UNKNOWN REF: EMM 74-00-01	HRS/MS ENC (AFL)	800					7325	8125	5360	
751010	NO. 2 ENGINE - VALVE, ANTI-ICE SHUTOFF 978944-1-1	MOS							31-MAY-1989		
75.010	SN-UNKNOWN REF: EMM 75-10-01	HRS/MS ENC (AFL)	O/C	4215				4265		2793	
772110	NO. 2 ENGINE - HARNESS, ITT THERMOCOUPLE 3071849-3	MOS							31-MAY-1989		
77.030	9-20219-358 REF: EMM 77-20-01	HRS/MS ENC (AFL)	O/C					4265		2793	
771120	NO. 2 ENGINE - TRANSDUCER, HIGH PRESSURE (N2) 3070722-2	MOS							31-MAY-1989		
77.020	SN-UNKNOWN REF: EMM 77-10-05	HRS/MS ENC (AFL)	O/C	4215				4265		2793	
771110	NO. 2 ENGINE - TRANSDUCER, LOW PRESSURE (N1) 3071928-5	MOS							31-MAY-1989		
77.010	SN-UNKNOWN REF: EMM 77-10-03	HRS/MS ENC (AFL)	O/C	4215				4265		2793	
79	OIL										

Engine Model - TFE731-3

Report Date **13-MAY-2002**

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
+ 790110	NO. 2 ENGINE - ANALYZE ENGINE OIL											
79.010	PKG 5, 5, 7, 7	MOS							26-JUN-2001			
	REF: EMM 72-00-00	HRS/MSC	150						7687		1	
		ENC										
		(AFL)							5594			
790120	NO. 2 ENGINE - CHANGE OIL											
79.020		MOS							17-OCT-1998			
	REF: EMM 72-00-00	HRS/MSC	1400						6520	7920		
		ENC										
		(AFL)							4889			
+ 790130	NO. 2 ENGINE - INSPECT CHIP DETECTOR											
79.030	PKG 5, 5, 7, 7	MOS							26-JUN-2001			
	REF: EMM 72-00-00	HRS/MSC	150						7687			
		ENC										
		(AFL)							5594			
792150	NO. 2 ENGINE - COOLER, OIL LOWER LEFT											
79.080	159900-1	MOS							31-MAY-1989			
	SN-UNKNOWN	HRS/MSC	O/C						4265			
	REF: EMM 79-20-09	ENC										
		(AFL)							2793			
792160	NO. 2 ENGINE - COOLER, OIL LOWER RIGHT											
79.090	159910-1	MOS							31-MAY-1989			
	SN-UNKNOWN	HRS/MSC	O/C	4215					4265			
	REF: EMM 79-20-09	ENC										
		(AFL)							2793			
792140	NO. 2 ENGINE - COOLER, OIL UPPER											
79.070	158600-4	MOS							31-MAY-1989			
	SN-UNKNOWN	HRS/MSC	O/C	4215					4265			
	REF: EMM 79-20-09	ENC										
		(AFL)							2793			
792110	NO. 2 ENGINE - PUMP, OIL											
79.040	3071949-7	MOS							31-MAY-1989			
	0683	HRS/MSC	O/C						4265			
	REF: EMM 79-20-03	ENC										
		(AFL)							2793			
790120	NO. 2 ENGINE - CHANGE OIL											
79.020		MOS							17-OCT-1998			
ASSOCIATED		HRS/MSC	1400						6520	7920		
	REF: EMM 72-00-00	ENC										
		(AFL)							4889			
793120	NO. 2 ENGINE - SWITCH, OIL PRESSURE											
79.120	3-833518	MOS							31-MAY-1989			
	1041	HRS/MSC	O/C	482					4265			
	REF: NO REF	ENC										
		(AFL)							2793			

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:46 PM

COPYRIGHT 2001 CAMP SYSTEMS INT'L

Engine Model - TFE731-3

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
793110	NO. 2 ENGINE - TRANSMITTER, OIL PRESSURE											
79.110	101-412-80-13	MOS								31-MAY-1989		
	SN-UNKNOWN	HRS/MSC	O/C	4215						4265		
	REF: NO REF	ENC (AFL)								2793		
792120	NO. 2 ENGINE - VALVE, OIL FILTER BYPASS											
79.050	3070000NP69	MOS								31-MAY-1989		
	SN-UNKNOWN	HRS/MSC	O/C	4215						4265		
	REF: EMM 79-30-01	ENC (AFL)								2793		
792130	NO. 2 ENGINE - VALVE, PRESSURE BREATHER											
79.060	3075323-1	MOS								04-FEB-1994		
	6376	HRS/MSC	O/C	0						5390		
	REF: EMM 79-20-02	ENC (AFL)								4040		

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION TSN TSO TSR TSI ADJ	Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
AIRCRAFT								
AD 1974-08-09 R2	AIRWORTHINESS DIRECTIVE TO PREVENT POSSIBLE FIRES THAT COULD RESULT FROM SMOKING MATERIALS BEING DROPPED INTO LAVATORY PAPER OR LINEN WASTE RECEPTACLES							F4
		MOS				17-JAN-2001		
		HRS/MSC	1000			7494	8494	
		AFL				5466		
	REF:							
	Method of Compliance: OPEN							
AD 1989-12-08	AIRWORTHINESS DIRECTIVE TO DETECT CRACKS IN THE HINGE LUGS OF THE HORIZONTAL STABILIZER AFT SPAR SPLICE FITTING (HINGE ASSEMBLY)							
		MOS				17-JAN-2001		
		HRS/MSC	300			7494	7794	
		AFL				5466		
	REF: See Workcard							
	Method of Compliance: OPEN							
AD 1996-24-11 LEFT AILERON	AIRWORTHINESS DIRECTIVE TO PREVENT EXCESSIVE WEAR OF THE AILERON PUSH-PULL TUBE, WHICH COULD RESULT IN UNEVEN MOVEMENT OF THE CONTROL WHEEL, PERFORATION OF THE AILERON PUSH-PULL TUBE, AND CONSEQUENT REDUCED ROLL CONTROL OF THE AIRPLANE							W1
		MOS				26-JUL-2000		
		HRS/MSC	600			7325	7925	
		AFL				5360		
	REF: AD							
	Method of Compliance: OPEN							
SB 1124-27-129 LEFT AILERON	FLIGHT CONTROLS SERVICE BULLETIN							W1
		MOS				26-JUL-2000		
ASSOCIATED		HRS/MSC	600			7325	7925	
		AFL				5360		
	REF: BULLETINS							
	Method of Compliance: OPEN							
AD 1996-24-11 RIGHT AILERON	AIRWORTHINESS DIRECTIVE TO PREVENT EXCESSIVE WEAR OF THE AILERON PUSH-PULL TUBE, WHICH COULD RESULT IN UNEVEN MOVEMENT OF THE CONTROL WHEEL, PERFORATION OF THE AILERON PUSH-PULL TUBE, AND CONSEQUENT REDUCED ROLL CONTROL OF THE AIRPLANE							W2
		MOS				26-JUL-2000		
		HRS/MSC	600			7325	7925	
		AFL				5360		
	REF: AD							
	Method of Compliance: OPEN							
SB 1124-27-129 RIGHT AILERON	FLIGHT CONTROLS SERVICE BULLETIN							W2
		MOS				26-JUL-2000		
ASSOCIATED		HRS/MSC	600			7325	7925	
		AFL				5360		
	REF: BULLETINS							
	Method of Compliance: OPEN							
AD 1998-06-10	AIRWORTHINESS DIRECTIVE TO PREVENT FAILURE OF THE HYDRAULIC FUSE TO OPERATE PROPERLY IN THE EVENT OF AN EXTERNAL LEAK DOWNSTREAM OF THE FUSE, WHICH COULD RESULT IN LOSS OF HYDRAULIC SYSTEMS							
		MOS	36			06-NOV-2001	06-NOV-2004	
		HRS/MSC	1200			7774	8974	
		AFL				5641		
	REF: AD							
	Method of Compliance: OPEN							

Aircraft Model - 1124 WESTWIND

Report Date 13-MAY-2002

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
AD 2002-01-26	AIRWORTHINESS DIRECTIVE TO PREVENT FAILURE OF ATTACHMENT BOLTS DUE TO FATIGUE, WHICH COULD RESULT IN SEPARATION OF THE ENGINE INLET COWL AND AFT NACELLE, AND CONSEQUENT DAMAGE TO THE HORIZONTAL OR VERTICAL STABILIZER	MOS							MANDATORY		
		HRS/MSC	DUE						50		
	REF:	AFL									
	Method of Compliance: OPEN										
SB ASB1124-54A-138	SERVICE BULLETIN	MOS							MANDATORY		
	ASSOCIATED	HRS/MSC	A/R								
	REF:	AFL									
	Method of Compliance: OPEN										
SB 1124-27-129 LEFT AILERON	SERVICE BULLETIN FLIGHT CONTROLS	MOS						26-JUL-2000		W1	
		HRS/MSC	600					7325	7925		
	REF: BULLETINS	AFL						5360			
	Method of Compliance: OPEN										
SB 1124-27-129 RIGHT AILERON	SERVICE BULLETIN FLIGHT CONTROLS	MOS						26-JUL-2000		W2	
		HRS/MSC	600					7325	7925		
	REF: BULLETINS	AFL						5360			
	Method of Compliance: OPEN										
SB 1124-30-036 PART II	SERVICE BULLETIN ICE AND RAIN PROTECTION	MOS						26-JUN-2001		F3	
	PKG 1, 2, 3	HRS/MSC	150					7687	7837		
	REF: See Workcard	AFL						5594			
	Method of Compliance: OPEN										
SB 1124-32-139 UPPER	SERVICE BULLETIN LANDING GEAR	MOS						26-JUL-2000			
	PKG 3	HRS/MSC	800					7325	8125		
	REF:	AFL						5360			
	Method of Compliance: OPEN										
SB 1124-55-020 R2	SERVICE BULLETIN STABILIZERS	MOS						26-JUN-2001		T1	
	PKG 2, 3	HRS/MSC	300					7687	7987		
	REF: See Workcard	AFL						5594			
	Method of Compliance: OPEN										
SB 900280	SERVICE BULLETIN SB WW 24-28A	MOS						22-FEB-2000		L3	
		HRS/MSC	1200					7107			
	REF: See Workcard	AFL						5232			
	Method of Compliance: OPEN										
SB 972850U	SERVICE BULLETIN SB 731-A72-3668 #1 ENG	MOS							RECOMMENDED		
		HRS/MSC	A/R						31-DEC-2002		
	REF:	AFL									

? - Insufficient Information
+ Task exists in FAA Manual
5/14/2002 7:05:59 PM

COPYRIGHT 2001 CAMP SYSTEMS INTL

Aircraft Model - 1124 WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					Warr Exp	COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ				
SB 972851U	SERVICE BULLETIN SB 731-A72-3688 #2 ENG	MOS								RECOMMENDED 31-DEC-2002		
	REF:	HRS/MSA AFL	A/R									
SB 972B40U	SERVICE BULLETIN GSBA72-3569 R/E FAN ROTOR	MOS								5722		
	REF:	HRS/MSA AFL	A/R									
	Method of Compliance: OPEN											
SL WW-2492	SERVICE LETTER HYD HOSE INSP PKG 1, 2, 3	MOS							26-JUN-2001			
	REF:	HRS/MSA AFL	200						7687 5594	7887		
	Method of Compliance: OPEN											
SL WW-2494 R3 LEFT	SERVICE LETTER LANDING GEAR	MOS							26-JUN-2001		L1	
	REF: See Workcard	HRS/MSA AFL	300						7687 5594	7987		
	Method of Compliance: OPEN											
SL WW-2494 R3 RIGHT	SERVICE LETTER LANDING GEAR	MOS							26-JUN-2001		L2	
	REF: See Workcard	HRS/MSA AFL	300						7687 5594	7987		
	Method of Compliance: OPEN											

Engine Model - TFE731-3

Report Date **13-MAY-2002**

Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

A/C Serial #: 368 A/C Reg. #: N368MD

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
ENGINE NO. 1											
AD 2000-15-09	NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE HPC IMPELLER										
		MOS								10-OCT-2000	
		HRS/MS	4200								
	REF:	ENC									
	Method of Compliance: OPEN										
AD 2001-23-09	NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE TO PREVENT FAILURE OF THE FAN ROTOR DISC DUE TO FATIGUE CRACKING IN THE DOVETAIL SLOTS									MANDATORY	
		MOS								31-DEC-2002	
		HRS/MS	DUE								
	REF:	ENC									
	Method of Compliance: OPEN										
SB TFE731-A72-3668	NO. 1 ENGINE - REMOVE FAN ROTOR DISC FROM SERVICE SERVICE BULLETIN									MANDATORY	
		MOS								31-DEC-2002	
	ASSOCIATED	HRS/MS	A/R								
	REF: BULLETINS	ENC									
	Method of Compliance: OPEN										

Engine Model - TFE731-3
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO WORKCARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL	TIME-----AT-----INSTALLATION					COMPLIANCE	DISPOSITION NEXT DUE	AREA PRICE LABOR HRS
				TSN	TSO	TSR	TSI	ADJ			
ENGINE NO. 2											
AD 2000-15-09	NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE HPC IMPELLER										
		MOS							10-OCT-2000		
	REF:	HRS/MSC	4200								
	ENC										
	Method of Compliance: OPEN										
AD 2001-23-09	NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE TO PREVENT FAILURE OF THE FAN ROTOR DISC DUE TO FATIGUE CRACKING IN THE DOVETAIL SLOTS								MANDATORY		
		MOS							31-DEC-2002		
	REF:	HRS/MSC	DUE								
	ENC										
	Method of Compliance: OPEN										
SB TFE731-A72-3668	NO. 2 ENGINE - REMOVE FAN ROTOR DISC FROM SERVICE SERVICE BULLETIN								MANDATORY		
		MOS							31-DEC-2002		
	ASSOCIATED	HRS/MSC	A/R								
	REF: BULLETINS	ENC									
	Method of Compliance: OPEN										

OWNER: R&S AIRCRAFT INVESTMENTS, LLC
ADDRESS: P.O. BOX 43 HOUSTON TX 77001-0043
PHONE: 713-830-9584
FAX: 713-918-5925

OPERATOR: R&S AIRCRAFT INVESTMENTS, LLC
ADDRESS: P.O. BOX 43 HOUSTON TX 77001-0043
PHONE: 713-830-9584
FAX: 713-918-5925

PROJECTED : 2 MOS. to 13-JUL-2002

AIRCRAFT

S/N: 368 **REG NO:** N368MD **MODEL:** 1124A WESTWIND **MANUFACTURER:** GULFSTREAM AEROSPACE CORPORATION

NOTE:
INSPECTION PROGRAM: 3
CERTIFICATE DATE: 11-FEB-1982

UOM	LAST ACTUAL	LAST ACTUAL DATE	PROJECTED
HRS	7806	28-FEB-2002	7964.07
AFL	5706	28-FEB-2002	5864

ENGINE NO. 1

S/N: P-77482 **PART NO:** 3072500-2 **MODEL:** TFE731-3 **MANUFACTURER:** HONEYWELL

INSTALLED DATE: 4/3/1989
A/C HRS: 4215
ENGINE HRS: 3972
ENGINE CYCLES: 2456

UOM	LAST ACTUAL	LAST ACTUAL DATE	PROJECTED
HRS	7806	28-FEB-2002	7964.07
ENC	0		0
(AFL)	5706	28-FEB-2002	5864

ENGINE NO. 2

S/N: P77488 **PART NO:** 3072500-2 **MODEL:** TFE731-3 **MANUFACTURER:** HONEYWELL

INSTALLED DATE: 5/31/1993
A/C HRS: 5278
ENGINE HRS: 5227
ENGINE CYCLES: 3867

UOM	LAST ACTUAL	LAST ACTUAL DATE	PROJECTED
HRS	7806	28-FEB-2002	7964.07
ENC	0		0
(AFL)	5706	28-FEB-2002	5864

Maintenance Due List/Time Remaining - AIRCRAFT(CALENDAR)

Aircraft Model - 1124A WESTWIND

Serial #: 368 Reg. #: N368MD

Report Date 13-MAY-2002

ITEM NO	WORK CARD	TASK DESCRIPTION	UNIT	INTERVAL TIME-----AT-----INSTALLATION COMPLIANCE				DISPOSITION		TIME	AREA
				TSN	TSO	TSR	WARR EXP	NEXT DUE	(ENH) AFH (xEXT)		
WORK ORDER	SERIAL NUMBER									LABOR	
R	AD 2000-15-09	NO. 1 ENGINE - HPC IMPELLER AIRWORTHINESS DIRECTIVE									
			MOS					10-OCT-2000		New Reqmt	
			DUE NEXT	HRS/MSC	4200						
		REF:	ENC								
R	AD 2000-15-09	NO. 2 ENGINE - HPC IMPELLER AIRWORTHINESS DIRECTIVE									
			MOS					10-OCT-2000		New Reqmt	
			DUE NEXT	HRS/MSC	4200						
		REF:	ENC								
R	260169	VISUAL INSPECTION COCKPIT PORTABLE EXTINGUISHER COCKPIT FIRE EXTINGUISHER									F3
	26.060		DAYS	30			06-NOV-2001	06-DEC-2001		OVD	
			HRS/MSC				7774				
		REF: NO REF	AFL				5641				
R	260180	VISUAL INSPECTION CABIN PORTABLE EXTINGUISHER CABIN FIRE EXTINGUISHER									F3
	26.060		DAYS	30			06-NOV-2001	06-DEC-2001		OVD	
			HRS/MSC				7774				
		REF: NO REF	AFL				5641				
R	330228	CHARGE EMERGENCY LIGHT BATTERY									F4
	33.100		MOS	3			06-NOV-2001	06-FEB-2002		OVD	
			HRS/MSC	200			7774	7974		168	
		REF: AMM 12-10-06	AFL				5641				
R	344616	INSPECT EMERGENCY GYRO POWER SUPPLY BATTERY EMERGENCY POWER SUPPLY BATTERY/STAND-BY ATTITUDE GYRO									F5
	34.370		MOS	3			06-NOV-2001	06-FEB-2002		OVD	
			HRS/MSC	200			7774	7974		168	
		REF: AMM NO REF	AFL				5641				
R	320118	INSPECT/LUBRICATE NOSE GEAR ASSEMBLY UPPER/LOWER STRUT BEARINGS BODY									L3
	32.540		MOS	24			22-FEB-2000	22-FEB-2002		OVD	
			HRS/MSC	1200			7107	8307		501	
		REF: AMM 32-20-01	AFL				5232				
R	230400	CLEAN/TEST COCKPIT VOICE RECORDER BEACON									T1
	23.130		MOS	6			06-NOV-2001	06-MAY-2002		OVD	
			HRS/MSC				7774				
		REF: NO REF	AFL				5641				
	270080	X-RAY INSPECT LEFT AILERON CONTROL ROD LEFT AILERON CONTROL ROD ASSEMBLIES									W1
	27.530		MOS	60			16-JUN-1997	16-JUN-2002		1.07	
			HRS/MSC	5000			6135	11135		3329	
		REF: NO REF	AFL				4707				
	270081	X-RAY INSPECT RIGHT AILERON CONTROL ROD ASSEMBLY									W2
	27.535		MOS	60			16-JUN-1997	16-JUN-2002		1.07	
			HRS/MSC	5000			6135	11135		3329	
		REF: NO REF	AFL				4707				
	270150	X-RAY INSPECT RUDDER CONTROL ROD ASSEMBLY									T1
	27.560		MOS	60			16-JUN-1997	16-JUN-2002		1.07	
			HRS/MSC	5000			6135	11135		3329	
		REF: NO REF	AFL				4707				

R - Task was due on previous due lists
(xEXT) - Extension incorporated in the next due calculation

ITEM NO WORK CARD WORK ORDER	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL TIME-----AT-----INSTALLATION				COMPLIANCE WARR EXP	DISPOSITION NEXT DUE		TIME REMAINING OVD = Overdue	AREA PRICE LABOR
			TSN	TSO	TSR	TSR		(ENH)	AFH (xEXT)		
270210 27.570	VISUAL INSPECT ELEVATOR CONTROL BELLCRANK ASSEMBLY REF: AMM 5-10-00	MOS HRS/MSC AFL	60 5000			16-JUN-1997 6135 4707	16-JUN-2002 11135	1.07 3329			
320110 32.560	X-RAY INSPECT NOSE GEAR ASSEMBLY NOSE GEAR SHAFT AND DOOR ASSEMBLIES REF: AMM 5-10-00	MOS HRS/MSC AFL	60 5000			16-JUN-1997 6135 4707	16-JUN-2002 11135	1.07 3329	L3		
260171 26.030	WEIGHT CHECK COCKPIT PORTABLE EXTINGUISHER COCKPIT FIRE EXTINGUISHER REF: AMM 5-10-00	MOS HRS/MSC AFL	12			26-JUN-2001 7687 5594	26-JUN-2002	1.4	F3		
260181 26.030	WEIGHT CHECK CABIN PORTABLE EXTINGUISHER CABIN FIRE EXTINGUISHER REF: AMM 5-10-00	MOS HRS/MSC AFL	12			26-JUN-2001 7687 5594	26-JUN-2002	1.4	F4		
350166U 35.070	CHECK PILOT OXYGEN MASK REF: AMM 35-00-00	MOS HRS/MSC AFL	12 600			26-JUN-2001 7687 5594	26-JUN-2002 8287	1.4 481	F3		
350169U 35.070	CHECK COPILOT OXYGEN MASK REF: AMM 35-00-00	MOS HRS/MSC AFL	12 600			26-JUN-2001 7687 5594	26-JUN-2002 8287	1.4 481	F3		

Total Labor Hours
Total Price :

R - Task was due on previous due lists
(xEXT) - Extension incorporated in the next due calculation

ITEM NO	WORK CARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL TIME-----AT-----INSTALLATION COMPLIANCE				DISPOSITION		TIME REMAINING	AREA PRICE
				TSN	TSO	TSR	WARR EXP	NEXT DUE (ENH) AFH (xEXT)	OVD = Overdue		
R	AD 2002-01-26	TO PREVENT FAILURE OF ATTACHMENT BOLTS DUE TO FATIGUE, WHICH COULD RESULT IN SEPARATION OF THE ENGINE INLET COWL AND AFT NACELLE, AND CONSEQUENT DAMAGE TO THE HORIZONTAL OR VERTICAL STABILIZER AIRWORTHINESS DIRECTIVE							MANDATORY		
			MOS								New Reqmt
		REF:	HRS/MSC	DUE				50			
		AFL									
R	AD 1989-12-08	TO DETECT CRACKS IN THE HINGE LUGS OF THE HORIZONTAL STABILIZER AFT SPAR SPLICE FITTING (HINGE ASSEMBLY) AIRWORTHINESS DIRECTIVE									
			MOS				17-JAN-2001				
		REF: See Workcard	HRS/MSC	300			7494		7794		OVD
		AFL					5466				
R	SB 1124-30-036 PART II	ICE AND RAIN PROTECTION SERVICE BULLETIN									F3
			MOS				26-JUN-2001				
		REF: See Workcard	HRS/MSC	150			7687		7837		31
		AFL					5594				
R	057110U	NO. 1 ENGINE - 150HR #1 ENGINE INSP									
			MOS				26-JUN-2001				
		REF:	HRS/MSC	150			7687		7837		31 1
		ENC									
		(AFL)					5594				
R	057110U	NO. 2 ENGINE - 150HR #2 ENGINE INSP									
			MOS				26-JUN-2001				
		REF:	HRS/MSC	150			7687		7837		31 1
		ENC									
		(AFL)					5594				
R	057120U	NO. 1 ENGINE - 300HR #1 ENGINE INSP									
			MOS				16-FEB-2001				
		REF:	HRS/MSC	300			7551		7851		45 1.5
		ENC									
		(AFL)					5515				
R	057120U	NO. 2 ENGINE - 300HR #2 ENGINE INSP									
			MOS				16-FEB-2001				
		REF:	HRS/MSC	300			7551		7851		45 1.5
		ENC									
		(AFL)					5515				
R	050150U	200 HOUR INSPECTION									
			MOS				26-JUN-2001				
		REF:	HRS/MSC	200			7687		7887		81 31
		AFL					5594				
R	SL WW-2492	HYD HOSE INSP SERVICE LETTER									
			MOS				26-JUN-2001				
		REF:	HRS/MSC	200			7687		7887		81
		AFL					5594				
R	710120 71.010	NO. 2 ENGINE - MAJOR PERIODIC INSPECTION									
			MOS				17-OCT-1998				
		REF: EMM 72-00-00	HRS/MSC	1400			6520		7920		114
		ENC									
		(AFL)					4889				

R - Task was due on previous due lists
(xEXT) - Extension incorporated in the next due calculation

ITEM NO	WORK CARD	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL TIME-----AT-----INSTALLATION				COMPLIANCE	DISPOSITION		TIME	AREA
				TSN	TSO	TSR	WARR EXP		NEXT DUE	(ENH) AFH (xEXT)		
R	724120 72.030	NO. 2 ENGINE - INSPECT COMBUSTION PLENUM CASE	MOS					17-SEP-1998				
		REF: EMM 72-40-04	HRS/MSC	1400				6520	7920		114	
			ENC					4889				
			(AFL)									
R	790120 79.020	NO. 2 ENGINE - CHANGE OIL	MOS					17-OCT-1998				
		REF: EMM 72-00-00	HRS/MSC	1400				6520	7920		114	
			ENC					4889				
			(AFL)									
R	AD 1996-24-11 LEFT AILERON	TO PREVENT EXCESSIVE WEAR OF THE AILERON PUSH-PULL TUBE, WHICH COULD RESULT IN UNEVEN MOVEMENT OF THE CONTROL WHEEL, PERFORATION OF THE AILERON PUSH-PULL TUBE, AND CONSEQUENT REDUCED ROLL CONTROL OF THE AIRPLANE AIRWORTHINESS DIRECTIVE	MOS					26-JUL-2000				W1
		REF: AD	HRS/MSC	600				7325	7925		119	
			AFL					5360				
R	AD 1996-24-11 RIGHT AILERON	TO PREVENT EXCESSIVE WEAR OF THE AILERON PUSH-PULL TUBE, WHICH COULD RESULT IN UNEVEN MOVEMENT OF THE CONTROL WHEEL, PERFORATION OF THE AILERON PUSH-PULL TUBE, AND CONSEQUENT REDUCED ROLL CONTROL OF THE AIRPLANE AIRWORTHINESS DIRECTIVE	MOS					26-JUL-2000				W2
		REF: AD	HRS/MSC	600				7325	7925		119	
			AFL					5360				
R	SB 1124-27-129 LEFT AILERON	FLIGHT CONTROLS SERVICE BULLETIN	MOS					26-JUL-2000				W1
		REF: BULLETINS	HRS/MSC	600				7325	7925		119	
			AFL					5360				
R	SB 1124-27-129 RIGHT AILERON	FLIGHT CONTROLS SERVICE BULLETIN	MOS					26-JUL-2000				W2
		REF: BULLETINS	HRS/MSC	600				7325	7925		119	
			AFL					5360				

Total Labor Hours 36:0

Total Price :

R - Task was due on previous due lists
(xEXT) - Extension incorporated in the next due calculation



Aircraft Model - 1124A WESTWIND

Serial #: 368 Reg. #: N368MD

Maintenance Due List/Time Remaining - AIRCRAFT(AFL)

Report Date 13-MAY-2002

ITEM NO	TASK DESCRIPTION		UNIT	INTERVAL TIME-----AT-----INSTALLATION COMPLIANCE				DISPOSITION		TIME REMAINING	AREA PRICE
	WORK CARD	PART NUMBER/PKG		TSN	TSO	TSR	WARR EXP	NEXT DUE			
	WORK ORDER	SERIAL NUMBER						(ENH)	AFH (xEXT)		
R	SB 972B40U	SERVICE BULLETIN GSB A72-3569 R/E FAN ROTOR									
			MOS								
			HRS/MS	A/R					5722		16
			AFL								

REF:

Total Labor Hours

Total Price :

R - Task was due on previous due lists
(xEXT) - Extension incorporated in the next due calculation



Maintenance Due List/Time Remaining - ENGINE((AFL))

Aircraft Model - 1124A WESTWIND

Report Date 13-MAY-2002

Serial #: 368 Reg. #: N368MD

ITEM NO	TASK DESCRIPTION	UNIT	INTERVAL TIME-----AT-----INSTALLATION				COMPLIANCE	DISPOSITION		TIME REMAINING	AREA PRICE
			TSN	TSO	TSR	WARR EXP		NEXT DUE	(ENH) AFH (xEXT)		
WORK CARD	PART NUMBER/PKG								OVD = Overdue	LABOR	
WORK ORDER	SERIAL NUMBER										
R 725050	NO. 2 ENGINE - CHANGE FAN ROTOR DISC										
72.090	3073539-2	MOS				20-MAY-1993					
	0-18040-4768	HRS/MS	4087			5278					
	REF: NO REF	ENC									
		(AFL)	4100	2660		3928		5368		OVD	
R 725030	NO. 2 ENGINE - CHANGE STAGE 3 LOW PRESSURE TURBINE DISC										
72.060	3072544-2	MOS				31-MAY-1989					
	6-18040-4905	HRS/MS	0			4265					
	REF: NO REF	ENC									
		(AFL)	3000	0		2793		5793		87	

Total Labor Hours
Total Price :

R - Task was due on previous due lists
(xEXT) - Extension incorporated in the next due calculation

OWNER: R&S AIRCRAFT INVESTMENTS, LLC
ADDRESS: P.O. BOX 43 HOUSTON TX 77001-0043
PHONE: 713-830-9584
FAX: 713-918-5925

OPERATOR: R&S AIRCRAFT INVESTMENTS, LLC
ADDRESS: P.O. BOX 43 HOUSTON TX 77001-0043
PHONE: 713-830-9584
FAX: 713-918-5925

PROJECTED : 2 MOS. to 13-SEP-2002

EXTENDED DUE LIST - FOR PLANNING PURPOSES ONLY - Scheduled Work Cards were not issued with this Report.

AIRCRAFT

S/N: 368 **REG NO:** N368MD **MODEL:** 1124A WESTWIND **MANUFACTURER:** GULFSTREAM AEROSPACE CORPORATION

NOTE:
INSPECTION PROGRAM: 3
CERTIFICATE DATE: 11-FEB-1982

UOM	LAST ACTUAL	LAST ACTUAL DATE	PROJECTED
HRS	7806	28-FEB-2002	8034.07
AFL	5706	28-FEB-2002	5934

ENGINE NO. 1

S/N: P-77482 **PART NO:** 3072500-2 **MODEL:** TFE731-3 **MANUFACTURER:** HONEYWELL

INSTALLED DATE: 4/3/1989
A/C HRS: 4215
ENGINE HRS: 3972
ENGINE CYCLES: 2456

UOM	LAST ACTUAL	LAST ACTUAL DATE	PROJECTED
HRS	7806	28-FEB-2002	8034.07
ENC	0		0
(AFL)	5706	28-FEB-2002	5934

ENGINE NO. 2

S/N: P77488 **PART NO:** 3072500-2 **MODEL:** TFE731-3 **MANUFACTURER:** HONEYWELL

INSTALLED DATE: 5/31/1993
A/C HRS: 5278
ENGINE HRS: 5227
ENGINE CYCLES: 3867

UOM	LAST ACTUAL	LAST ACTUAL DATE	PROJECTED
HRS	7806	28-FEB-2002	8034.07
ENC	0		0
(AFL)	5706	28-FEB-2002	5934

Aircraft Model - 1124A WESTWIND

Serial #: 368 Reg. #: N368MD

Report Date 13-MAY-2002

EXTENDED DUE LIST - FOR PLANNING PURPOSE ONLY - Scheduled Work Cards were not issued with this Report.

ITEM NO WORK CARD WORK ORDER	TASK DESCRIPTION PART NUMBER/PKG SERIAL NUMBER	UNIT	INTERVAL TIME-----AT-----INSTALLATION				COMPLIANCE	DISPOSITION		AREA PRICE LABOR
			TSN	TSO	TSR	WARR EXP		NEXT DUE (ENH)	AFH (xEXT)	
R 330228 33.100	CHARGE EMERGENCY LIGHT BATTERY REF: AMM 12-10-06	MOS HRS/MSC AFL	3 200				06-NOV-2001 7774 5641	06-FEB-2002 7974	F4	
R 344616 34.370	INSPECT EMERGENCY GYRO POWER SUPPLY BATTERY EMERGENCY POWER SUPPLY BATTERY/STAND-BY ATTITUDE GYRO REF: AMM NO REF	MOS HRS/MSC AFL	3 200				06-NOV-2001 7774 5641	06-FEB-2002 7974	F5	
SB 1124-55-020 R2	STABILIZERS SERVICE BULLETIN REF: See Workcard	MOS HRS/MSC AFL	300				26-JUN-2001 7687 5594	7987	T1	
SL WW-2494 R3 LEFT	LANDING GEAR SERVICE LETTER REF: See Workcard	MOS HRS/MSC AFL	300				26-JUN-2001 7687 5594	7987	L1	
SL WW-2494 R3 RIGHT	LANDING GEAR SERVICE LETTER REF: See Workcard	MOS HRS/MSC AFL	300				26-JUN-2001 7687 5594	7987	L2	

Total Labor Hours
Total Price :

R - Task was due on previous due lists
(xEXT) - Extension incorporated in the next due calculation

MODEL NAME : 1124A WESTWIND

SERIAL : 368

REG NO : N368MD

Each item on the Insufficient Information report has missing information needed to properly update the items(s). Missing information will be one or more of the following:

*TSN and/or

*Airframe Hours, Landings, Engine Cycles,

*Apu Hours or Starts

*Date of Manufacture

*Date of Expiration

For each item (code number) in the left hand column, please supply the missing information indicated by the question mark under the appropriate column heading, sign the authorization area



Aircraft Model - 1124A WESTWIND

Serial #: 368 Reg. #: N368MD

Insufficient Information Report

Report Date 13-MAY-2002

ITEM NO	TASK DESCRIPTION	UNIT	INTERVAL	TIME	AT	INSTALLATION	COMPLIANCE	NEXT DUE	TIME REMAINING	AREA PRICE
WORK CARD	PART NUMBER/PKG SERIAL NUMBER			TSN	TSO	TSR/TAC Warr Exp				LABOR
230450U	- REPLACE BEACON BATTERY	MOS					17-OCT-1998	?		
	REF: HRS/MSC AFL						6520 4889			
	ENTER MISSING MANUAL NEXTDUE: -----									
270251	CHANGE LEFT INBOARD FLAP ACTUATOR	MOS					16-JUN-1997			W1
27.210	1390T100-5	HRS/MSC	10000	?	?		6135	8329	\$1006.00	
	610A REF: AMM 27-50-00	AFL					4707		8	
	ENTER MISSING TSN HOURS, TSO HOURS: -----									
240116	CHANGE NO. 1 STARTER GENERATOR	MOS					06-NOV-2001			E1
24.010	23065-018-1	HRS/MSC	1000	?	?		7774	968	\$813.00	
	3684 REF: AMM 80-10-00	AFL					5641		1	
	ENTER MISSING TSN HOURS, TSO HOURS: -----									
240126	CHANGE NO. 2 STARTER GENERATOR	MOS					06-NOV-2001			E2
24.010	23065-018-1	HRS/MSC	1000	?	?		7774	968	\$813.00	
	2562 REF: AMM 80-10-00	AFL					5641		1	
	ENTER MISSING TSN HOURS, TSO HOURS: -----									
230207	REPLACE COCKPIT VOICE RECORDER BATTERY	MOS					17-OCT-1998	?		T1
23.130		HRS/MSC					6520			
	REF: NO REF	AFL					4889			
	ENTER MISSING MANUAL NEXTDUE: -----									

AUTHORIZED BY _____

CERT.# _____

DATE _____

A/C Serial No.: 368 A/C Regn No.: N368MD Model:1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

Report Date **13-MAY-2002**

Compliance From 5/01/2001 To 5/13/2002

ITEM NO PART NO.	DESCRIPTION SERIAL NO.	COMPONENT INSTALLED AND/OR SERVICE/INSPECTION COMPLIED				COMPONENT TIMES AFTER REMOVAL			
		C/W	TSN	TSO	TSR	C/W	TSN	TSO	TSR
CHAPTER 24-ELECTRICAL POWER									
240118	INSPECT NO. 1 STARTER GENERATOR								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
240121	CHECK NO. 1 STARTER GENERATOR BRUSH WEAR/TENSION								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
240123	INSPECT NO. 1 STARTER GENERATOR SPLINE								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
240128	INSPECT NO. 2 STARTER GENERATOR								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
240131	CHECK NO. 2 STARTER GENERATOR BRUSH WEAR/TENSION								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
240133	INSPECT NO. 2 STARTER GENERATOR SPLINE								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
240166	DEEP CYCLE LEFT BATTERY								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
240181	DEEP CYCLE RIGHT BATTERY								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
CHAPTER 26-FIRE PROTECTION									
260169	VISUAL INSPECTION COCKPIT PORTABLE EXTINGUISHER COCKPIT FIRE EXTINGUISHER								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
260180	VISUAL INSPECTION CABIN PORTABLE EXTINGUISHER CABIN FIRE EXTINGUISHER								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
CHAPTER 33-LIGHTS									
330228	CHARGE EMERGENCY LIGHT BATTERY								
		MOS	6/26/2001						
		HRS	7687						
		AFL	5594						
						TECH :		INSP :	
								LABOR HRS :	
								SERVICE REMARKS	--
CHAPTER 34-NAVIGATION									
344616	INSPECT EMERGENCY GYRO POWER SUPPLY BATTERY EMERGENCY POWER SUPPLY BATTERY/STAND-BY ATTITUDE GYRO								

A/C Serial No.: 368 A/C Regn No.: N368MD Model:1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC

Report Date **13-MAY-2002**

Compliance From 5/01/2001 To 5/13/2002

ITEM NO PART NO.	DESCRIPTION SERIAL NO.	COMPONENT INSTALLED AND/OR SERVICE/INSPECTION COMPLIED				COMPONENT TIMES AFTER REMOVAL				TECH :	INSP :	LABOR HRS :	SERVICE REMARKS
		C/W	TSN	TSO	TSR	C/W	TSN	TSO	TSR				
		MOS	6/26/2001										
		HRS	7687										
		AFL	5594										

Aircraft Model - 1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

C/W DATA
THE FOLLOWING INFORMATION IS ACCURATE AND CURRENT TO THE BEST KNOWLEDGE AND ABILITY OF CSI
HOWEVER, CAMP SHALL NOT BE RESPONSIBLE OR LIABLE FOR ANY ERRORS CONTAINED IN THIS REPORT.

ITEM NO EFFECTIVE DATE	DISPOSITION REQ TYPE	TASK DESCRIPTION	VALUE	METHOD	C/W DATE
AIRCRAFT					
AD 1974-08-09 R2		AIRWORTHINESS DIRECTIVE TO PREVENT POSSIBLE FIRES THAT COULD RESULT FROM SMOKING MATERIALS BEING DROPPED INTO LAVATORY PAPER OR LINEN WASTE RECEPTACLES	OPEN		01/17/2001
	REPEAT				
AD 1989-12-08		AIRWORTHINESS DIRECTIVE TO DETECT CRACKS IN THE HINGE LUGS OF THE HORIZONTAL STABILIZER AFT SPAR SPLICE FITTING (HINGE ASSEMBLY)	OPEN		01/17/2001
	REPEAT				
AD 1996-24-11 LEFT AILERON		AIRWORTHINESS DIRECTIVE TO PREVENT EXCESSIVE WEAR OF THE AILERON PUSH-PULL TUBE, WHICH COULD RESULT IN UNEVEN MOVEMENT OF THE CONTROL WHEEL, PERFORATION OF THE AILERON PUSH-PULL TUBE, AND CONSEQUENT REDUCED ROLL CONTROL OF THE AIRPLANE	OPEN		07/26/2000
	REPEAT				
AD 1996-24-11 RIGHT AILERON		AIRWORTHINESS DIRECTIVE TO PREVENT EXCESSIVE WEAR OF THE AILERON PUSH-PULL TUBE, WHICH COULD RESULT IN UNEVEN MOVEMENT OF THE CONTROL WHEEL, PERFORATION OF THE AILERON PUSH-PULL TUBE, AND CONSEQUENT REDUCED ROLL CONTROL OF THE AIRPLANE	OPEN		07/26/2000
	REPEAT				
AD 1998-06-10		AIRWORTHINESS DIRECTIVE TO PREVENT FAILURE OF THE HYDRAULIC FUSE TO OPERATE PROPERLY IN THE EVENT OF AN EXTERNAL LEAK DOWNSTREAM OF THE FUSE, WHICH COULD RESULT IN LOSS OF HYDRAULIC SYSTEMS	OPEN		11/06/2001
	REPEAT				
AD 99010U		AIRWORTHINESS DIRECTIVE AD72-19-04			02/03/1982
AD 99045U		AIRWORTHINESS DIRECTIVE AD80-16-04	NOT APPLICABLE	N/A	08/07/1980
AD 99048U		AIRWORTHINESS DIRECTIVE AD80-18-08	COMPLIED WITH	C/W	02/05/1985
AD 99050U		AIRWORTHINESS DIRECTIVE AD80-19-15	NOT APPLICABLE	N/A	09/11/1980
AD 99070U		AIRWORTHINESS DIRECTIVE AD81-07-07 PARA A	NOT APPLICABLE	N/A	01/03/1985
AD 99075U		AIRWORTHINESS DIRECTIVE AD81-07-07 PARA B	NOT APPLICABLE	N/A	01/03/1985
AD 99085U		AIRWORTHINESS DIRECTIVE AD81-24-08 #1 ENGINE	NOT APPLICABLE	N/A	07/12/1991
AD 99090U		AIRWORTHINESS DIRECTIVE AD81-24-08 #2 ENGINE	NOT APPLICABLE	N/A	01/08/1982
AD 990100U		AIRWORTHINESS DIRECTIVE AD84-02-08	NOT APPLICABLE	N/A	04/10/1990
AD 990120U		AIRWORTHINESS DIRECTIVE AD86-03-01 #1 ENGINE	NOT APPLICABLE	N/A	07/28/1986
AD 990130U		AIRWORTHINESS DIRECTIVE AD86-14-02			01/20/1989
AD 990165U		AIRWORTHINESS DIRECTIVE AD88-18-03 #1 ENGINE	COMPLIED WITH	C/W	01/20/1989
AD 990166U		AIRWORTHINESS DIRECTIVE AD88-18-03 #2 ENGINE	COMPLIED WITH	C/W	01/20/1989
AD 990821U		AIRWORTHINESS DIRECTIVE AD82-23-03 R1 #1 ENGINE	NOT APPLICABLE	N/A	11/13/1999
AD 990822U		AIRWORTHINESS DIRECTIVE AD82-23-03 R1 #2 ENGINE			05/17/1989
AD 990960U		AIRWORTHINESS DIRECTIVE AD89-02-10R1	NOT APPLICABLE	N/A	
AD 990980U		AIRWORTHINESS DIRECTIVE AD90-03-02	NOT APPLICABLE	N/A	03/21/1990

Aircraft Model - 1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

C/W DATA
THE FOLLOWING INFORMATION IS ACCURATE AND CURRENT TO THE BEST KNOWLEDGE AND ABILITY OF CSI
HOWEVER, CAMP SHALL NOT BE RESPONSIBLE OR LIABLE FOR ANY ERRORS CONTAINED IN THIS REPORT.

ITEM NO	EFFECTIVE DATE	DISPOSITION REQ TYPE	TASK DESCRIPTION	VALUE	METHOD	C/W DATE
AD 990982U			AIRWORTHINESS DIRECTIVE AD90-03-04 #1 ENGINE	NOT APPLICABLE	N/A	03/21/1990
AD 990983U			AIRWORTHINESS DIRECTIVE AD90-03-04 #2 ENGINE	NOT APPLICABLE	N/A	03/21/1990
AD 990985U			AIRWORTHINESS DIRECTIVE AD90-10-04 LEFTAILERON	NOT APPLICABLE	N/A	11/01/1992
AD 990986U			AIRWORTHINESS DIRECTIVE AD90-10-04 RIGHTAILERON	NOT APPLICABLE	N/A	11/01/1992
AD 990987U			AIRWORTHINESS DIRECTIVE AD90-14-06	COMPLIED WITH	CW	06/19/1991
AD 990988U			AIRWORTHINESS DIRECTIVE AD90-07-08R1	NOT APPLICABLE	N/A	07/11/1990
AD 991020U			AIRWORTHINESS DIRECTIVE AD91-08-13 #1 ENGINE			04/26/1994
AD 991030U			AIRWORTHINESS DIRECTIVE AD91-08-13 #2 ENGINE			05/31/1993
AD 991040U			AIRWORTHINESS DIRECTIVE AD91-13-08	COMPLIED WITH	CW	11/09/1996
AD 991065U			AIRWORTHINESS DIRECTIVE AD92-12-09 #1 ENGINE	COMPLIED WITH	CW	06/23/1992
AD 991070U			AIRWORTHINESS DIRECTIVE AD92-12-02 LEFTAILERON	COMPLIED WITH	CW	11/01/1992
AD 991071U			AIRWORTHINESS DIRECTIVE AD92-12-02 RIGHTAILERON	COMPLIED WITH	CW	11/01/1992
AD 991090U			AIRWORTHINESS DIRECTIVE AD92-26-09 #1 ENGINE	NOT APPLICABLE	N/A	09/30/1993
AD 991091U			AIRWORTHINESS DIRECTIVE AD92-26-09 #2 ENGINE	NOT APPLICABLE	N/A	04/26/1994
AD 991100U			AIRWORTHINESS DIRECTIVE AD93-04-02 PARA A	NOT APPLICABLE	N/A	04/19/1993
AD 991105U			AIRWORTHINESS DIRECTIVE AD93-04-02 PARA B	NOT APPLICABLE	N/A	04/19/1993
AD 991115U		SUPERSEDED	AIRWORTHINESS DIRECTIVE AD93-10-10 #1 ENGINE	OPEN		09/29/1993
AD 991120U		SUPERSEDED	AIRWORTHINESS DIRECTIVE AD93-10-10 #2 ENGINE	OPEN		09/29/1993
AD 991350U			AIRWORTHINESS DIRECTIVE AD93-25-16 #1 ENGINE	NOT APPLICABLE	N/A	04/26/1994
AD 991351U			AIRWORTHINESS DIRECTIVE AD93-25-16 #2 ENGINE	NOT APPLICABLE	N/A	03/07/1994
AD 991370U			AIRWORTHINESS DIRECTIVE AD94-07-03 PARA A	NOT APPLICABLE	N/A	07/27/1994
AD 991400U			AIRWORTHINESS DIRECTIVE AD94-21-06	NOT APPLICABLE	N/A	02/21/1995
AD 991510U			AIRWORTHINESS DIRECTIVE AD95-22-01	COMPLIED WITH	CW	07/26/2000
AD 991570U			AIRWORTHINESS DIRECTIVE AD97-05-03R1	NOT APPLICABLE	N/A	06/16/1997
AD 991580U			AIRWORTHINESS DIRECTIVE AD97-04-03 #1 ENGINE	NOT APPLICABLE	N/A	10/17/1998
AD 991581U			AIRWORTHINESS DIRECTIVE AD97-04-03 #2 ENGINE	NOT APPLICABLE	N/A	10/17/1998
AD 991590U			AIRWORTHINESS DIRECTIVE AD97-11-10	NOT APPLICABLE	N/A	10/17/1998

Aircraft Model - 1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

C/W DATA
THE FOLLOWING INFORMATION IS ACCURATE AND CURRENT TO THE BEST KNOWLEDGE AND ABILITY OF CSI
HOWEVER, CAMP SHALL NOT BE RESPONSIBLE OR LIABLE FOR ANY ERRORS CONTAINED IN THIS REPORT.

ITEM NO	EFFECTIVE DATE	DISPOSITION	TASK DESCRIPTION	VALUE	METHOD	C/W DATE
		REQ TYPE				
AD	991610U	SUPERSEDED	AIRWORTHINESS DIRECTIVE AD98-05-09	OPEN		10/17/1998
AD	991620U	MANDATORY	AIRWORTHINESS DIRECTIVE AD98-17-01 R1 L/E	NOT APPLICABLE	N/A	10/06/1998
AD	991625U	MANDATORY	AIRWORTHINESS DIRECTIVE AD98-17-01 R1 R/E	NOT APPLICABLE	N/A	10/06/1998
AD	991634U		AIRWORTHINESS DIRECTIVE AD98-20-35 PART 1	OPEN		04/07/1998
AD	991635U	MANDATORY	AIRWORTHINESS DIRECTIVE AD98-20-35 PART 2	COMPLIED WITH	C/W	04/06/1998
AD	991640U	MANDATORY	AIRWORTHINESS DIRECTIVE AD98-25-10	OPEN		04/07/1999
AD	991645U	MANDATORY	AIRWORTHINESS DIRECTIVE AD98-25-02	OPEN		04/07/1999
AD	991755U	MANDATORY	AIRWORTHINESS DIRECTIVE AD99-08-21	OPEN		10/27/1999
AD	991765U		AIRWORTHINESS DIRECTIVE AD99-18-08	OPEN		10/17/1998
AD	991770U		AIRWORTHINESS DIRECTIVE AD99-23-22 R2			02/22/2000
AD	991775U	MANDATORY	AIRWORTHINESS DIRECTIVE AD98-25-10 R1	OPEN		02/22/2000
AD	991845U	MANDATORY	AIRWORTHINESS DIRECTIVE AD2000-23-13			01/17/2001
AD	991850U	MANDATORY	AIRWORTHINESS DIRECTIVE AD2001-03-01			11/06/2001
AD	991855U	MANDATORY	AIRWORTHINESS DIRECTIVE AD2001-15-17			11/06/2001
SB	1124-27-129 LEFT AILERON		SERVICE BULLETIN FLIGHT CONTROLS	OPEN		07/26/2000
		REPEAT				
SB	1124-27-129 RIGHT AILERON		SERVICE BULLETIN FLIGHT CONTROLS	OPEN		07/26/2000
		REPEAT				
SB	1124-30-036 PART II		SERVICE BULLETIN ICE AND RAIN PROTECTION	OPEN		06/26/2001
		REPEAT				
SB	1124-32-139 UPPER		SERVICE BULLETIN LANDING GEAR	OPEN		07/26/2000
		REPEAT				
SB	1124-55-020 R2		SERVICE BULLETIN STABILIZERS	OPEN		06/26/2001
		REPEAT				
SB	900280 30-JAN-02		SERVICE BULLETIN SB WW 24-28A	OPEN		02/22/2000
SB	910100U		SERVICE BULLETIN SB1124-27-100R2 L/H RODS	NOT APPLICABLE	N/A	11/01/1992
SB	910101U		SERVICE BULLETIN SB1124-27-100R2 R/H RODS			11/01/1992
SB	910210U		SERVICE BULLETIN SB1124-55-021 REV 3			10/13/1985
SB	910911U		SERVICE BULLETIN SB 1124-71-091 PART II	COMPLIED WITH	C/W	04/12/1989
SB	910912U		SERVICE BULLETIN SB 1124-71-091 PART II	COMPLIED WITH	C/W	05/31/1989
SB	910970U		SERVICE BULLETIN SB 1124-55-097STAB SCISSR	NOT APPLICABLE	N/A	04/30/1990

Aircraft Model - 1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

C/W DATA
THE FOLLOWING INFORMATION IS ACCURATE AND CURRENT TO THE BEST KNOWLEDGE AND ABILITY OF CSI
HOWEVER, CAMP SHALL NOT BE RESPONSIBLE OR LIABLE FOR ANY ERRORS CONTAINED IN THIS REPORT.

ITEM NO	EFFECTIVE DATE	DISPOSITION	TASK DESCRIPTION	VALUE	METHOD	C/W DATE
		REQ TYPE				
SB	911160U		SERVICE BULLETIN SB1124-32-116 L/G NW STR	COMPLIED WITH	CW	06/01/1995
SB	911190U		SERVICE BULLETIN SB1124-26-119 FIRE EXTGHR	COMPLIED WITH	CW	09/29/1993
SB	911230U		SERVICE BULLETIN SB1124-53-123 DRAIN/CABIN	OPEN		10/26/1999
SB	911320U	MANDATORY	SERVICE BULLETIN SB1124-29-132 HYD FUS TST	COMPLIED WITH	CW	
SB	911330U	MANDATORY	SERVICE BULLETIN SB1124-27-133R1 INSP HORZ	COMPLIED WITH	CW	11/09/1996
SB	911340U	MANDATORY	SERVICE BULLETIN ASB1124-78A-134	OPEN		10/26/1999
SB	911360U		SERVICE BULLETIN SB1124-27-136 HORZ TRIM	OPEN		04/07/1998
SB	911380U	MANDATORY	SERVICE BULLETIN ASB1124-54A-138	OPEN		11/06/2001
SB	911400U	MANDATORY	SERVICE BULLETIN ASB 1124-29A-140	COMPLIED WITH	CW	10/06/1998
SB	911470U	MANDATORY	SERVICE BULLETIN ASB1124-27A-147	OPEN		01/17/2001
SB	950911U		SERVICE BULLETIN SL WW-2491 REV 1 NLG BRGS	OPEN		02/22/2000
SB	951030U		SERVICE BULLETIN SL WW-24103 L/H			08/15/1988
SB	951031U		SERVICE BULLETIN SL WW-24103 R/H			08/15/1988
SB	960078U		SERVICE BULLETIN SIL1124-21-078 R2 35D SEN			11/13/1995
SB	971279U		SERVICE BULLETIN TFE731-72-3640 R3 ENG #1	NOT APPLICABLE	N/A	11/13/1999
SB	971280U	RECOMMENDED	SERVICE BULLETIN TFE731-72-3640 R3 ENG #2			10/26/1999
SB	972200U		SERVICE BULLETIN TFE731-A72-3388 LEFT ENG	NOT APPLICABLE	N/A	12/05/1989
SB	972202U		SERVICE BULLETIN TFE731-A72-3388 RIGHT ENG	NOT APPLICABLE	N/A	12/05/1989
SB	972655U		SERVICE BULLETIN GSBA72-3328 R5 LEFT ENG	NOT APPLICABLE	N/A	10/31/1995
SB	972656U		SERVICE BULLETIN GSBA72-3328 R5 RIGHT ENG	NOT APPLICABLE	N/A	10/31/1995
SB	972847U		SERVICE BULLETIN GSB TFE 731-A72-3432 L/H	NOT APPLICABLE	N/A	07/05/2000
SB	972848U		SERVICE BULLETIN GSB TFE 731-A72-3432 R/H	NOT APPLICABLE	N/A	06/07/1991
SB	972A03U		SERVICE BULLETIN G/SB72-3502 #1 ENGINE	COMPLIED WITH	CW	05/31/1993
SB	972A04U		SERVICE BULLETIN G/SB72-3502 #2 ENGINE	COMPLIED WITH	CW	05/31/1993
SB	972A07U		SERVICE BULLETIN G/SBA72-3504 L/ENG REV 1	NOT APPLICABLE	N/A	02/25/1994
SB	972A08U		SERVICE BULLETIN G/SBA72-3504 R/ENG REV 1	NOT APPLICABLE	N/A	02/25/1994
SB	972A87U		SERVICE BULLETIN SB TFE731-A72-3544 LH ENG	NOT APPLICABLE	N/A	02/17/1994

Aircraft Model - 1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

C/W DATA
THE FOLLOWING INFORMATION IS ACCURATE AND CURRENT TO THE BEST KNOWLEDGE AND ABILITY OF CSI
HOWEVER, CAMP SHALL NOT BE RESPONSIBLE OR LIABLE FOR ANY ERRORS CONTAINED IN THIS REPORT.

ITEM NO	DISPOSITION	TASK DESCRIPTION	VALUE	METHOD	C/W DATE
EFFECTIVE DATE	REQ TYPE				
SB 972A88U		SERVICE BULLETIN SB TFE731-A72-3544 RH ENG	NOT APPLICABLE	N/A	02/17/1994
SB 972B07U		SERVICE BULLETIN G/SBA72-3504 L/ENG REV 1	NOT APPLICABLE	N/A	09/30/1993
SB 972B08U		SERVICE BULLETIN G/SBA72-3504 R/ENG REV 1	NOT APPLICABLE	N/A	09/30/1993
SB 972B13U	RECOMMENDED	SERVICE BULLETIN REPL LE 1ST STG LP TURB	NOT APPLICABLE	N/A	07/27/1994
SB 972B14U	RECOMMENDED	SERVICE BULLETIN REPL LE 2ND STG LP TURB	NOT APPLICABLE	N/A	07/27/1994
SB 972B15U	RECOMMENDED	SERVICE BULLETIN REPL RE 1ST STG LP TURB	NOT APPLICABLE	N/A	07/27/1994
SB 972B16U	RECOMMENDED	SERVICE BULLETIN REPL RE 2ND STG LP TURB	NOT APPLICABLE	N/A	07/27/1994
SB 972B39U		SERVICE BULLETIN GSBA72-3569 L/E FAN ROTOR	NOT APPLICABLE	N/A	11/13/1999
SB 972B53U		SERVICE BULLETIN GSBA72-3578 LEFT ENGINE	NOT APPLICABLE	N/A	10/31/1995
SB 972B54U		SERVICE BULLETIN GSBA72-3578 RIGHT ENGINE	NOT APPLICABLE	N/A	10/31/1995
SB 973241U		SERVICE BULLETIN GSB 73-3121 L/E FUEL CONT	NOT APPLICABLE	N/A	03/07/1994
SB 973242U		SERVICE BULLETIN GSB 73-3121 R/E FUEL CONT	NOT APPLICABLE	N/A	03/07/1994
SB 973636U		SERVICE BULLETIN SB731-A72-3636R1 L/E	OPEN		10/17/1998
SB 973665U		SERVICE BULLETIN SB731-A72-3636R1 R/E	OPEN		10/17/1998
SB 977039U		SERVICE BULLETIN SBTFE731-A77-3020 L/H	NOT APPLICABLE	N/A	06/11/1991
SB 977040U		SERVICE BULLETIN SBTFE 731-A77-3020 R/H	NOT APPLICABLE	N/A	06/11/1991
SL WW-2492	REPEAT	SERVICE LETTER HYD HOSE INSP	OPEN		06/26/2001
SL WW-2494 R3 LEFT	REPEAT	SERVICE LETTER LANDING GEAR	OPEN		06/26/2001
SL WW-2494 R3 RIGHT	REPEAT	SERVICE LETTER LANDING GEAR	OPEN		06/26/2001

Aircraft Model - 1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date 13-MAY-2002

C/W DATA
THE FOLLOWING INFORMATION IS ACCURATE AND CURRENT TO THE BEST KNOWLEDGE AND ABILITY OF CSI
HOWEVER, CAMP SHALL NOT BE RESPONSIBLE OR LIABLE FOR ANY ERRORS CONTAINED IN THIS REPORT.

ITEM NO	EFFECTIVE DATE	DISPOSITION	TASK DESCRIPTION	VALUE	METHOD	C/W DATE
		REQ TYPE				
ENGINE NO. 1						
AD	990100U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD86-11-05 #1 ENGINE	OPEN		04/26/1994
AD	990101U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD90-24-06 #1 ENGINE	NOT APPLICABLE	N/A	06/11/1991
AD	990102U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD92-21-06 #1 ENGINE	NOT APPLICABLE	N/A	12/28/1992
AD	990103U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD94-07-03 #1 ENGINE	NOT APPLICABLE	N/A	07/27/1994
AD	990104U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD95-07-02 #1E #1 LPT DSK	NOT APPLICABLE	N/A	09/26/1995
AD	990105U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD95-07-02 #1E #2 LPT DSK	NOT APPLICABLE	N/A	09/26/1995
AD	990106U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD96-04-01 #1 ENGINE	NOT APPLICABLE	N/A	03/27/1996
AD	990107U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD96-05-03 #1 ENGINE	NOT APPLICABLE	N/A	07/05/2000
AD	990108U		NO. 1 ENGINE - AIRWORTHINESS DIRECTIVE AD96-18-13 #1 ENGINE	NOT APPLICABLE	N/A	11/13/1999

Aircraft Model - 1124A WESTWIND
Owner Name - R&S AIRCRAFT INVESTMENTS, LLC
A/C Serial #: 368 A/C Reg. #: N368MD

Report Date **13-MAY-2002**

C/W DATA
THE FOLLOWING INFORMATION IS ACCURATE AND CURRENT TO THE BEST KNOWLEDGE AND ABILITY OF CSI
HOWEVER, CAMP SHALL NOT BE RESPONSIBLE OR LIABLE FOR ANY ERRORS CONTAINED IN THIS REPORT.

ITEM NO	DISPOSITION	TASK DESCRIPTION	VALUE	METHOD	C/W DATE
EFFECTIVE DATE	REQ TYPE				
ENGINE NO. 2					
AD 990101U		NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE AD90-24-06 #2 ENGINE	NOT APPLICABLE	N/A	06/11/1991
AD 990102U		NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE AD92-21-06 #2 ENGINE	COMPLIED WITH	CW	01/25/1993
AD 990103U		NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE AD94-07-03 #2 ENGINE	NOT APPLICABLE	N/A	07/27/1994
AD 990104U		NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE AD95-07-02 #2E #2 LPT DSK	NOT APPLICABLE	N/A	09/26/1995
AD 990105U		NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE AD95-07-02 #2E #1 LPT DSK	NOT APPLICABLE	N/A	09/26/1995
AD 990106U		NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE AD96-04-01 #2 ENGINE	NOT APPLICABLE	N/A	10/06/1998
AD 990107U		NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE AD96-05-03 #2 ENGINE	NOT APPLICABLE	N/A	03/27/1996
AD 990108U		NO. 2 ENGINE - AIRWORTHINESS DIRECTIVE AD96-18-13 #2 ENGINE			10/06/1998